


Service Manual

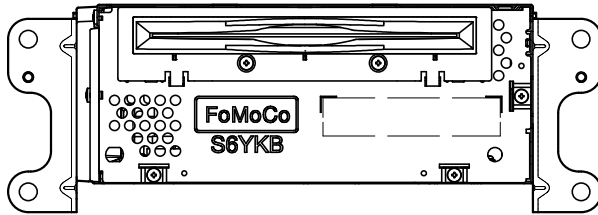

Ford Motor Genuine
 Satellite Digital Audio Radio
 AM/FM/ Tuner CD Player

Model **PU-3253L-N**
 (Genuine No. BB5T-19C107-CN)

Model **PU-3253L-P**
 (Genuine No. BB5T-19C107-CP)

Model **PU-3253L-S**
 (Genuine No. BB5T-19C107-CS)

Information on updated model



This product is a lead free model.
 Lead free solder is used in PWB stamped LF mark.
 Please keep the following conditions when you repair.

1. Use lead free solder.
 - * Koki's lead free solder S3X-55M 0.6mm
 (CLARION Parts No.642-0231-01)
 - * Koki's lead free solder S3X-55M 1.0mm
 (CLARION Parts No.642-0231-02)
2. Use a nitrogen solder system.
3. Do not use "General solder" and "Lead free solder" together.

ORIGINAL MODEL

The original model of PU-3253L-N/P/S is PU-3253L-M.

Original model	Manual No.
PU-3253L-M	298-6811-00

< Update >

PU-3253L-M (BB5T-19C107-CM)
 => **PU-3253L-N** (BB5T-19C107-CN)
 => **PU-3253L-P** (BB5T-19C107-CP)
 => **PU-3253L-S** (BB5T-19C107-CS)

< Difference of software >

The software of E2PROM and the microcomputer was changed.

< Difference of hardware >

- * SETPLATE
 - PU-3253L-M: P/No. 276-0681-55
 - PU-3253L-N: P/No. 276-0681-61
 - PU-3253L-P: P/No. 276-0681-70
 - PU-3253L-S: P/No. 276-0681-77
- * TUNER PACK(Sirius) BL101
 - PU-3253L-M: P/No. 941-0240-21
 - PU-3253L-N: P/No. 941-0240-21
 - PU-3253L-P: P/No. 941-0240-22
 - PU-3253L-S: P/No. 941-0240-22
- * TUNER PACK(HD) BL102
 - PU-3253L-M: P/No. 941-0239-51
 - PU-3253L-N: P/No. 941-0239-52
 - PU-3253L-P: P/No. 941-0239-52
 - PU-3253L-S: P/No. 941-0239-52