
Clarion Co., Ltd.
7-2, Shintoshin, Chuo-ku, Saitama-shi, Saitama 330-0081 Japan
Service Dept.: 7-2, Shintoshin, Chuo-ku, Saitama-shi, Saitama 330-0081 Japan
Tel: +81-48-601-3705 FAX: +81-48-601-3804

Published by Service Dept.
298-7072-00 Sep.2011
Printed in Japan

Service Manual

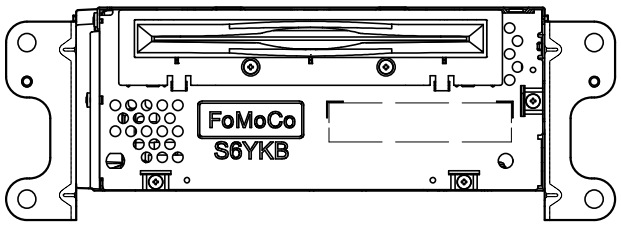

Ford Motor Genuine
SAT/FM/AM/ Radio Tuner
1CD Player

Model PU-3457L-C
(Genuine No. CB5T-19C107-BC)

NEW MODEL INFORMATION

LF

This product is a lead free model.
Lead free solder is used in PWB stamped LF mark.
Please keep the following conditions when you repair.

1. Use lead free solder.
   * Koki's lead free solder S3X-55M 0.6mm
   (CLARION Parts No.642-0231-01)
   * Koki's lead free solder S3X-55M 1.0mm
   (CLARION Parts No.642-0231-02)
2. Use a nitrogen solder system.
3. Do not use "General solder" and "Lead free solder" together.

NOTES

* The tuner of this unit is DSP type. The special equipment is necessary for an accurate adjustment of DSP tuner.
* This product includes technology owned by Microsoft Corporation and cannot be used or distributed without a license from MSLGP.
* Specification and design are subject to change without notice for further improvement.

ORIGINAL MODEL

The original model of PU-3457L-C is PU-3457L-B.

Original model	Manual No.
PU-3457L-B	298-6983-00

< Points of difference >
Genuine number
PU-3457L-B : CT4T-19C107-BB
PU-3457L-C : CT4T-19C107-BC
Setplate
PU-3457L-B : P/No. 276-0919-20
PU-3457L-C : P/No. 276-0919-40
Tuner(SIRI) Block BL101
PU-3457L-B : P/No. 941-0240-22
PU-3457L-C : P/No. 941-0240-24
Software
* Combination Software of IC301
* EEPROM Data of IC302