
Clarion Co., Ltd.
7-2, Shintoshin, Chuo-ku, Saitama-shi, Saitama 330-0081 Japan
Service Dept.: 7-2, Shintoshin, Chuo-ku, Saitama-shi, Saitama 330-0081 Japan
Tel: +81-48-601-3705 FAX: +81-48-601-3804

Published by Service Dept.
298-6810-00 Sep.2010
Printed in Japan

Service Manual

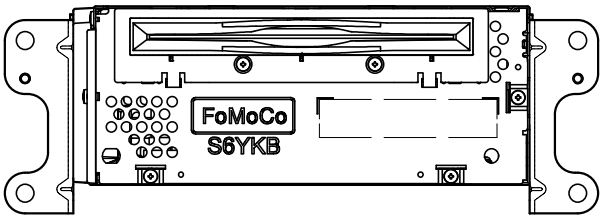

Ford Motor Genuine
Satellite Digital Audio Radio
AM/FM/ Tuner CD Player

Model **PU-3252L-M**
(Genuine No. BB5T-19C107-BM)

ORIGINAL SERVICE MANUAL

The original model of PU-3252L-M is PU-3208L-M. This additional service manual is designed to be used together with the service manual of PU-3208L-M.

Original model	Manual No.
PU-3208L-M	298-6787-00

NOTE:The software of PU-3252L-M is different with PU-3208L-M's.

COMPONENT

PU-3252L-M

1. Main unit ---------- 1

EXPLODED VIEW/PARTS LIST

The following parts are different from the original model.
Other parts are the same as PU-3208L-M.
Please refer to page 10 to 11 of the original manual.

Main section

NO.	PART NO.	DESCRIPTION	Q'TY
21	276-0681-54	SETPLATE	1

ELECTRICAL PARTS LIST


The following parts are different from the original model.
Other parts are the same as PU-3208L-M.
Please refer to page 13 to 16 of the original manual.

Main PWB(B1) section

REF No.	PART No.	DESCRIPTION
D606	001-4315-51	MMBZ27VCLT1G
D607	001-4315-51	MMBZ27VCLT1G
D651	001-4315-51	MMBZ27VCLT1G
D652	001-4315-51	MMBZ27VCLT1G
PWB	039-3790-00	PWB(WITHOUT COMPONENT)

CAUTIONS

Use of controls,adjustment or performance of procedures other than those specified herein,may result in hazardous radiation exposure.
The compact disc player should not be adjusted or repaired by anyone except properly qualified service personnel.

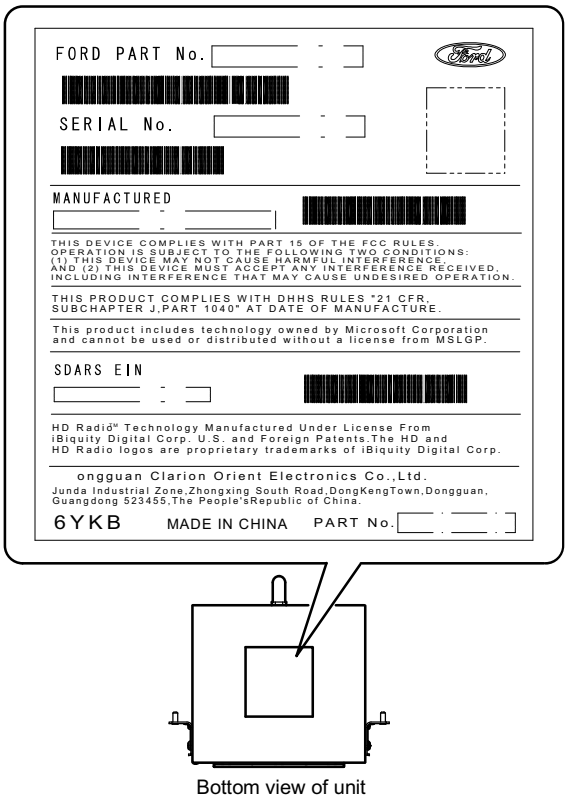

Bottom view of unit