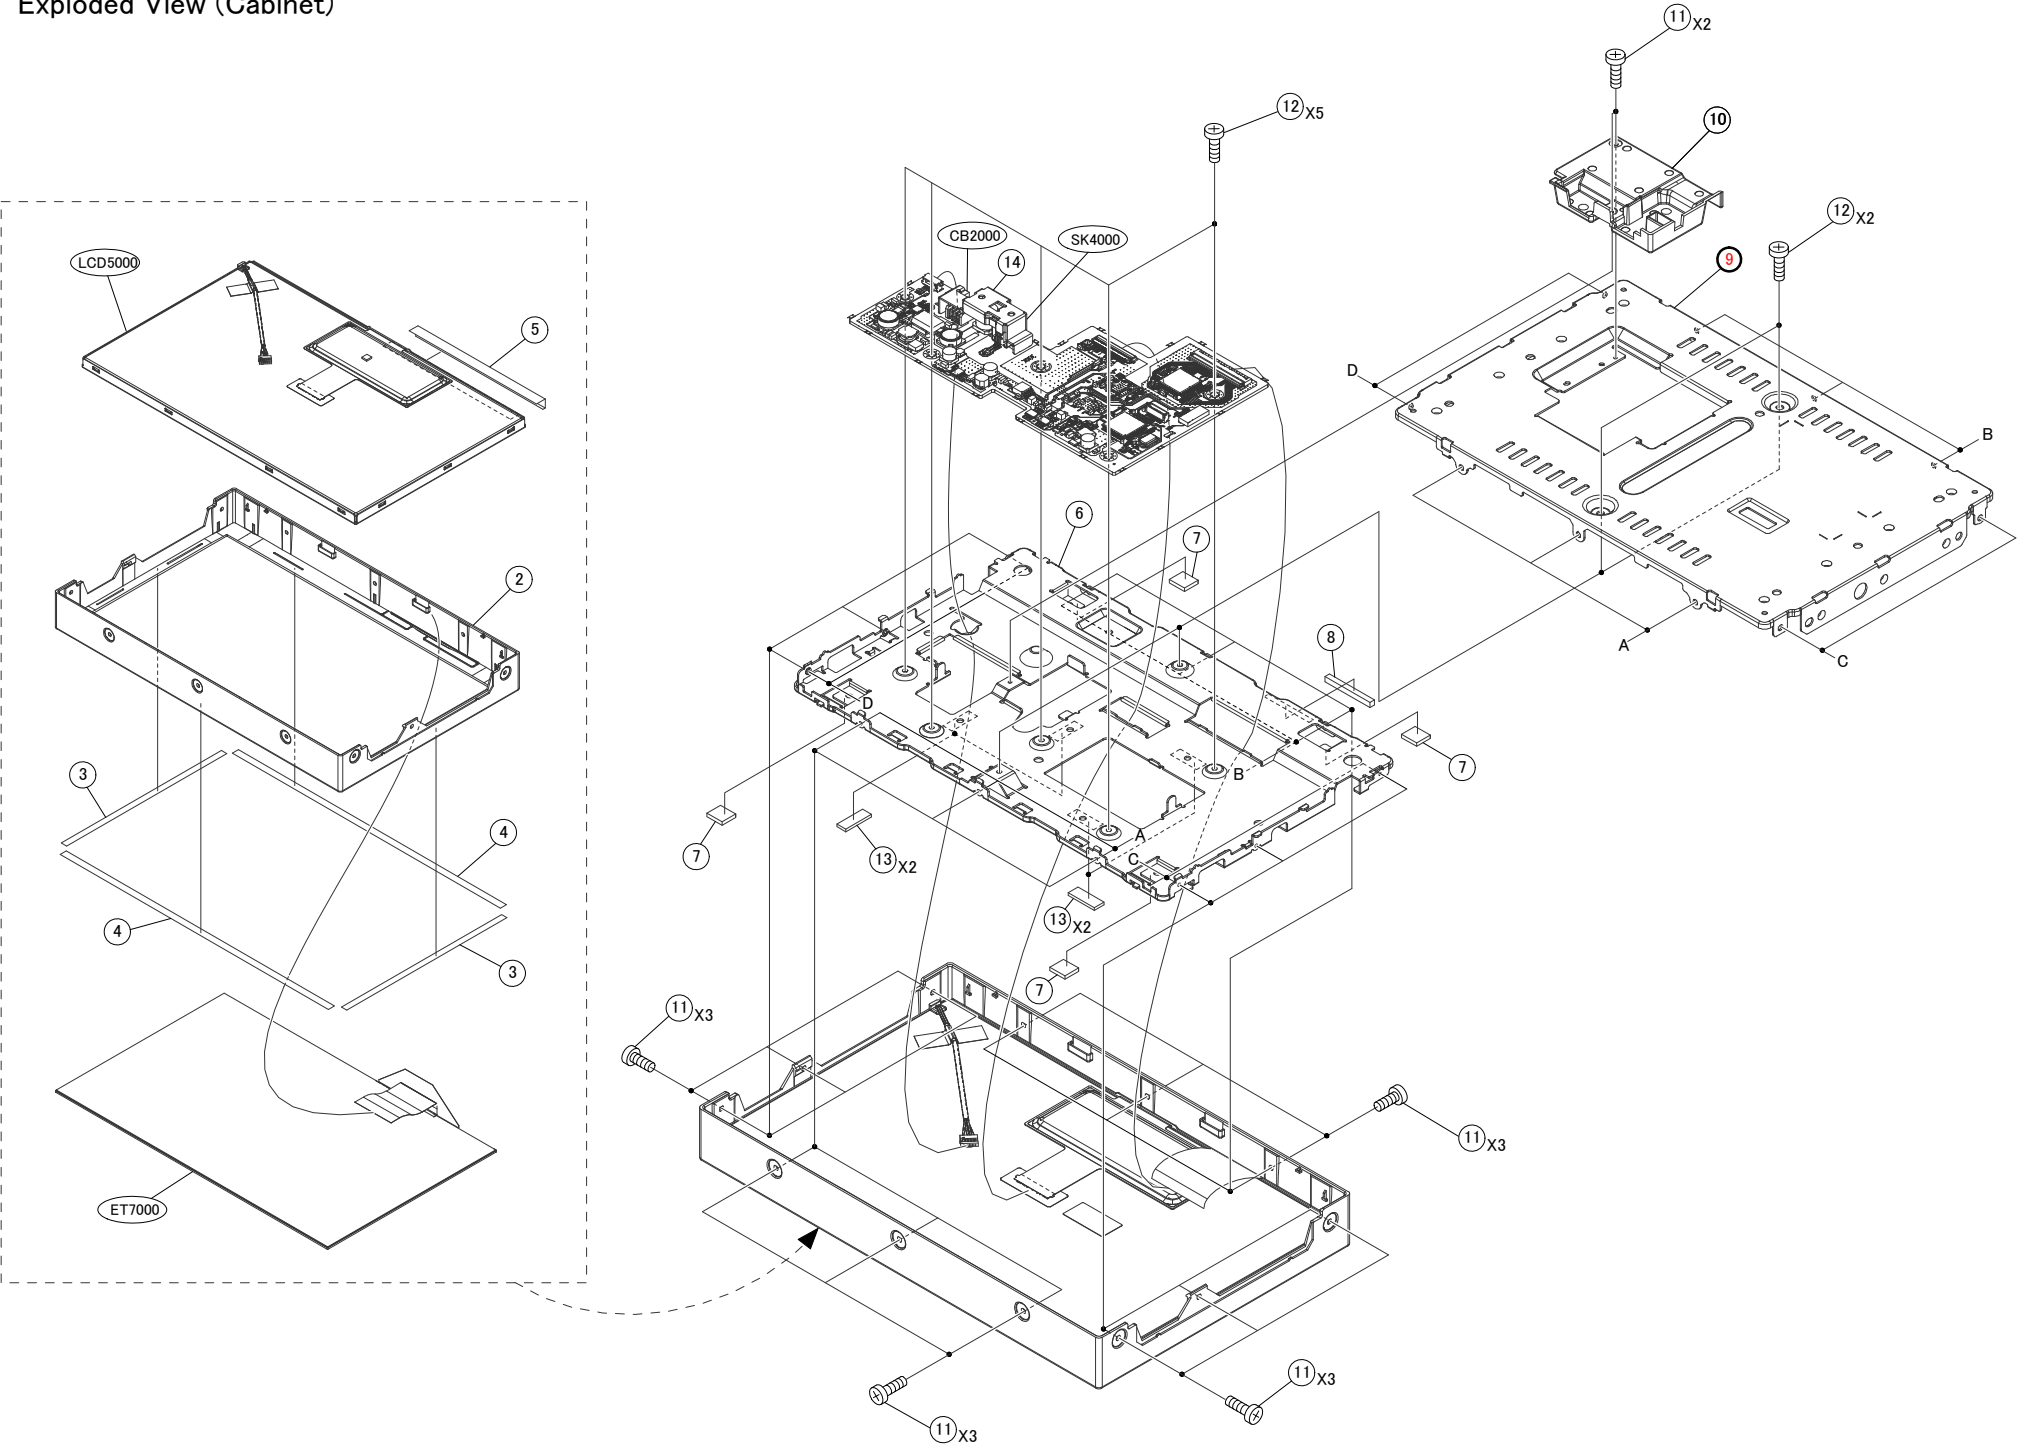


Exploded View (Cabinet)




| MODEL                   | Symbol No.  | Parts No.    | Description          |
|-------------------------|-------------|--------------|----------------------|
| <a href="#">2</a>       | 13-30237Z01 | NOSE,MONITOR |                      |
| <a href="#">3</a>       | 14-28478Z04 |              | INS,CVR 135X2XT0.4   |
| <a href="#">4</a>       | 14-28478Z05 |              | INS,CVR 225X2.5XT0.4 |
| <a href="#">5</a>       | 14-28478Z06 |              | INS,CVR 100X22XT0.05 |
| <a href="#">6</a>       | 07-30238Z01 |              | BKT,LCD              |
| <a href="#">7</a>       | 14-28478Z68 |              | INS,CVR 10X10XT2     |
| <a href="#">8</a>       | 14-28478Z84 |              | INS,CVR 30X6XT10     |
| <a href="#">9</a>       | - - - - -   |              | BKT,REAR             |
| <a href="#">10</a>      | 15-30169Z01 |              | COVER,BASE           |
| <a href="#">11</a>      | 03-00712Z74 |              | SCR,MCH 2X5 ZBEA     |
| <a href="#">12</a>      | 03S60822Y13 |              | SCR,S-T 2.6X6 ZN A   |
| <a href="#">13</a>      | 75-20737Z01 |              | 65TSV 7-7(KD3)H L=20 |
| <a href="#">14</a>      | 07-30168Z01 |              | BKT,CONN FPD         |
| <a href="#">CB2000</a>  | 09-25106Z09 |              | WTB,S08B-PUDSS-1 -DB |
| <a href="#">ET7000</a>  | 40-30438Z02 |              | ASSY,HCDSP0B014B     |
| <a href="#">LCD5000</a> | 65-30481Z01 |              | ASSY,C101EAN01.0     |
| <a href="#">SK4000</a>  | 09-29404Z02 |              | SKT,GT17HN2-4DP -EE  |

#1           X110-G Only,  
\$1           X110-F Only,  
Others:Common.

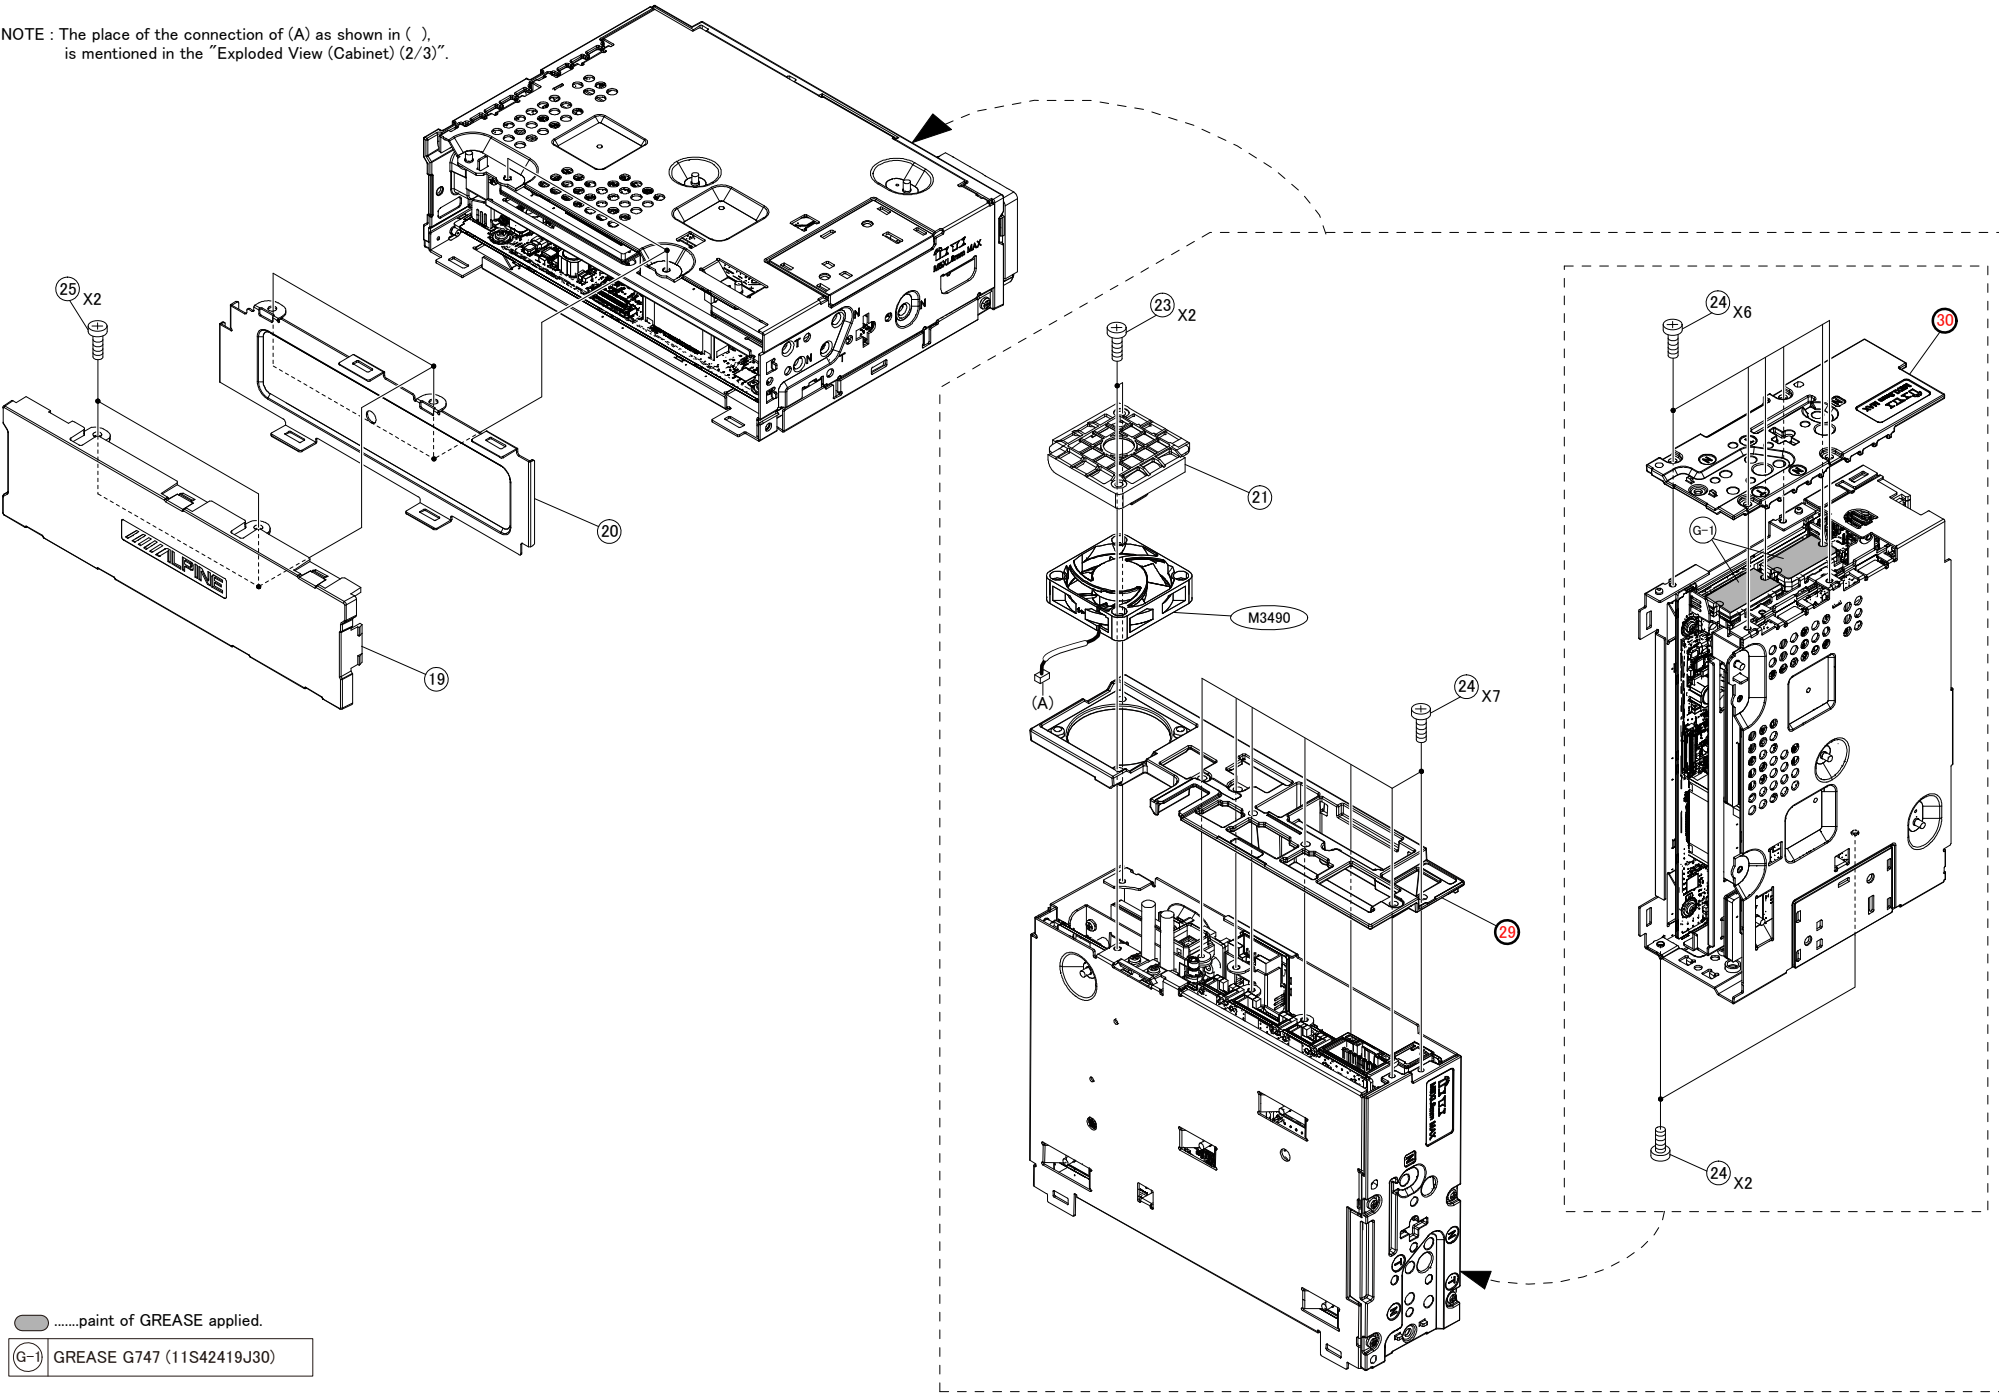NOTE:The part that has not PART NUMBER will not be supplied



Exploded View (Cabinet) (1/3)

NOTE : The place of the connection of (A) as shown in ( ), is mentioned in the "Exploded View (Cabinet) (2/3)".




# Exploded View (Cabinet) (2/3)

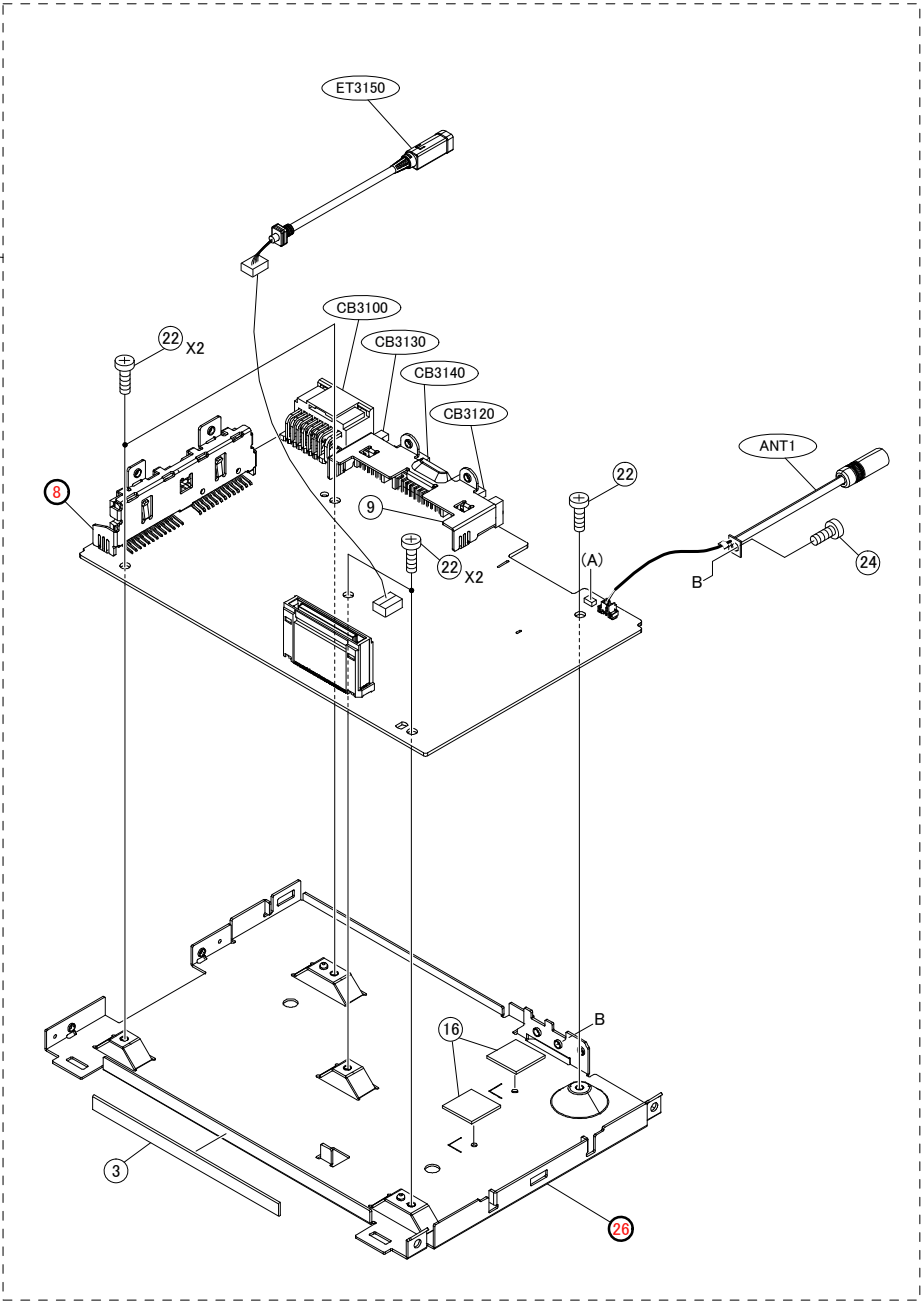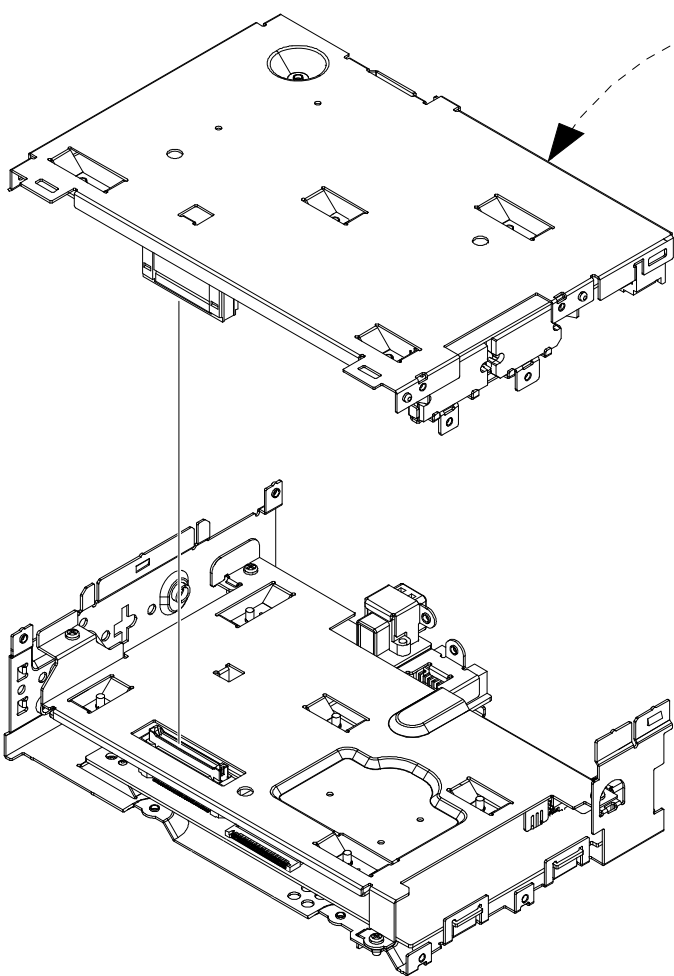NOTE : The place of the connection of (A) as shown in ( ),  
is mentioned in the "Exploded View (Cabinet) (1/3)".



# Exploded View (Cabinet) (3/3)

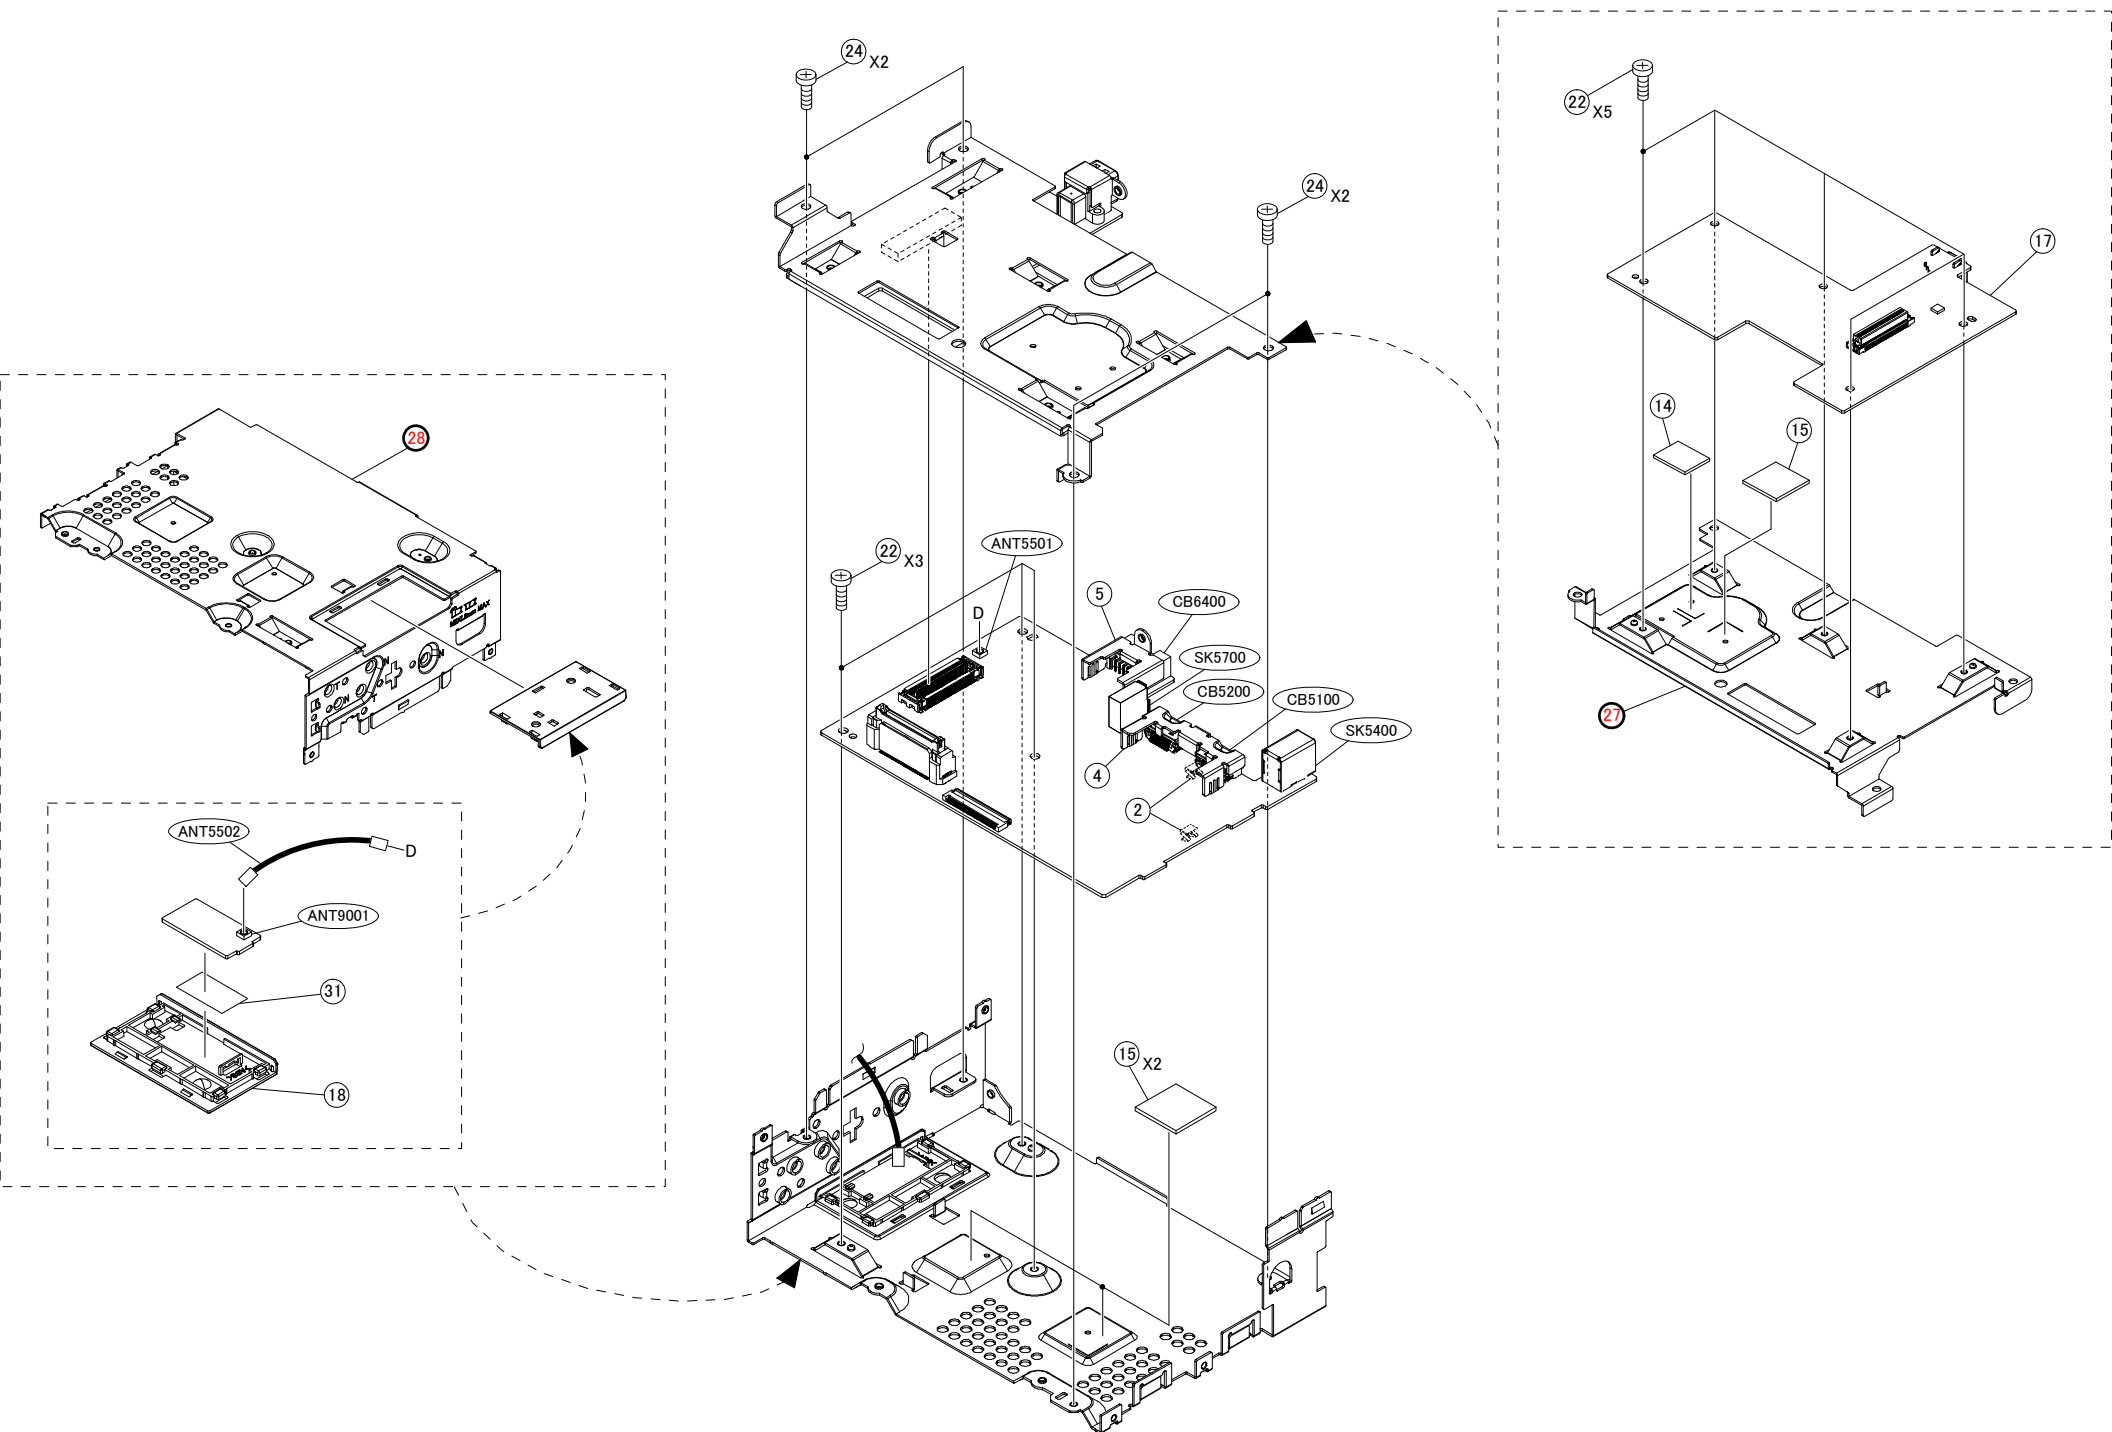

| MODEL | Symbol No. | Parts No. | Description |
|-------|------------|-----------|-------------|
|-------|------------|-----------|-------------|









|                         |             |               |                      |
|-------------------------|-------------|---------------|----------------------|
| <a href="#">2</a>       | 29-22483Z02 | OG-453065 -E5 |                      |
| <a href="#">3</a>       |             | 14-19217Z19   | INS,CVR 104X4XT0.15  |
| <a href="#">4</a>       |             | 07-30182Z01   | BKT,CONN HDMI        |
| <a href="#">5</a>       |             | 07-30183Z01   | BKT,CONN CAN         |
| <a href="#">8</a>       |             | -----         | BKT,IC               |
| <a href="#">9</a>       |             | 07-30184Z01   | BKT,CONN PREOUT      |
| <a href="#">14</a>      |             | 75-31381Z01   | 5580H-1.5-19-15      |
| <a href="#">15</a>      |             | 75-31381Z02   | 5580H-1.5-20-20      |
| <a href="#">16</a>      |             | 75-31381Z03   | 5580H-5.5-12-12      |
| <a href="#">17</a>      |             | 84-30004Z01   | ASSY,NAVI,LIMO_US    |
| <a href="#">18</a>      |             | 15-29982Z01   | COVER,PLATE TOP      |
| <a href="#">19</a>      |             | 15-30180Z01   | COVER,FRONT          |
| <a href="#">20</a>      |             | 26-30398Z01   | SHIELD,FRONT         |
| <a href="#">21</a>      |             | 15-12877Z01   | COVER,FAN            |
| <a href="#">22</a>      |             | 03-12686Z01   | SCR,S-T 2.6X6 ZN ATP |
| <a href="#">23</a>      |             | 03S60822Y31   | SCR,S-T 2.6X18 ZN A  |
| <a href="#">24</a>      |             | 03S60822Y10   | SCR,S-T 2.6X5 ZN A   |
| <a href="#">25</a>      |             | 03-00340Z01   | SCR,S-T 2.6X6 ZB A   |
| <a href="#">26</a>      |             | -----         | CHAS,BASE            |
| <a href="#">27</a>      |             | -----         | SHIELD,MIDDLE        |
| <a href="#">28</a>      |             | -----         | COVER,TOP            |
| <a href="#">29</a>      |             | -----         | BKT,REAR             |
| <a href="#">30</a>      |             | -----         | HEAT,SINK            |
| <a href="#">31</a>      |             | 14-28478Z77   | INS,CVR 24X14XT0.15  |
| <a href="#">ANT1</a>    |             | 09-17241Z06   | ASSY,ANID-0116-06A   |
| <a href="#">ANT5501</a> |             | 09-07494Z01   | U.FL-R-SMT-1(80)-E2  |

NOTE:The part that has not PART NUMBER will not be supplied.






| MODEL | Symbol No.              | Parts No.   | Description          |
|-------|-------------------------|-------------|----------------------|
|       | <a href="#">ANT5502</a> | 09-24492Z04 | ASSY,U.FL-2LP-066N1  |
|       | <a href="#">ANT9001</a> | 09-07494Z01 | U.FL-R-SMT-1(80)-E2  |
|       | <a href="#">CB3100</a>  | 09T35473Y16 | WTB,F169B001-16 -DB  |
|       | <a href="#">CB3120</a>  | 09-25106Z01 | WTB,S10B-PUDSS-1 -DB |
|       | <a href="#">CB3130</a>  | 09-25106Z02 | WTB,S12B-PUDSS-1 -DB |
|       | <a href="#">CB3140</a>  | 09-25106Z07 | WTB,S22B-PUDSS-1 -DB |
|       | <a href="#">CB5100</a>  | 09-25213Z01 | WTB,TCX3400-011187-T |
|       | <a href="#">CB5200</a>  | 09-25213Z01 | WTB,TCX3400-011187-T |
|       | <a href="#">CB6400</a>  | 09-25106Z05 | WTB,S18B-PUDSS-1 -DB |
|       | <a href="#">ET3150</a>  | 09-19615Z02 | ASSY,ANID-0139-02A   |
|       | <a href="#">M3490</a>   | 59-14185Z03 | MOTOR,ASB0412MA-9D11 |
|       | <a href="#">SK5400</a>  | 09-30387Z01 | SKT,GT17HNF-4DP-2-DB |
|       | <a href="#">SK5700</a>  | 09-31283Z01 | SKT,UBAL-4R-D14-4SDB |

NOTE:The part that has not PART NUMBER will not be supplied.







**Accessory List****Source Unit Box Parts (X110-G)**
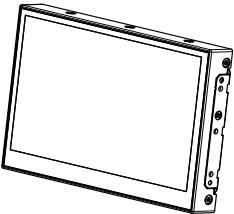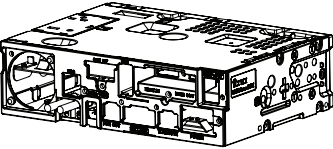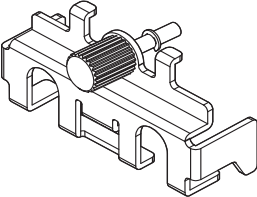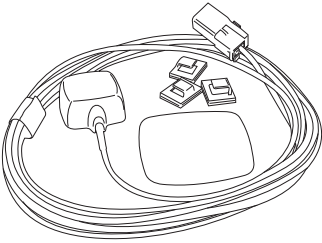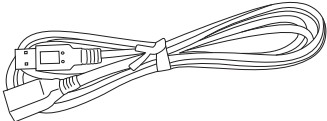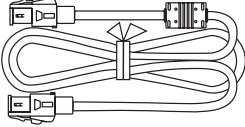
|                                                                                     |                                                                                     |                                                                                       |
|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| <b>Display Monitor</b>                                                              | <b>X110-G Source Unit</b>                                                           | <b>HDMI Cable Bracket</b>                                                             |
|    |    |    |
| <b>8mm x 8 Screws</b>                                                               | <b>GPS Antenna</b>                                                                  | <b>USB Extension Cable</b>                                                            |
|    |    |    |
| <b>Pre Out Harness</b>                                                              | <b>Direct Camera Adapter</b>                                                        | <b>Display Cable</b>                                                                  |
|  |  |  |





**DVD Player Box Parts (DVE-5300X)**

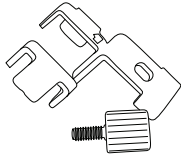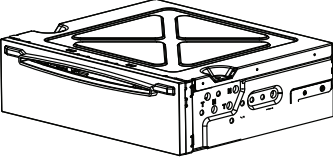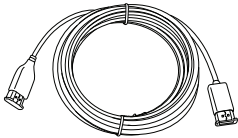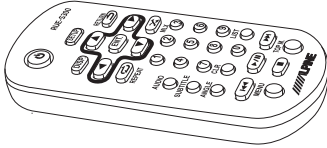
|                                                                                     |                                                                                     |                                                                                       |
|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| <b>HDMI Cable Bracket</b>                                                           | <b>DVE-5300X DVD Player Unit</b>                                                    | <b>8mm x 4 Screws</b>                                                                 |
|  |  |  |
| <b>HDMI Cable</b>                                                                   | <b>Remote Control</b>                                                               |                                                                                       |
|  |  |                                                                                       |



## Installation Kit Parts (G-KTX110-GM1/GM2)
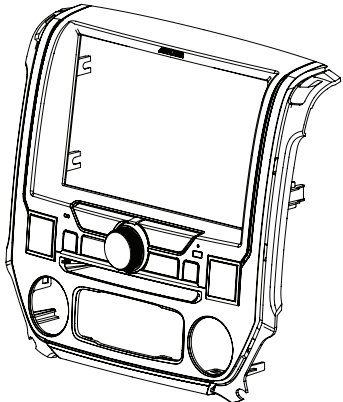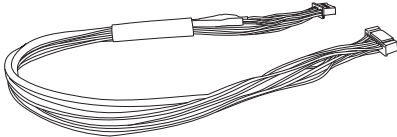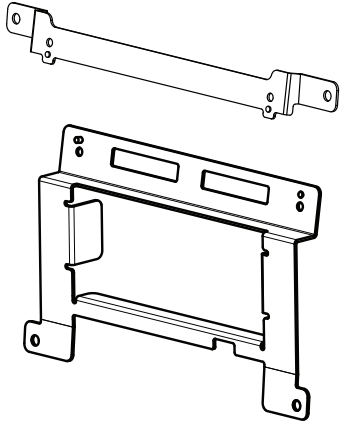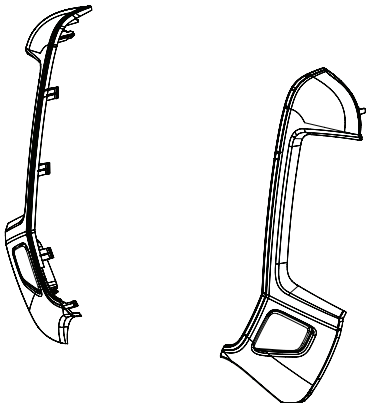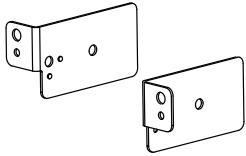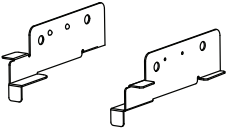
| Radio Dash Bezel                                                                   | Key Harness                                                                        | Display Mounting Brackets                                                            |
|------------------------------------------------------------------------------------|------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
|   |  |   |
| Vent Covers                                                                        | DVD Player Mounting Brackets                                                       | Source Unit Mounting Brackets                                                        |
|  |  |  |


## iDatalink Maestro Box Parts (ALP-MRR V2.0/ALP-HRN-GM3)
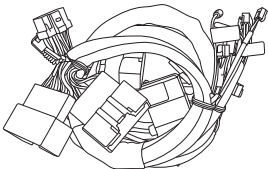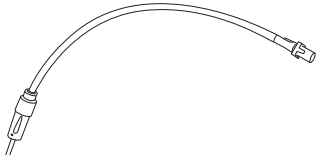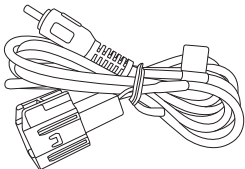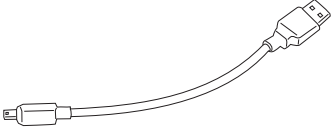
| Main Harness                                                                        | Antenna Adapter                                                                     | Factory Camera Harness                                                                |
|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
|  |  |  |
| SAT Radio Antenna Adapter                                                           | Maestro USB Update Cable                                                            | iDatalink Maestro Module                                                              |
|  |  |  |

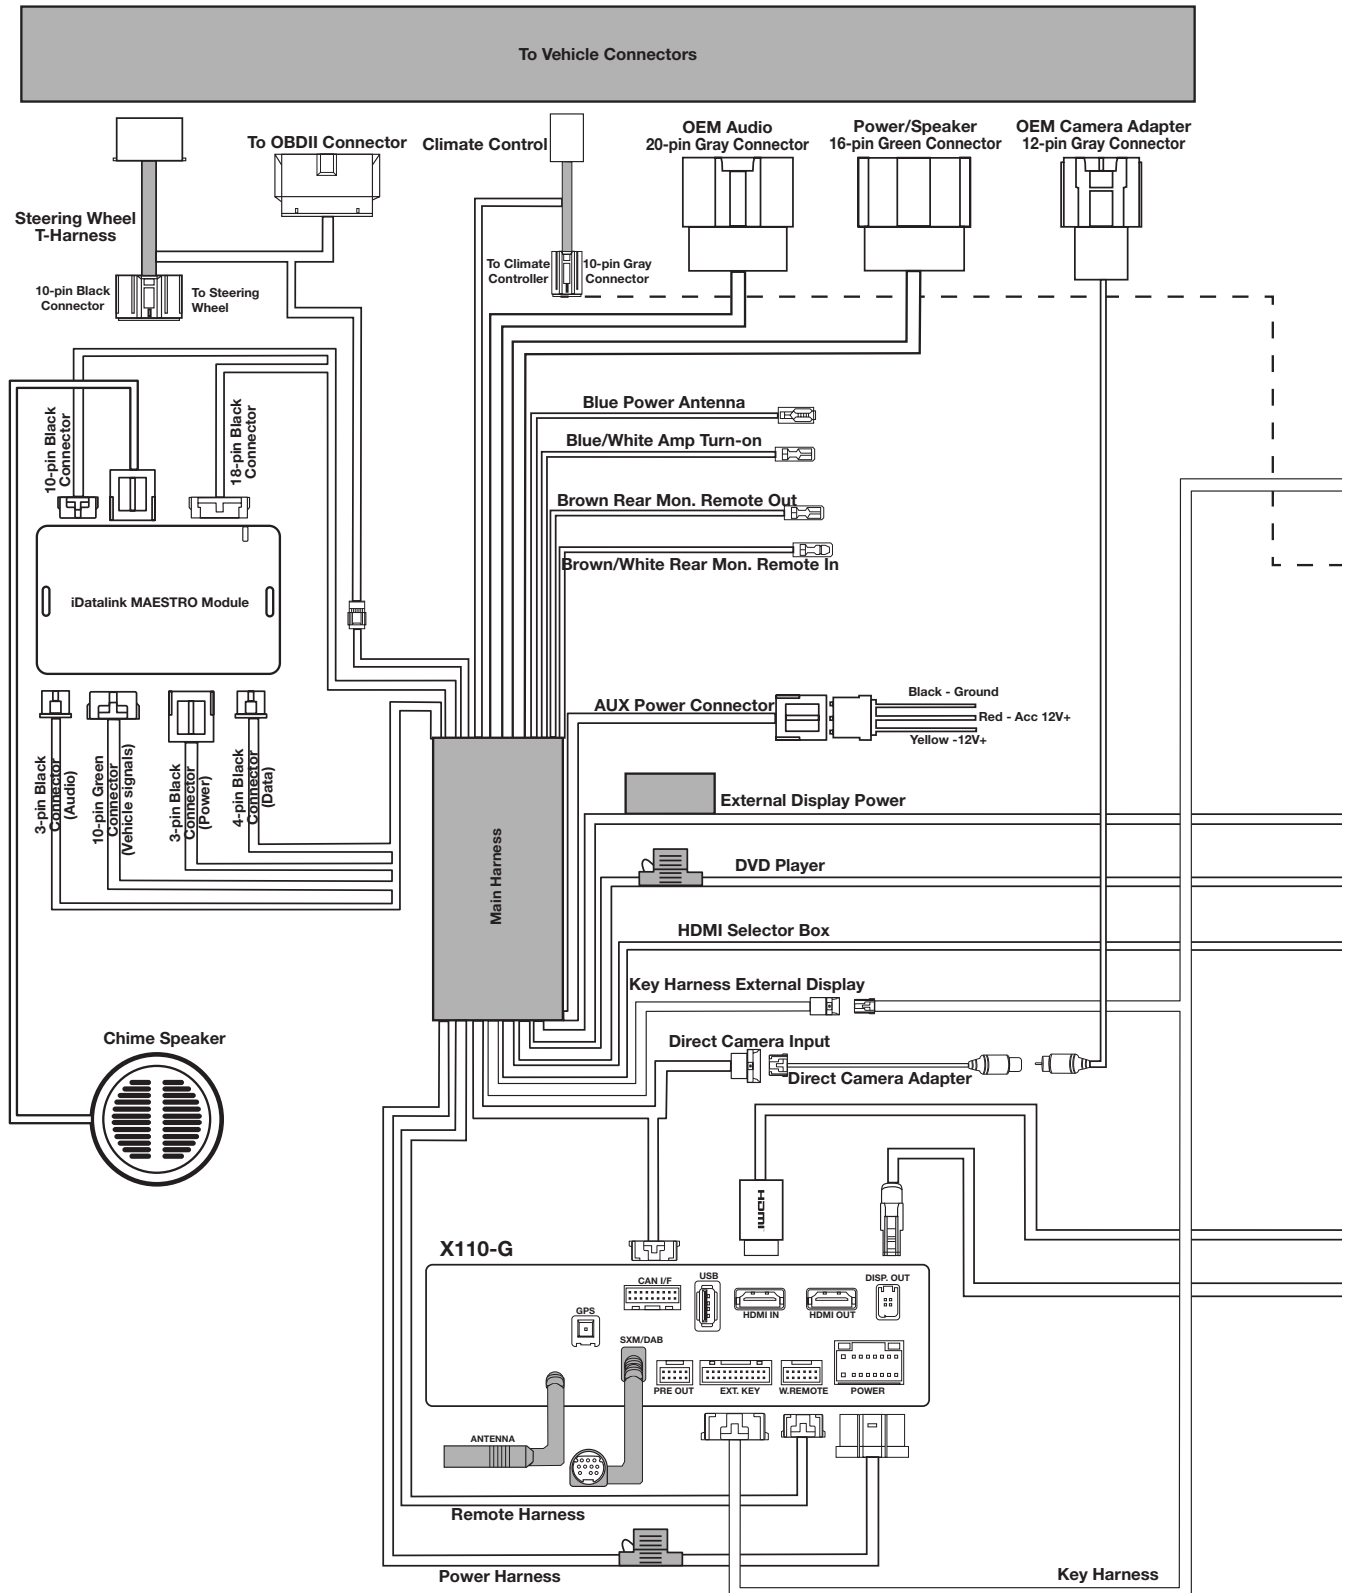
**X110-G Wiring Diagram**

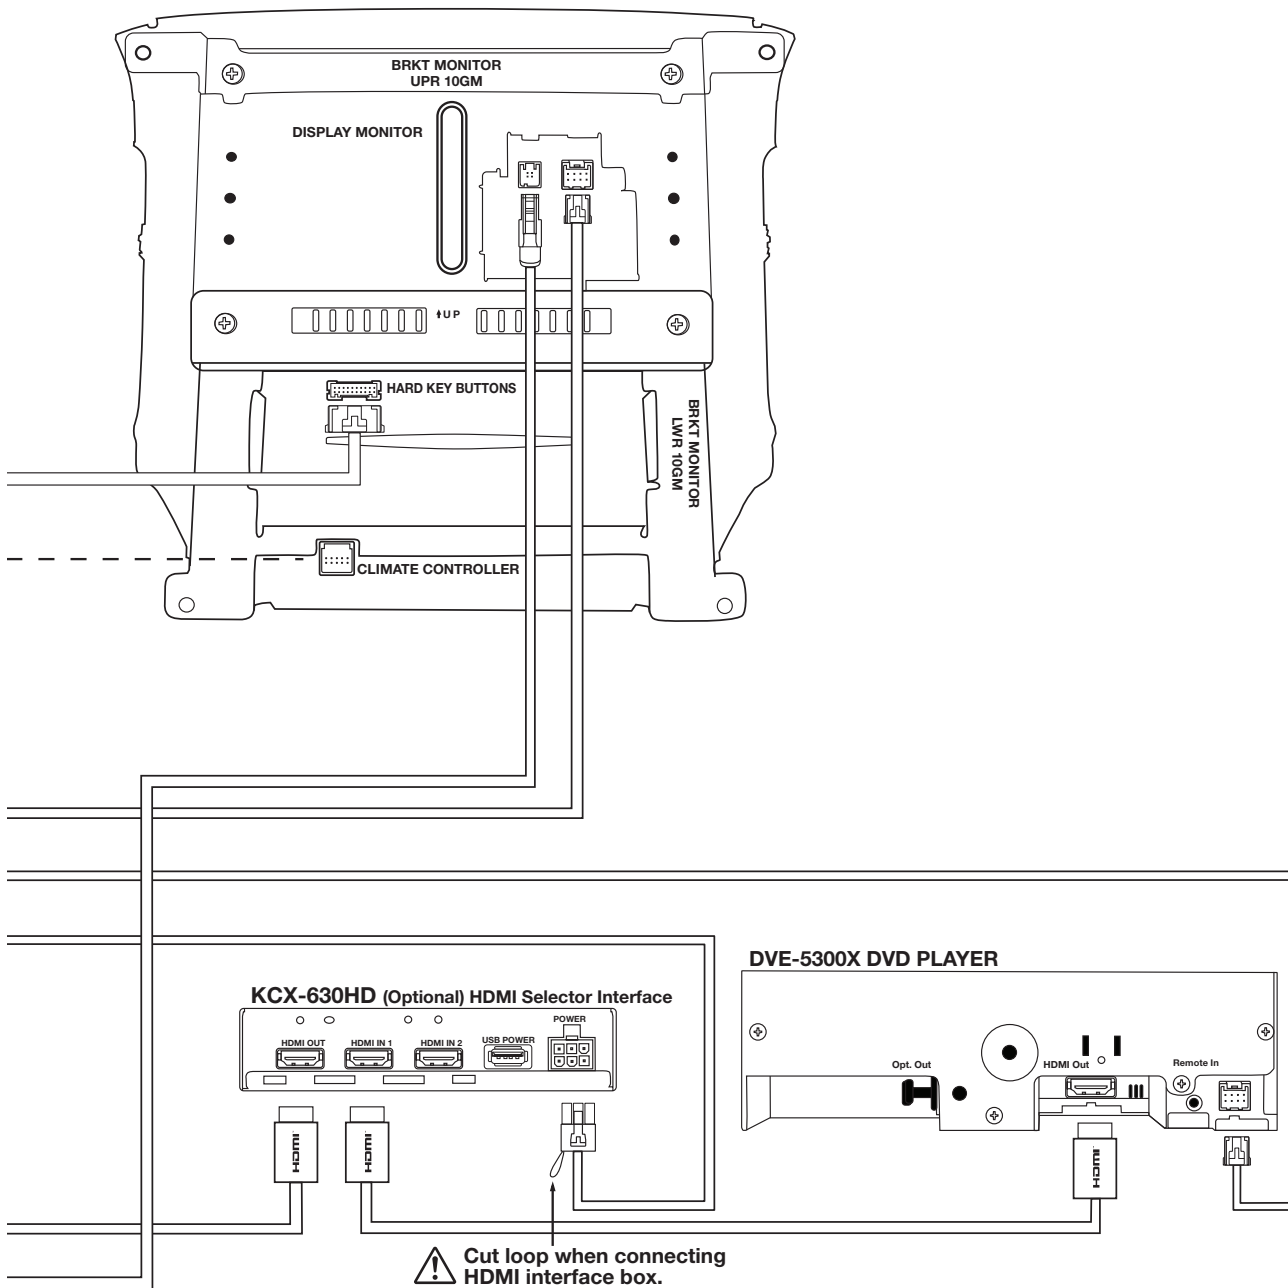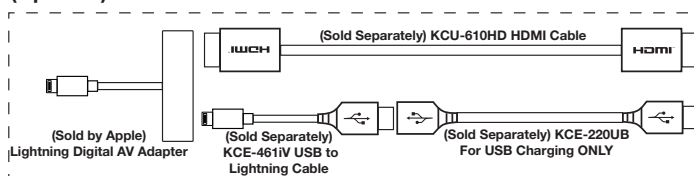**(Optional) iPhone Connection**


## System Connection

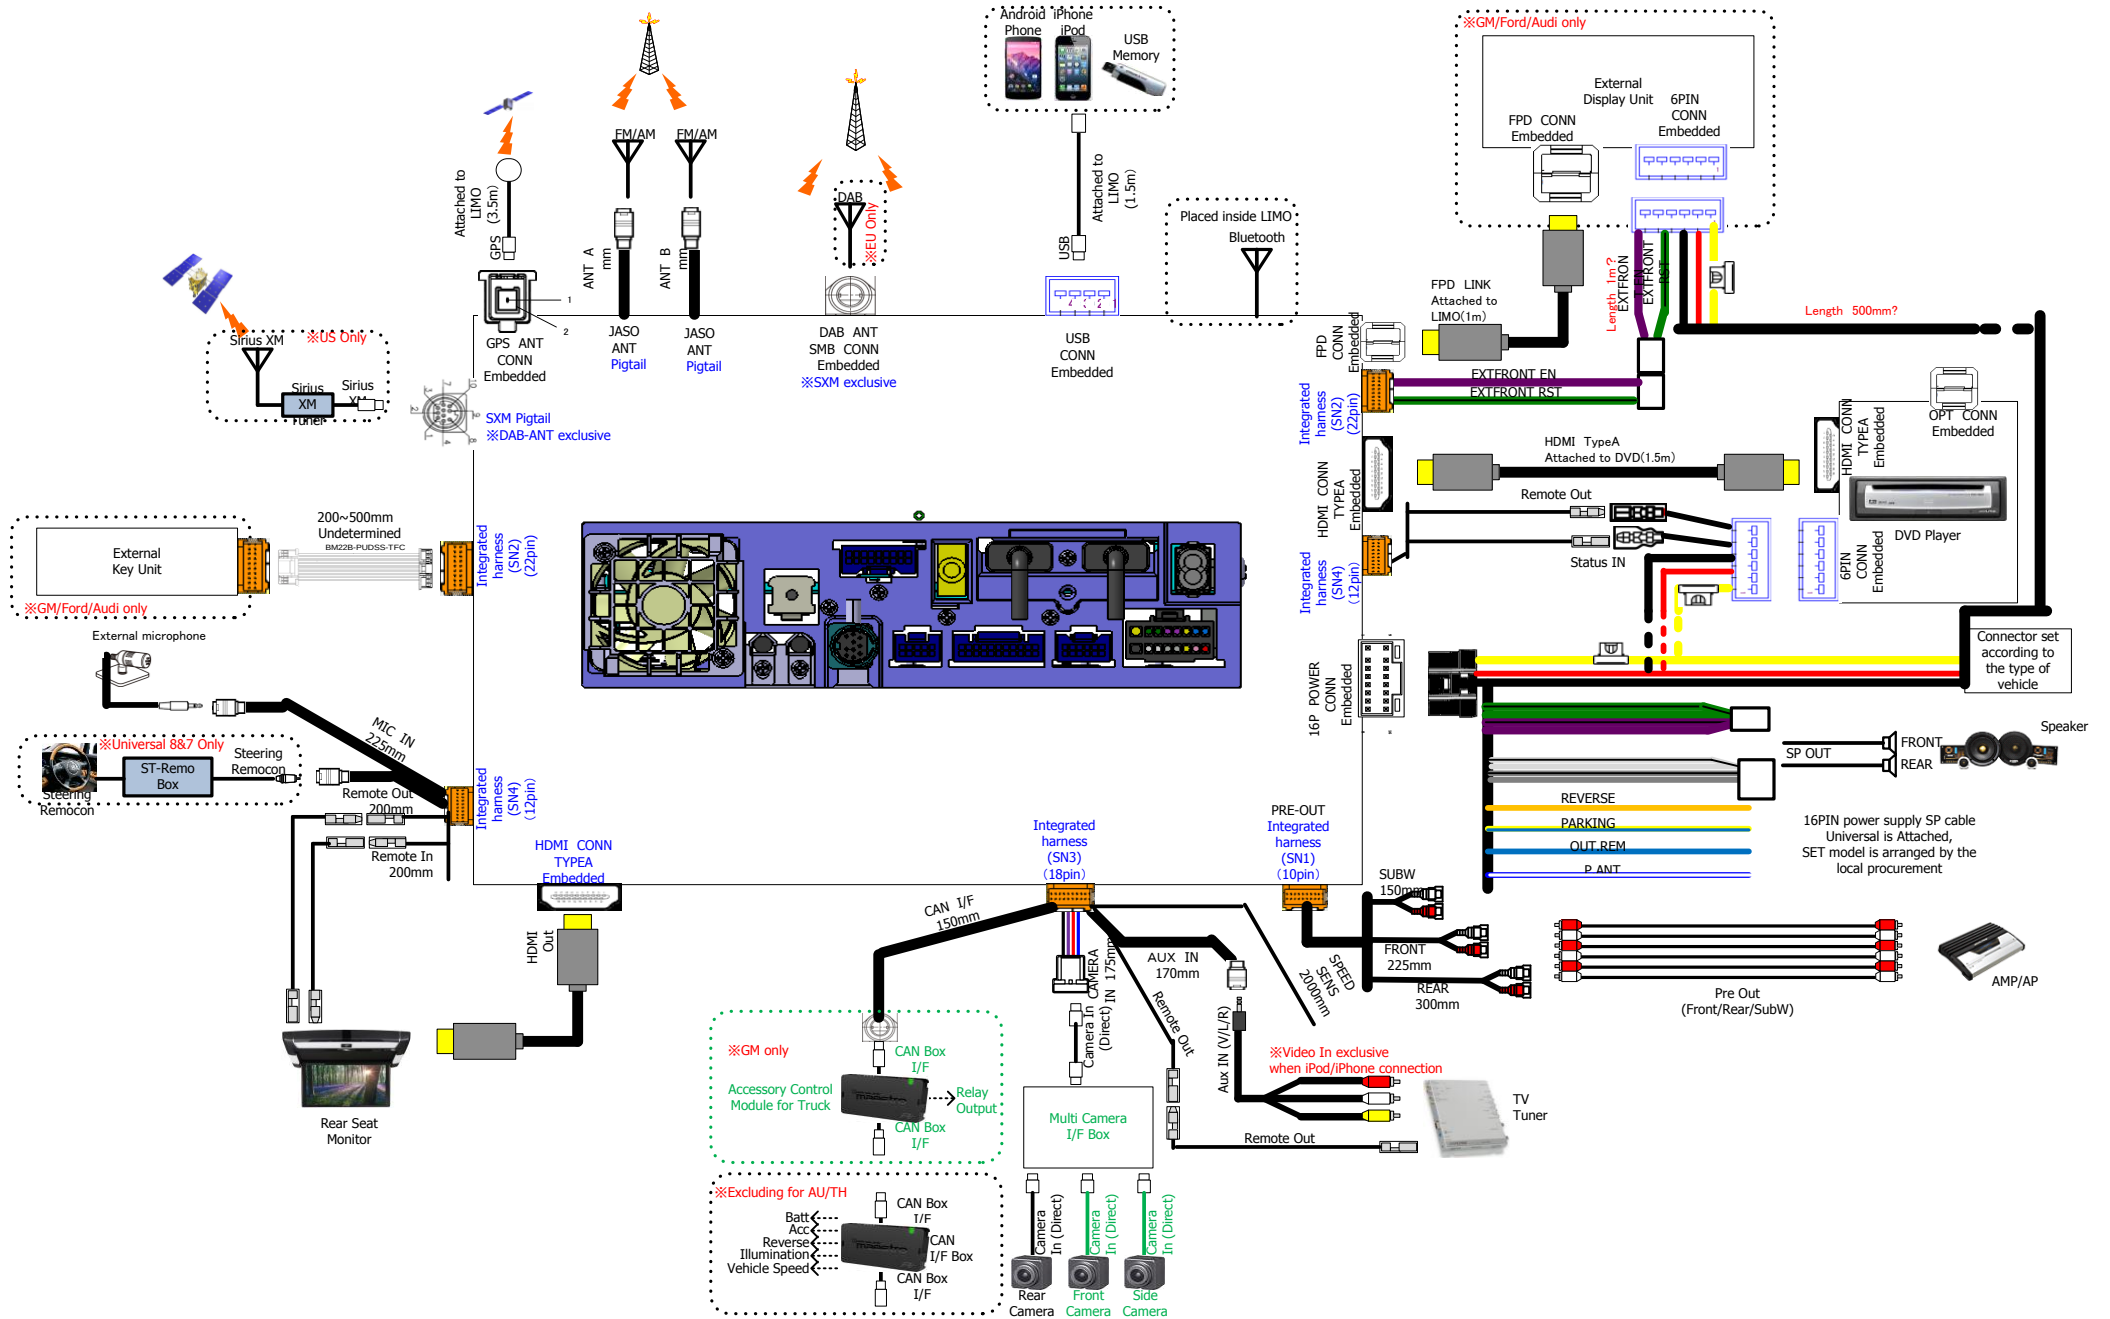

# Parts Identification

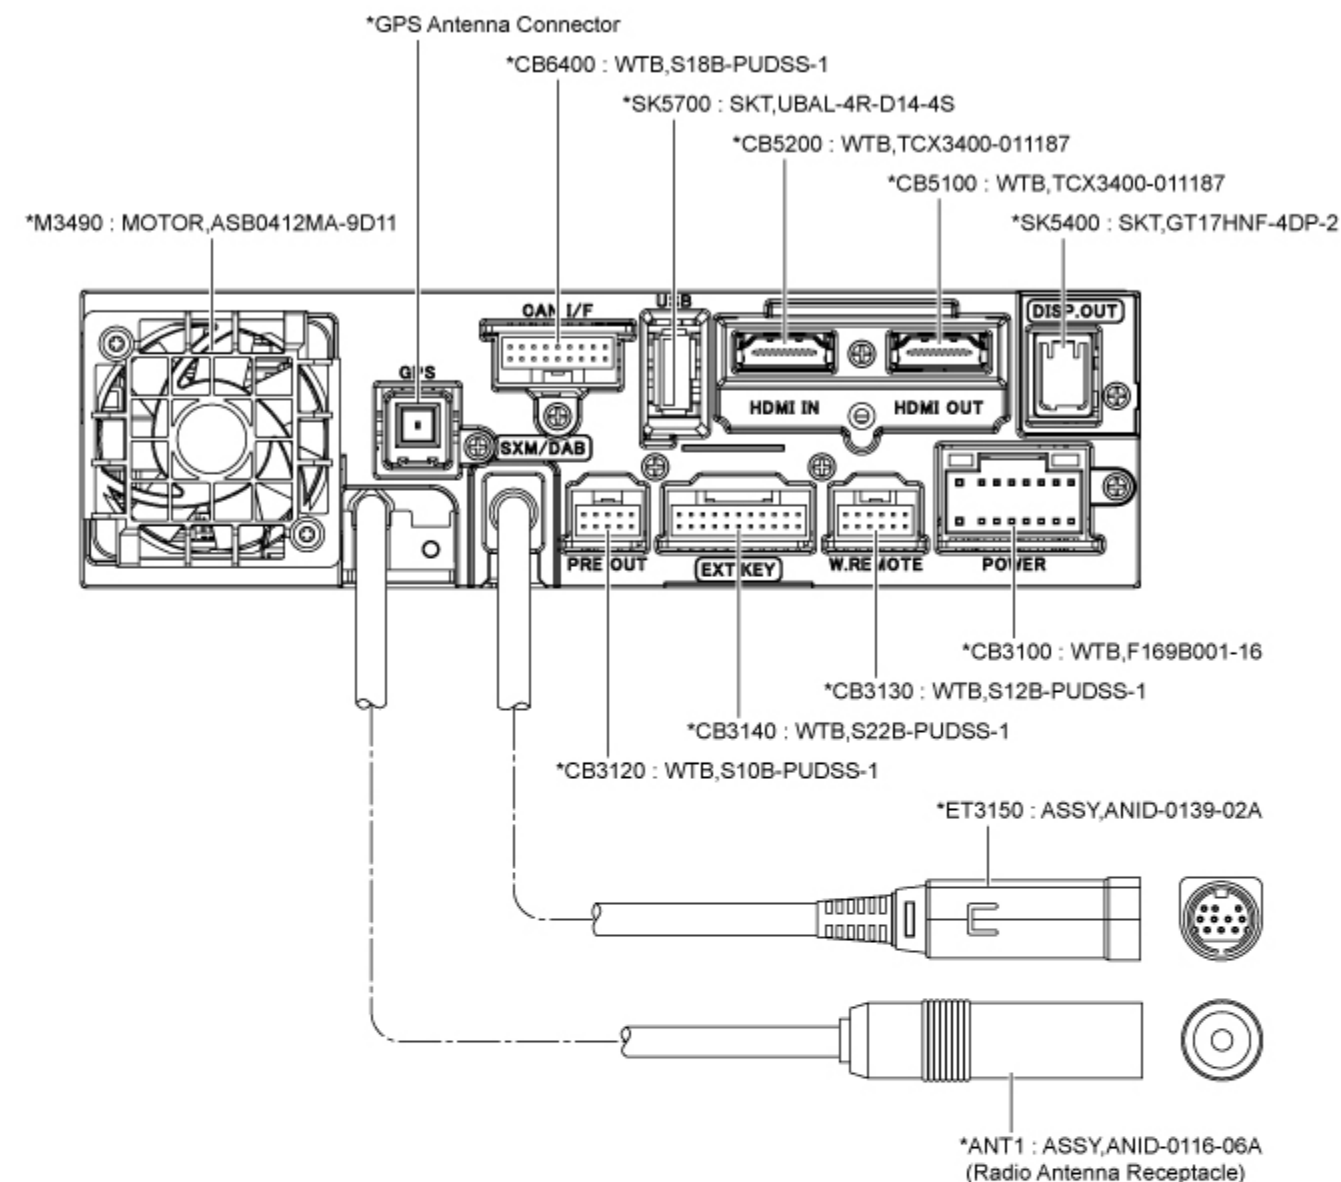


\*ET3150 : ASSY,ANID-0139-02A

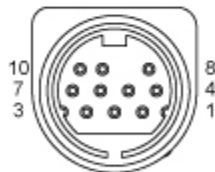


|   |         |   |        |
|---|---------|---|--------|
| ① | AUDIO_L | ⑥ | SXM_RX |
| ② | SXM_TX  | ⑦ | NC     |
| ③ | NC      | ⑧ | GND_D  |
| ④ | AUDIO_R | ⑨ | POWER  |
| ⑤ | GND_A   | ⑩ | PWR_EN |

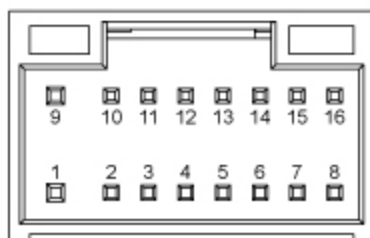\*CB3100 : WTB,F169B001-16




|   |                |   |         |
|---|----------------|---|---------|
| ① | GND            | ⑨ | BATT    |
| ② | FL-            | ⑩ | RL-     |
| ③ | FL+            | ⑪ | RL+     |
| ④ | FR-            | ⑫ | RR-     |
| ⑤ | FR+            | ⑬ | RR+     |
| ⑥ | NC (F_PARKING) | ⑭ | PARKING |
| ⑦ | REVERSE        | ⑮ | O-REM   |
| ⑧ | ACC            | ⑯ | P-ANT   |

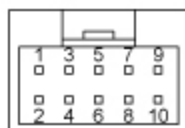\*CB3120 : WTB,S10B-PUDSS-1



|   |     |   |     |
|---|-----|---|-----|
| ① | GND | ⑥ | RR  |
| ② | SWL | ⑦ | GND |
| ③ | GND | ⑧ | FL  |
| ④ | SWR | ⑨ | FR  |
| ⑤ | RL  | ⑩ | NC  |

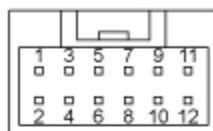\*CB3130 : WTB,S12B-PUDSS-1




|   |              |   |              |
|---|--------------|---|--------------|
| ① | ST_REMIN     | ⑦ | REAR_REM_OUT |
| ② | ST_REM5V     | ⑧ | HDMI_ST_IN   |
| ③ | GND          | ⑨ | NC           |
| ④ | REAR_REM_IN  | ⑩ | NC           |
| ⑤ | AUX_REM_OUT  | ⑪ | HFT_MIC+     |
| ⑥ | HDMI_REM_OUT | ⑫ | HFT_MIC-     |

\*CB3140 : WTB,S22B-PUDSS-1




|   |               |   |             |
|---|---------------|---|-------------|
| ① | EXT_LED_8.5V  | ⑫ | REMOCON_EYE |
| ② | LED_GND       | ⑬ | DG_3.3V     |
| ③ | NC            | ⑭ | EXT_KEY_AD2 |
| ④ | LED_GND       | ⑮ | EXT_KEY_AD1 |
| ⑤ | HARD_KEY_PWM  | ⑯ | EXT_KEY_GND |
| ⑥ | EXT_DISP_GND  | ⑰ | MIC_GND     |
| ⑦ | DIMMER        | ⑱ | EXT_MIC+    |
| ⑧ | EXT_DISP_WDOG | ⑲ | RESET_SW    |
| ⑨ | DIMMER_GND    | ⑳ | EXT_MIC-    |
| ⑩ | EXT_DISP_EN   | ㉑ | ENC_1       |
| ⑪ | EXT_KEY_AD3   | ㉒ | ENC_2       |

\*CB5100 : WTB,TCX3400-011187



|   |                   |   |                   |
|---|-------------------|---|-------------------|
| ① | TMDS Data2+       | ⑪ | TMDS Clock Shield |
| ② | TMDS Data2 Shield | ⑫ | TMDS Clock-       |
| ③ | TMDS Data2-       | ⑬ | NC (CEC)          |
| ④ | TMDS Data1+       | ⑭ | NC (Utility)      |
| ⑤ | TMDS Data1 Shield | ⑮ | SCL               |
| ⑥ | TMDS Data1-       | ⑯ | SDA               |
| ⑦ | TMDS Data0+       | ⑰ | DDC/CEC Ground    |
| ⑧ | TMDS Data0 Shield | ⑱ | +5V Power         |
| ⑨ | TMDS Data0-       |   | Hot Plug Detect   |
| ⑩ | TMDS Clock+       |   |                   |

\*CB5200 : WTB,TCX3400-011187



|   |                   |   |                   |
|---|-------------------|---|-------------------|
| ① | TMDS Data2+       | ⑪ | TMDS Clock Shield |
| ② | TMDS Data2 Shield | ⑫ | TMDS Clock-       |
| ③ | TMDS Data2-       | ⑬ | NC (CEC)          |
| ④ | TMDS Data1+       | ⑭ | NC (Utility)      |
| ⑤ | TMDS Data1 Shield | ⑮ | SCL               |

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">C1000</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C1001</a> | 08S35374W01 | CAP,CER 104K-B1E-CP  |
| FRONT-P.W.Board |     |       | <a href="#">C1002</a> | 08S35374W01 | CAP,CER 104K-B1E-CP  |
| FRONT-P.W.Board |     |       | <a href="#">C1003</a> | 08S45676W65 | CAP,CER.222K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C1004</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C1005</a> | 08S35374W01 | CAP,CER 104K-B1E-CP  |
| FRONT-P.W.Board |     |       | <a href="#">C1006</a> | 08S45231Y11 | CAP,CER 8R0D-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C1007</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C1008</a> | 08S35374W01 | CAP,CER 104K-B1E-CP  |
| FRONT-P.W.Board |     |       | <a href="#">C1009</a> | 08S35374W01 | CAP,CER 104K-B1E-CP  |
| FRONT-P.W.Board |     |       | <a href="#">C1011</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C1013</a> | 08S35374W01 | CAP,CER 104K-B1E-CP  |
| FRONT-P.W.Board |     |       | <a href="#">C2001</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C2002</a> | 08S45539Y07 | CAP,CER 333KX7R2J-CP |
| FRONT-P.W.Board |     |       | <a href="#">C2004</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C2005</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C2006</a> | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |     |       | <a href="#">C2008</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C2009</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C2011</a> | 08S65670Y08 | CAP,CER 225KX5R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3000</a> | 08S65676Y03 | CAP,CER 225KX7R1C-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3001</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">C3002</a> | 08S35374W10 | CAP,CER 225K-B1A -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3003</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3004</a> | 08S45232Y08 | CAP,CER 332K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3005</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3007</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3009</a> | 08S65676Y09 | CAP,CER 475KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3010</a> | 08S65670Y01 | CAP,CER 106KX5R1C-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3011</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3012</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3013</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3014</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3015</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3016</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3032</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3033</a> | 08S35374W10 | CAP,CER 225K-B1A -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3047</a> | 08S35374W10 | CAP,CER 225K-B1A -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3048</a> | 08S65670Y09 | CAP,CER 106KX5R1E-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3049</a> | 08S45232Y07 | CAP,CER 222K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3051</a> | 08S65670Y02 | CAP,CER 225KX5R1E-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3052</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3053</a> | 08S65670Y07 | CAP,CER 105KX5R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3054</a> | 08S65670Y07 | CAP,CER 105KX5R1H-CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">C3056</a> | 08S65671Y03 | CAP,CER 475KX5R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3057</a> | 08S65670Y08 | CAP,CER 225KX5R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3058</a> | 08S35374W08 | CAP,CER 474K-B1C -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3059</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3060</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3061</a> | 08S45232Y07 | CAP,CER 222K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3062</a> | 08S45232Y07 | CAP,CER 222K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3063</a> | 08S65670Y07 | CAP,CER 105KX5R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3064</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C3065</a> | 08S65670Y09 | CAP,CER 106KX5R1E-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3066</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C3068</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C4000</a> | 08S65128F88 | CAP,CER 104K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4001</a> | 08S65128F88 | CAP,CER 104K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4002</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4003</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4004</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4005</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4006</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4007</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4008</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4009</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">C4011</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4012</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4013</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4014</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4015</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4017</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4018</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C4019</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5000</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5001</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5002</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5003</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5004</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5005</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5006</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5007</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5008</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5009</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5010</a> | 08S45231Y11 | CAP,CER 8R0D-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C5011</a> | 08S45231Y10 | CAP,CER 7R0D-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C5012</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5013</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |

#1           X110-G Only,  
\$1           X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">C5014</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5015</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5016</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5017</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5018</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5019</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5020</a> | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5021</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5022</a> | 08S45232Y03 | CAP,CER 471K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5023</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5024</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5025</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5027</a> | 08S35350Y04 | CAP,CER 105K-B1C -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5028</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5029</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5030</a> | 08S45232Y03 | CAP,CER 471K-B1H -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5031</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C5032</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C5033</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| FRONT-P.W.Board |     |       | <a href="#">C5034</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| FRONT-P.W.Board |     |       | <a href="#">C5035</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| FRONT-P.W.Board |     |       | <a href="#">C5036</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS                                                                                 | MODEL | Ref.                   | Parts No.   | Parts Name           |
|-----------------|-------------------------------------------------------------------------------------|-------|------------------------|-------------|----------------------|
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7000</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7001</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7002</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7003</a>  | 08S35374W12 | CAP,CER 106K-B0J -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7004</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7005</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7006</a>  | 08S65667Y05 | CAP,CER 105KX5R1A-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7007</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7008</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7009</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7010</a>  | 08S45676W85 | CAP,CER 104K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7011</a>  | 08S45231Y20 | CAP,CER 39RJ-CH1H-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7012</a>  | 08S45231Y20 | CAP,CER 39RJ-CH1H-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7013</a>  | 08S45231Y20 | CAP,CER 39RJ-CH1H-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7014</a>  | 08S45231Y20 | CAP,CER 39RJ-CH1H-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7015</a>  | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7016</a>  | 08S65667Y05 | CAP,CER 105KX5R1A-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7017</a>  | 08S65667Y05 | CAP,CER 105KX5R1A-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">C7018</a>  | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">CB1000</a> | 09T25286Y10 | WTB,BM(10)B-SRSS -E9 |
| FRONT-P.W.Board |  |       | <a href="#">CB2000</a> | 09-25106Z09 | WTB,S08B-PUDSS-1 -DB |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">CB3001</a> | 09-01488Z07 | WTB,SM05B-GHS-TB -E5 |

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                   | Parts No.   | Parts Name             |
|-----------------|-----|-------|------------------------|-------------|------------------------|
| FRONT-P.W.Board |     |       | <a href="#">CB5000</a> | 09-23546Z06 | FFC,FH52-40S-0.5SHEQ   |
| FRONT-P.W.Board |     |       | <a href="#">CB7000</a> | 09-29915Z05 | FFC,60FHH-SM1-GAN-EZ   |
| FRONT-P.W.Board |     |       | <a href="#">CB7001</a> | 09-05384Z11 | FFC,52745-1597 -E9     |
| FRONT-P.W.Board |     |       | <a href="#">D2000</a>  | 48-05164Z01 | DIO,1SS352-TPH3 -CP    |
| FRONT-P.W.Board |     |       | <a href="#">E2000</a>  | 23T35612Y03 | CAP,WX 101-1E -E6      |
| FRONT-P.W.Board |     |       | <a href="#">E2001</a>  | 23T65114Y31 | CAP,FK 471-1E-G -EA    |
| FRONT-P.W.Board |     |       | <a href="#">E2002</a>  | 23T75543Y04 | CAP,MVA 221-0JF55-E6   |
| FRONT-P.W.Board |     |       | <a href="#">E3000</a>  | 23T35612Y03 | CAP,WX 101-1E -E6      |
| FRONT-P.W.Board |     |       | <a href="#">E3001</a>  | 23T35612Y03 | CAP,WX 101-1E -E6      |
| FRONT-P.W.Board |     |       | <a href="#">E3002</a>  | 23T65114Y06 | CAP,FK 221-0J-D -E6    |
| FRONT-P.W.Board |     |       | <a href="#">IC1000</a> | 51T75063Y07 | BD5229G-TR -CP         |
| FRONT-P.W.Board |     |       | <a href="#">IC1001</a> | 83-30860Z26 | 15Limo 10inch SOFTWARE |
| FRONT-P.W.Board |     |       | <a href="#">IC1001</a> | 51-12505Z01 | MTP,R5F3640MDFB -QT    |
| FRONT-P.W.Board |     |       | <a href="#">IC2000</a> | 51-30768Z01 | NJW4183DL1-33BTE1NE5   |
| FRONT-P.W.Board |     |       | <a href="#">IC2001</a> | 51T65016Y26 | S-80937CNMC-T2 -CP     |
| FRONT-P.W.Board |     |       | <a href="#">IC3000</a> | 51-23593Z02 | BD00IC0WEFJ-ME2 -SE2   |
| FRONT-P.W.Board |     |       | <a href="#">IC3002</a> | 51-28779Z01 | BD90620EFJ-CE2 -SE2    |
| FRONT-P.W.Board |     |       | <a href="#">IC3004</a> | 51-25969Z01 | MAX16813ATP/V+T -LE2   |
| FRONT-P.W.Board |     |       | <a href="#">IC3005</a> | 51-23593Z02 | BD00IC0WEFJ-ME2 -SE2   |
| FRONT-P.W.Board |     |       | <a href="#">IC3006</a> | 51-19754Z02 | NJM2857DL3-33TE1-NE5   |
| FRONT-P.W.Board |     |       | <a href="#">IC4000</a> | 51-27405Z01 | DS90UH928QSQ -LE6      |
| FRONT-P.W.Board |     |       | <a href="#">IC5000</a> | 51-29348Z01 | TW8834AT-TA2-GR -QT    |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                   | Parts No.   | Parts Name                |
|-----------------|-----|-------|------------------------|-------------|---------------------------|
| FRONT-P.W.Board |     |       | <a href="#">IC5001</a> | 51T85276W02 | TC7WH74FK-TE85L -CP       |
| FRONT-P.W.Board |     |       | <a href="#">IC5002</a> | 51T55336Y02 | TC7SH04FU,JF-L -CP        |
| FRONT-P.W.Board |     |       | <a href="#">IC7000</a> | 51T15456Y01 | TC74HC4066AFT-EL-SE5      |
| FRONT-P.W.Board |     |       | <a href="#">IC7001</a> | 83-30860Z27 | 15Limo 10inch TP_SOFTWARE |
| FRONT-P.W.Board |     |       | <a href="#">IC7001</a> | 51-28000Z01 | CY8CTMA884AE-12 -QT       |
| FRONT-P.W.Board |     |       | <a href="#">L3001</a>  | 24-17231Z03 | IND,NR8040 6R8N -E6       |
| FRONT-P.W.Board |     |       | <a href="#">L3004</a>  | 24-05547Z06 | IND,SLF10145-H22RMEA      |
| FRONT-P.W.Board |     |       | <a href="#">L3005</a>  | 24T95456W12 | FBI,BLM18AG102SH1-CP      |
| FRONT-P.W.Board |     |       | <a href="#">L3006</a>  | 24-22371Z01 | IND,NRS4018T 2R2M-E2      |
| FRONT-P.W.Board |     |       | <a href="#">L3007</a>  | 24-22372Z08 | IND,NRS6045T 22RM-E2      |
| FRONT-P.W.Board |     |       | <a href="#">L5000</a>  | 24T95458W07 | FBI,BLM31PG601SH1-CP      |
| FRONT-P.W.Board |     |       | <a href="#">L5001</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP      |
| FRONT-P.W.Board |     |       | <a href="#">L5002</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP      |
| FRONT-P.W.Board |     |       | <a href="#">L5003</a>  | 24T95458W07 | FBI,BLM31PG601SH1-CP      |
| FRONT-P.W.Board |     |       | <a href="#">L5004</a>  | 24-06212Z01 | FBI,BLM15AG601SH1-CP      |
| FRONT-P.W.Board |     |       | <a href="#">L5005</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP      |
| FRONT-P.W.Board |     |       | <a href="#">Q1000</a>  | 48T25737Y02 | TR,UMD3N-TR -CP           |
| FRONT-P.W.Board |     |       | <a href="#">Q1001</a>  | 48T25737Y02 | TR,UMD3N-TR -CP           |
| FRONT-P.W.Board |     |       | <a href="#">Q2001</a>  | 48T25737Y01 | TR,UMD2N-TR -CP           |
| FRONT-P.W.Board |     |       | <a href="#">Q2002</a>  | 48T94606F06 | TR,DTC114EUA-T106-CP      |
| FRONT-P.W.Board |     |       | <a href="#">Q3006</a>  | 48-24943Z02 | FET,RSH065N06-TB -E2      |
| FRONT-P.W.Board |     |       | <a href="#">Q5000</a>  | 48T35687Y01 | TR,UMH11N-TN -CP          |

#1           X110-G Only,  
\$1           X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">Q5001</a> | 48-20288Z01 | FET,MTM981400BBF -E2 |
| FRONT-P.W.Board |     |       | <a href="#">Q5002</a> | 48-20288Z01 | FET,MTM981400BBF -E2 |
| FRONT-P.W.Board |     |       | <a href="#">R1000</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1001</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1002</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1003</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1004</a> | 06S15593Y91 | RES,RK 563F 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1005</a> | 06S15593Y41 | RES,RK 471F 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1006</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1007</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R1008</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1009</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1010</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1011</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1014</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1015</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1016</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1017</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1018</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1019</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1020</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1021</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R1022</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1023</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1024</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R1025</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1028</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1030</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1031</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1032</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1033</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R1034</a> | 06S45674W89 | RES,RK 223J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1036</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1037</a> | 06S45674W89 | RES,RK 223J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1038</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R1043</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R2000</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| FRONT-P.W.Board |     |       | <a href="#">R2001</a> | 06S35095Y01 | RES,RK 333J 1/4 -CP  |
| FRONT-P.W.Board |     |       | <a href="#">R2002</a> | 06S15593Y96 | RES,RK 913F 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R2003</a> | 06S15615Y59 | RES,RK 272J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R2005</a> | 06S35083Y44 | RES,RK 393F 1/4 -CP  |
| FRONT-P.W.Board |     |       | <a href="#">R2006</a> | 06S70072F98 | RES,RK 223J 1/4 -CP  |
| FRONT-P.W.Board |     |       | <a href="#">R2011</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3000</a> | 06S45675W01 | RES,RK 623J 1/10 -CP |

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R3001</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3002</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3003</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3004</a> | 06S65415Y32 | RES,RK 392F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3005</a> | 06S45675W23 | RES,RK 514J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3008</a> | 06S15615Y85 | RES,RK 333J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3009</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3010</a> | 06-25919Z04 | RES,RK 133F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3011</a> | 06S15615Y83 | RES,RK 273J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3013</a> | 06S65415Y31 | RES,RK 332F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3014</a> | 06S45675W21 | RES,RK 434J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3015</a> | 06S45674W99 | RES,RK 563J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3016</a> | 06S15594Y23 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3017</a> | 06S45675W18 | RES,RK 334J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3019</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3023</a> | 06S45674W74 | RES,RK 512J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3068</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3069</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3070</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3071</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3073</a> | 06S65415Y34 | RES,RK 562F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3075</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R3076</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3077</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3078</a> | 06S15593Y57 | RES,RK 222F 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3079</a> | 06S65522Y08 | RES,RK R39F 1/4 -CP  |
| FRONT-P.W.Board |     |       | <a href="#">R3080</a> | 06S65415Y32 | RES,RK 392F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3081</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3082</a> | 06S65415Y32 | RES,RK 392F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3083</a> | 06S65415Y21 | RES,RK 471F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3084</a> | 06S65415Y39 | RES,RK 153F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3085</a> | 06S65415Y55 | RES,RK 334F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3086</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3087</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3088</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3090</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3091</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R3092</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3093</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R3094</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R4000</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R4001</a> | 06S35095Y08 | RES,RK JUMPER 1/4-CP |
| FRONT-P.W.Board |     |       | <a href="#">R4003</a> | 06S15615Y97 | RES,RK 104J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R4004</a> | 06S35095Y08 | RES,RK JUMPER 1/4-CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R4005</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R4006</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R4008</a> | 06S15615Y97 | RES,RK 104J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R4009</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5000</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5001</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5002</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5003</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5004</a> | 06S15615Y39 | RES,RK 391J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5005</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5006</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5007</a> | 06S15615Y53 | RES,RK 152J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5008</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5009</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5010</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5011</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5012</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5013</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5014</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5015</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5016</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5017</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R5018</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5019</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5020</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5021</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5022</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5023</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5024</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5025</a> | 06S15616Y22 | RES,RK 105J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5026</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5027</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5028</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5029</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5030</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5031</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5032</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5033</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5034</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5035</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5036</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5037</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5038</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5039</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R5040</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5041</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5042</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5043</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5044</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5045</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5046</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5047</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5048</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5049</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5050</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5051</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5052</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5053</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5054</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5055</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5056</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| FRONT-P.W.Board |     |       | <a href="#">R5057</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R5058</a> | 06S15615Y39 | RES,RK 391J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7000</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7001</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7002</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R7003</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7004</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7005</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7006</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7007</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7008</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7009</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7010</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7011</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7012</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7013</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7014</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7015</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7016</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7017</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7018</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7019</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7020</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7021</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7022</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7023</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7024</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| FRONT-P.W.Board |     |       | <a href="#">R7025</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7026</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7027</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7028</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7029</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7030</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7031</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7032</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7033</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7034</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7035</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| FRONT-P.W.Board |     |       | <a href="#">R7036</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7037</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7038</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7039</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7040</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7041</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7042</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7043</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7044</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7045</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |     |       | <a href="#">R7046</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

#1 X110-G Only,  
\$1 X110-F Only,  
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS                                                                                 | MODEL | Ref.                   | Parts No.   | Parts Name           |
|-----------------|-------------------------------------------------------------------------------------|-------|------------------------|-------------|----------------------|
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7047</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7048</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7049</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7050</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7051</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7052</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7053</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7054</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7055</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7056</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7057</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7061</a>  | 06S15615Y65 | RES,RK 472J 1/16 -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7062</a>  | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7063</a>  | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7064</a>  | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7065</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">R7066</a>  | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">SD3001</a> | 48-19296Z01 | DIO,SHT RB056L-40-E1 |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">SD3004</a> | 48-17988Z01 | DIO,SHT RB060M-60-CP |
| FRONT-P.W.Board |  |       | <a href="#">SK4000</a> | 09-29404Z02 | SKT,GT17HN2-4DP -EE  |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">XL1000</a> | 91-10720Z04 | XTL,NX8045GB 6.0M-E5 |
| FRONT-P.W.Board |                                                                                     |       | <a href="#">XL5000</a> | 91-26661Z12 | XTL,NX3225SAAG27.0CP |

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS                                                                               | MODEL | Ref.                    | Parts No.   | Parts Name           |
|-----------------|-----------------------------------------------------------------------------------|-------|-------------------------|-------------|----------------------|
| FRONT-P.W.Board |                                                                                   |       | <a href="#">Z4000</a>   | 91T65123Y02 | EMI,DLW21SN900SQ2-CP |
| FRONT-P.W.Board |                                                                                   |       | <a href="#">ZD2000</a>  | 48-21149Z09 | DIO,ZEN DZ2J036L0LCP |
| FRONT-P.W.Board |                                                                                   |       | <a href="#">ZD2001</a>  | 48-16145Z36 | DIO,ZEN PZU9.1B1 -CP |
| FRONT-P.W.Board |                                                                                   |       | <a href="#">ZD2002</a>  | 48-21149Z26 | DIO,ZEN DZ2J062M0LCP |
| FRONT-P.W.Board |                                                                                   |       | <a href="#">ZD2003</a>  | 48-21879Z01 | DIO,ZEN SM5S24A -EA  |
| FRONT-P.W.Board |                                                                                   |       | <a href="#">ZD2004</a>  | 48-21149Z09 | DIO,ZEN DZ2J036L0LCP |
| Miscellaneous   |  |       | <a href="#">ET7000</a>  | 40-30438Z02 | ASSY,HCDSP0B014B     |
| Miscellaneous   |  |       | <a href="#">LCD5000</a> | 65-30481Z01 | ASSY,C101EAN01.0     |

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

#1           X110-G Only,

\$1           X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(\*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(\*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS                                                                               | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----------------------------------------------------------------------------------|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |  |       | <a href="#">ANT1</a>  | 09-17241Z06 | ASSY,ANID-0116-06A   |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2000</a> | 08S45231Y17 | CAP,CER 22RJ-CH1H-CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2001</a> | 08S45231Y17 | CAP,CER 22RJ-CH1H-CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2004</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2005</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2006</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2008</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2009</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2010</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2011</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2012</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2013</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2014</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2015</a> | 08-15113Z03 | CAP,CER 475KX7R1C-CP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2016</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2017</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2018</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2019</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2020</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">C2021</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2023</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2050</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2180</a> | 08-23325Z19 | CAP,CER 224KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2190</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2192</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2200</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2201</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2206</a> | 08-23326Z06 | CAP,CER 225KX7R0J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2207</a> | 08-23326Z06 | CAP,CER 225KX7R0J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2208</a> | 08-15113Z01 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2209</a> | 08-15113Z01 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2210</a> | 08-15113Z01 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2211</a> | 08-15113Z01 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2212</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2213</a> | 08-23326Z03 | CAP,CER 224KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2214</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2215</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2216</a> | 08S65669Y05 | CAP,CER 106KX7R0J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2217</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2218</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2219</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2220</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2221</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2222</a> | 08-23325Z07 | CAP,CER 103KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2223</a> | 08S45677W69 | CAP,CER 222J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2224</a> | 08-23325Z07 | CAP,CER 103KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2225</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2226</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2227</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2228</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2229</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2230</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2231</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2232</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2234</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2235</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2236</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2237</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2238</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2239</a> | 08S65676Y05 | CAP,CER 105KX7R1E-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2240</a> | 08S65676Y02 | CAP,CER 475KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2241</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2242</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2243</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2244</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2245</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2246</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2247</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2248</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2249</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2250</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2251</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2252</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2253</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2254</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2255</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2256</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2257</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2258</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2259</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2400</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2401</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2402</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2403</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2404</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2405</a> | 08-15113Z02 | CAP,CER 335KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2406</a> | 08-15113Z02 | CAP,CER 335KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2407</a> | 08S65667Y07 | CAP,CER 225KX5R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2408</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2409</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2410</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2411</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2412</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2413</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2414</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2416</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2417</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2418</a> | 08S45232Y08 | CAP,CER 332K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2419</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2420</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2421</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2422</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2423</a> | 08-30898Z01 | CAP,TF 155K-1C -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2424</a> | 08-15113Z03 | CAP,CER 475KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2425</a> | 08-15113Z03 | CAP,CER 475KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2426</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2427</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2428</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2429</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2430</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2431</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2432</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2433</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2434</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2435</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2440</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2441</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2442</a> | 08S65676Y05 | CAP,CER 105KX7R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2443</a> | 08S65676Y05 | CAP,CER 105KX7R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2444</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2445</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2446</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2447</a> | 08S65676Y10 | CAP,CER 106KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2451</a> | 08S45676W85 | CAP,CER 104K-B1C -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2460</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2461</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2462</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2463</a> | 08S65670Y03 | CAP,CER 335KX5R1E-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2470</a> | 08S65676Y10 | CAP,CER 106KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2500</a> | 08-23325Z19 | CAP,CER 224KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2501</a> | 08S45231Y10 | CAP,CER 7R0D-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2502</a> | 08S45231Y11 | CAP,CER 8R0D-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2503</a> | 08S65669Y05 | CAP,CER 106KX7R0J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2504</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2505</a> | 08-23325Z07 | CAP,CER 103KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2506</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2507</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2508</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2509</a> | 08-23326Z05 | CAP,CER 105KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2510</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2600</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2601</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2602</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2603</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2604</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2605</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2606</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2607</a> | 08S65676Y03 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2611</a> | 08-30898Z02 | CAP,TF 105K-1E -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">C2612</a> | 08-23326Z05 | CAP,CER 105KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2613</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2650</a> | 08-23326Z05 | CAP,CER 105KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2800</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2850</a> | 08S45231Y17 | CAP,CER 22RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2851</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2852</a> | 08S45231Y17 | CAP,CER 22RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2853</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2854</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C2855</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2901</a> | 08S65669Y06 | CAP,CER 103KX7R1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C2903</a> | 08S45677W16 | CAP,CER.15RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2905</a> | 08S45677W60 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2906</a> | 08S45231Y06 | CAP,CER 3R0C-CJ1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2907</a> | 08S45231Y15 | CAP,CER 15RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2908</a> | 08S45231Y21 | CAP,CER 47RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2912</a> | 08S45231Y04 | CAP,CER 1R5C-CK1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2913</a> | 08S45231Y16 | CAP,CER 18RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2914</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2918</a> | 08S45231Y24 | CAP,CER 82RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2950</a> | 08S45677W60 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2955</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2960</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2962</a> | 08S45231Y21 | CAP,CER 47RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2963</a> | 08S35350Y04 | CAP,CER 105K-B1C -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2964</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2965</a> | 08S45677W60 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C2966</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| AUDIO-P.W.Board |     |       | <a href="#">C3002</a> | 08S45231Y14 | CAP,CER 12RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3017</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3018</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C3019</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3020</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3021</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3022</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3026</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3029</a> | 08-23325Z19 | CAP,CER 224KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3030</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| AUDIO-P.W.Board |     |       | <a href="#">C3031</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| AUDIO-P.W.Board |     |       | <a href="#">C3032</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| AUDIO-P.W.Board |     |       | <a href="#">C3047</a> | 08S45231Y14 | CAP,CER 12RJ-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3101</a> | 08S45539Y01 | CAP,CER 102KX7R2J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3103</a> | 08-26091Z01 | CAP,CER 102KX7R2J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3104</a> | 08-26091Z05 | CAP,CER 103KX7R2J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3130</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3131</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3132</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3133</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3134</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3135</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3136</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C3140</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3143</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3146</a> | 08-19311Z03 | CAP,CER 103KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3147</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3148</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3150</a> | 08S45677W44 | CAP,CER.221J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3151</a> | 08S45677W44 | CAP,CER.221J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3152</a> | 08S45677W44 | CAP,CER.221J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3153</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3155</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3156</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3159</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3160</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3161</a> | 08-19311Z03 | CAP,CER 103KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3163</a> | 08S35349Y08 | CAP,CER 102K-B1H -CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3203</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3204</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3205</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3206</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3210</a> | 08S65676Y10 | CAP,CER 106KX7R1C-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C3221</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3222</a> | 08-19311Z03 | CAP,CER 103KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3223</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3224</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3225</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3226</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3227</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3230</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3233</a> | 08-15113Z01 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3236</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3238</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3239</a> | 08-23326Z08 | CAP,CER 473KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3240</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3350</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3351</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3352</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3353</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3354</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3400</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3401</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C3402</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3403</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3404</a> | 08-19311Z03 | CAP,CER 103KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3405</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3406</a> | 08-19311Z01 | CAP,CER 104KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3407</a> | 08-23326Z05 | CAP,CER 105KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3408</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3410</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3411</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3412</a> | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3430</a> | 08S65670Y08 | CAP,CER 225KX5R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3431</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3432</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3440</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3441</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| AUDIO-P.W.Board |     |       | <a href="#">C3442</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3460</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3461</a> | 08-15113Z01 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3462</a> | 08S65669Y05 | CAP,CER 106KX7R0J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3464</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">C3470</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3471</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3480</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3481</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| AUDIO-P.W.Board |     |       | <a href="#">C3482</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3490</a> | 08S65676Y02 | CAP,CER 475KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3492</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3493</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3494</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3495</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3496</a> | 08-15113Z03 | CAP,CER 475KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3499</a> | 08-23326Z05 | CAP,CER 105KX7R1A-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3502</a> | 08-15113Z01 | CAP,CER 225KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3510</a> | 08-23325Z07 | CAP,CER 103KX7R1C-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3512</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3550</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3551</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3552</a> | 08S45232Y21 | CAP,CER 104K-B1A-CP  |
| AUDIO-P.W.Board |     |       | <a href="#">C3602</a> | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |     |       | <a href="#">C3603</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS                                                                                 | MODEL | Ref.                   | Parts No.   | Parts Name           |
|-----------------|-------------------------------------------------------------------------------------|-------|------------------------|-------------|----------------------|
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3604</a>  | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3605</a>  | 08S65676Y10 | CAP,CER 106KX7R1C-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3607</a>  | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3608</a>  | 08S65676Y09 | CAP,CER 475KX7R1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3610</a>  | 08-23325Z04 | CAP,CER 332KX7R1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3611</a>  | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3612</a>  | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3613</a>  | 08S65677Y06 | CAP,CER 226MX7R1C-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3615</a>  | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3616</a>  | 08S65676Y09 | CAP,CER 475KX7R1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">C3617</a>  | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">CB2000</a> | 09-14451Z06 | FFC,502790-3091 -ED  |
| AUDIO-P.W.Board |   |       | <a href="#">CB3100</a> | 09T35473Y16 | WTB,F169B001-16 -DB  |
| AUDIO-P.W.Board |  |       | <a href="#">CB3120</a> | 09-25106Z01 | WTB,S10B-PUDSS-1 -DB |
| AUDIO-P.W.Board |  |       | <a href="#">CB3130</a> | 09-25106Z02 | WTB,S12B-PUDSS-1 -DB |
| AUDIO-P.W.Board |  |       | <a href="#">CB3140</a> | 09-25106Z07 | WTB,S22B-PUDSS-1 -DB |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">CB3150</a> | 09-16961Z09 | WTB,A1257WV0-10PS-ED |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">CB3490</a> | 09T85454W03 | WTB,53398-0371 -E6   |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">CH3300</a> | 09-29653Z01 | BTB,FX23-100S-0.5S-T |
| AUDIO-P.W.Board |                                                                                     |       | <a href="#">D2460</a>  | 48-17624Z01 | DIO,DA3J102D0L -CP   |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name          |
|-----------------|-----|-------|-----------------------|-------------|---------------------|
| AUDIO-P.W.Board |     |       | <a href="#">D2461</a> | 48-17624Z01 | DIO,DA3J102D0L -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">D2462</a> | 48-17624Z01 | DIO,DA3J102D0L -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">D2650</a> | 48-05965Z01 | DIO,1SS361-L -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">D2901</a> | 48-17547Z01 | DIO,DA3J101F0L -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">D3200</a> | 48-05965Z01 | DIO,1SS361-L -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">D3201</a> | 48-05164Z01 | DIO,1SS352-TPH3 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">D3202</a> | 48-05965Z01 | DIO,1SS361-L -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">D3204</a> | 48-05965Z01 | DIO,1SS361-L -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">D3205</a> | 48-05164Z01 | DIO,1SS352-TPH3 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">D3400</a> | 48T75527Y01 | DIO,1SR154-400 -E1  |
| AUDIO-P.W.Board |     |       | <a href="#">E2404</a> | 23-31100Z12 | CAP,MAK 101-1C -E6  |
| AUDIO-P.W.Board |     |       | <a href="#">E2405</a> | 23-31100Z07 | CAP,MAK 101-1A -E6  |
| AUDIO-P.W.Board |     |       | <a href="#">E2420</a> | 23-31100Z10 | CAP,MAK 22R-1C -E3  |
| AUDIO-P.W.Board |     |       | <a href="#">E2421</a> | 23-31100Z10 | CAP,MAK 22R-1C -E3  |
| AUDIO-P.W.Board |     |       | <a href="#">E2440</a> | 23S75244Y19 | CAP,ELY 101-1C -E6  |
| AUDIO-P.W.Board |     |       | <a href="#">E2441</a> | 23S75244Y17 | CAP,ELY 22R-1C -E2  |
| AUDIO-P.W.Board |     |       | <a href="#">E2442</a> | 23S75244Y17 | CAP,ELY 22R-1C -E2  |
| AUDIO-P.W.Board |     |       | <a href="#">E2460</a> | 23-31100Z26 | CAP,MAK 3R3-1H -E2  |
| AUDIO-P.W.Board |     |       | <a href="#">E2461</a> | 23-31100Z26 | CAP,MAK 3R3-1H -E2  |
| AUDIO-P.W.Board |     |       | <a href="#">E2600</a> | 23-31100Z17 | CAP,MAK 10R-1E -E3  |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name         |
|-----------------|-----|-------|-----------------------|-------------|--------------------|
| AUDIO-P.W.Board |     |       | <a href="#">E2601</a> | 23-31100Z17 | CAP,MAK 10R-1E -E3 |
| AUDIO-P.W.Board |     |       | <a href="#">E2650</a> | 23S75244Y19 | CAP,ELY 101-1C -E6 |
| AUDIO-P.W.Board |     |       | <a href="#">E3100</a> | 23-19876Z04 | CAP,CST 472-1E +   |
| AUDIO-P.W.Board |     |       | <a href="#">E3200</a> | 23-31100Z17 | CAP,MAK 10R-1E -E3 |
| AUDIO-P.W.Board |     |       | <a href="#">E3300</a> | 23S75244Y31 | CAP,ELY 471-1E -EA |
| AUDIO-P.W.Board |     |       | <a href="#">E3301</a> | 23S75244Y22 | CAP,ELY 471-1C -EA |
| AUDIO-P.W.Board |     |       | <a href="#">E3400</a> | 23S75244Y19 | CAP,ELY 101-1C -E6 |
| AUDIO-P.W.Board |     |       | <a href="#">E3404</a> | 23S75244Y24 | CAP,ELY 10R-1E -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">E3405</a> | 23S75244Y25 | CAP,ELY 22R-1E -E3 |
| AUDIO-P.W.Board |     |       | <a href="#">E3406</a> | 23S75244Y14 | CAP,ELY 681-1A -EA |
| AUDIO-P.W.Board |     |       | <a href="#">E3430</a> | 23S75244Y25 | CAP,ELY 22R-1E -E3 |
| AUDIO-P.W.Board |     |       | <a href="#">E3440</a> | 23S75244Y01 | CAP,ELY 22R-0J -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">E3470</a> | 23S75244Y01 | CAP,ELY 22R-0J -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">E3471</a> | 23-31100Z11 | CAP,MAK 47R-1C -E6 |
| AUDIO-P.W.Board |     |       | <a href="#">E3480</a> | 23S75244Y01 | CAP,ELY 22R-0J -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">E3510</a> | 23S75244Y01 | CAP,ELY 22R-0J -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">E3511</a> | 23-31100Z06 | CAP,MAK 33R-1A -E3 |
| AUDIO-P.W.Board |     |       | <a href="#">E3600</a> | 23S75244Y05 | CAP,ELY 331-0J -E6 |
| AUDIO-P.W.Board |     |       | <a href="#">E3601</a> | 23S75244Y24 | CAP,ELY 10R-1E -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">E3602</a> | 23S75244Y24 | CAP,ELY 10R-1E -E2 |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                   | Parts No.   | Parts Name           |
|-----------------|-----|-------|------------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">IC2000</a> | 83-31628Z30 | V0.960_LIMOGM_BU     |
| AUDIO-P.W.Board |     |       | <a href="#">IC2000</a> | 51-23912Z01 | MTP,D70F3479AGJAQ-QT |
| AUDIO-P.W.Board |     |       | <a href="#">IC2001</a> | 51T15185Y03 | TC7SH08FU,LJ -CP     |
| AUDIO-P.W.Board |     |       | <a href="#">IC2180</a> | 51-24805Z01 | BR24T16F-WGE2 -SE2   |
| AUDIO-P.W.Board |     |       | <a href="#">IC2190</a> | 51-04315Z22 | BU4229G-TR -CP       |
| AUDIO-P.W.Board |     |       | <a href="#">IC2200</a> | 51-30382Z02 | SAF7754HV/N205 -QT   |
| AUDIO-P.W.Board |     |       | <a href="#">IC2201</a> | 51-29083Z01 | SN74AHC04QPWRG4-SE2  |
| AUDIO-P.W.Board |     |       | <a href="#">IC2202</a> | 83-31628Z34 | V1.100_LIMO_DiRaNA3  |
| AUDIO-P.W.Board |     |       | <a href="#">IC2202</a> | 51-18520Z01 | MX25L8035EM21-10G-ST |
| AUDIO-P.W.Board |     |       | <a href="#">IC2203</a> | 51-29083Z01 | SN74AHC04QPWRG4-SE2  |
| AUDIO-P.W.Board |     |       | <a href="#">IC2400</a> | 51-16740Z01 | BD3461FS-E2 -SE6     |
| AUDIO-P.W.Board |     |       | <a href="#">IC2420</a> | 51T25576W07 | NJM4580V-TE2 -SE2    |
| AUDIO-P.W.Board |     |       | <a href="#">IC2421</a> | 51T25576W07 | NJM4580V-TE2 -SE2    |
| AUDIO-P.W.Board |     |       | <a href="#">IC2422</a> | 51T25576W07 | NJM4580V-TE2 -SE2    |
| AUDIO-P.W.Board |     |       | <a href="#">IC2440</a> | 51-20907Z01 | TPS60402QDBVRQ1 -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">IC2441</a> | 51-16845Z04 | TAR5S50U-TE85L -CP   |
| AUDIO-P.W.Board |     |       | <a href="#">IC2501</a> | 51-27602Z01 | AK7736AVQ -QE6       |
| AUDIO-P.W.Board |     |       | <a href="#">IC2600</a> | 51-30375Z01 | STPA003OD-4WX -ZS    |
| AUDIO-P.W.Board |     |       | <a href="#">IC2850</a> | 51T25141Y03 | TC7SHU04FU,LJ -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">IC2851</a> | 51-27637Z01 | SI4749-C10-AMR -LE2  |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                   | Parts No.   | Parts Name                 |
|-----------------|-----|-------|------------------------|-------------|----------------------------|
| AUDIO-P.W.Board |     |       | <a href="#">IC3000</a> | 51-29945Z01 | SAF3600EL/V1040A-BEA       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3001</a> | 83-31628Z35 | VC0004.004R1_LIMOUS_Saturn |
| AUDIO-P.W.Board |     |       | <a href="#">IC3001</a> | 51-30259Z02 | S25FL116K0XMFA040-ST       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3150</a> | 51T15194Y03 | 74VHCT08AFT-EL -SE2        |
| AUDIO-P.W.Board |     |       | <a href="#">IC3200</a> | 51T65016Y26 | S-80937CNMC-T2 -CP         |
| AUDIO-P.W.Board |     |       | <a href="#">IC3206</a> | 51-02032Z02 | TC7SET02FU,LJ -CP          |
| AUDIO-P.W.Board |     |       | <a href="#">IC3207</a> | 51T15614Y01 | TC74HC4051AFT-EL-SE5       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3208</a> | 51T15614Y01 | TC74HC4051AFT-EL-SE5       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3209</a> | 51T35360Y01 | TC7WH08FU-L -SE1           |
| AUDIO-P.W.Board |     |       | <a href="#">IC3210</a> | 51T15194Y03 | 74VHCT08AFT-EL -SE2        |
| AUDIO-P.W.Board |     |       | <a href="#">IC3211</a> | 51T15647Y01 | NJM4558V-TE2 -SE2          |
| AUDIO-P.W.Board |     |       | <a href="#">IC3400</a> | 51-13711Z02 | TB2920AHQ -ZS              |
| AUDIO-P.W.Board |     |       | <a href="#">IC3430</a> | 51-28614Z01 | BD00FC0EEFJ-ME2 -SE2       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3440</a> | 51-23593Z02 | BD00IC0WEFJ-ME2 -SE2       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3460</a> | 51-23593Z02 | BD00IC0WEFJ-ME2 -SE2       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3470</a> | 51-23593Z05 | BD00IA5EEFJ-ME2 -SE2       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3480</a> | 51-23593Z02 | BD00IC0WEFJ-ME2 -SE2       |
| AUDIO-P.W.Board |     |       | <a href="#">IC3510</a> | 51-07902Z02 | NJM2871BF33-TE1 -CP        |
| AUDIO-P.W.Board |     |       | <a href="#">IC3601</a> | 51-28779Z02 | BD90640EFJ-CE2 -SE2        |
| AUDIO-P.W.Board |     |       | <a href="#">IC3602</a> | 51-28779Z01 | BD90620EFJ-CE2 -SE2        |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">L2200</a> | 24-24463Z01 | FBI,BLM15HD601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2201</a> | 24-24463Z01 | FBI,BLM15HD601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2202</a> | 24-24463Z01 | FBI,BLM15HD601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2203</a> | 24-17733Z06 | IND,NLCV32T 47RK -CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2204</a> | 24-17733Z06 | IND,NLCV32T 47RK -CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2205</a> | 24-24463Z01 | FBI,BLM15HD601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2206</a> | 24-24463Z01 | FBI,BLM15HD601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2210</a> | 24-24463Z01 | FBI,BLM15HD601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2440</a> | 24T95202W25 | IND,CDRH64B 102M -E6 |
| AUDIO-P.W.Board |     |       | <a href="#">L2441</a> | 24T95202W25 | IND,CDRH64B 102M -E6 |
| AUDIO-P.W.Board |     |       | <a href="#">L2501</a> | 24-06212Z05 | FBI,BLM15BB121SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2502</a> | 24-06212Z05 | FBI,BLM15BB121SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2503</a> | 24-06212Z05 | FBI,BLM15BB121SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2850</a> | 24-06212Z01 | FBI,BLM15AG601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2851</a> | 24-09036Z10 | IND,LQW18AN R18J -CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2852</a> | 24-06212Z01 | FBI,BLM15AG601SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2902</a> | 24-30185Z23 | IND,LQW2BAS R22J -CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2904</a> | 24T25164Y12 | IND,FSLM2520 R82J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2905</a> | 24-09036Z11 | IND,LQW18AN R27J -CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2906</a> | 24T25164Y19 | IND,FSLM2520 3R3J-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                   | Parts No.   | Parts Name           |
|-----------------|-----|-------|------------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">L2950</a>  | 24T25164Y21 | IND,FSLM2520 4R7J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2951</a>  | 24T25164Y05 | IND,FSLM2520 R22J-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L2952</a>  | 24T15278Y03 | IND,BM-7A -DB        |
| AUDIO-P.W.Board |     |       | <a href="#">L2953</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L3150</a>  | 24-06212Z08 | FBI,BLM15BD102SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L3490</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L3492</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L3493</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L3494</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP |
| AUDIO-P.W.Board |     |       | <a href="#">L3495</a>  | 24-28869Z04 | FBI,BKP1608HS121 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">L3601</a>  | 24-17581Z02 | IND,NRS5020T 1R5N-E2 |
| AUDIO-P.W.Board |     |       | <a href="#">L3602</a>  | 24-08610Z03 | IND,DS106C2 10RM -EA |
| AUDIO-P.W.Board |     |       | <a href="#">L3603</a>  | 24-22371Z01 | IND,NRS4018T 2R2M-E2 |
| AUDIO-P.W.Board |     |       | <a href="#">L3604</a>  | 24-08610Z05 | IND,DS106C2 33RM -EA |
| AUDIO-P.W.Board |     |       | <a href="#">PS3101</a> | 48-16589Z01 | POLY,SW SMDC075F -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">PS3150</a> | 48-16589Z03 | POLY,SW SMDC150F -E2 |
| AUDIO-P.W.Board |     |       | <a href="#">Q2000</a>  | 48T25737Y02 | TR,UMD3N-TR -CP      |
| AUDIO-P.W.Board |     |       | <a href="#">Q2001</a>  | 48T25737Y02 | TR,UMD3N-TR -CP      |
| AUDIO-P.W.Board |     |       | <a href="#">Q2460</a>  | 48T75180Y04 | TR,IMH23-T110 -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">Q2461</a>  | 48T75180Y04 | TR,IMH23-T110 -CP    |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">Q2462</a> | 48T75180Y04 | TR,IMH23-T110 -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">Q2650</a> | 48T25737Y02 | TR,UMD3N-TR -CP      |
| AUDIO-P.W.Board |     |       | <a href="#">Q2651</a> | 48-20093Z01 | TR,DMC561010R -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">Q2652</a> | 48T25737Y01 | TR,UMD2N-TR -CP      |
| AUDIO-P.W.Board |     |       | <a href="#">Q2950</a> | 48-29875Z01 | TR,2SC5084-O -CP     |
| AUDIO-P.W.Board |     |       | <a href="#">Q3200</a> | 48-12999Z01 | TR,LTA114EUBFS8-TLCP |
| AUDIO-P.W.Board |     |       | <a href="#">Q3202</a> | 48-13000Z05 | TR,LTC124EUBFS8-TLCP |
| AUDIO-P.W.Board |     |       | <a href="#">Q3203</a> | 48T25737Y01 | TR,UMD2N-TR -CP      |
| AUDIO-P.W.Board |     |       | <a href="#">Q3204</a> | 48-13000Z01 | TR,LTC114EUBFS8-TLCP |
| AUDIO-P.W.Board |     |       | <a href="#">Q3205</a> | 48T25737Y01 | TR,UMD2N-TR -CP      |
| AUDIO-P.W.Board |     |       | <a href="#">Q3207</a> | 48-13000Z01 | TR,LTC114EUBFS8-TLCP |
| AUDIO-P.W.Board |     |       | <a href="#">Q3208</a> | 48-17548Z01 | TR,DSA500100L -CP    |
| AUDIO-P.W.Board |     |       | <a href="#">R2001</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2005</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2006</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2007</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2008</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2009</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2010</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2011</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2012</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2014</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2015</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2016</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2017</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2019</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2023</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2024</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2025</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2026</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2027</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2028</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2030</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2031</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2032</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2033</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2034</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2036</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2039</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2040</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2042</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2043</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2044</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2045</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2046</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2047</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2048</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2060</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2061</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2062</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2063</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2064</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2070</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2071</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2072</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2073</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2074</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2076</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2077</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2078</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2083</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2089</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2092</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2093</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2100</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2101</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2103</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2104</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2105</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2108</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2109</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2110</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2111</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2170</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2171</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2180</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2181</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2190</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2191</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2192</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2204</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2207</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2211</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2212</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2213</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2214</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2215</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2216</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2217</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2218</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2219</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2220</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2221</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2222</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2224</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2225</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2226</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2227</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2228</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2229</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2230</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2231</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2232</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2233</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2249</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2250</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2251</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2253</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2254</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2255</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2256</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2258</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2260</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2262</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2263</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2265</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2268</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2270</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2273</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2274</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2400</a> | 06S65415Y34 | RES,RK 562F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2401</a> | 06-25919Z12 | RES,RK 623F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2402</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2404</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2405</a> | 06S65415Y48 | RES,RK 823F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2406</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2407</a> | 06S65415Y48 | RES,RK 823F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2408</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2409</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2420</a> | 06S65415Y49 | RES,RK 104F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2421</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2422</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2423</a> | 06S65415Y49 | RES,RK 104F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2424</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2425</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2426</a> | 06S65415Y49 | RES,RK 104F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2427</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2428</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2429</a> | 06S65415Y49 | RES,RK 104F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2430</a> | 06S65415Y49 | RES,RK 104F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2431</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2432</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2433</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2434</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2435</a> | 06S65415Y49 | RES,RK 104F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2436</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2437</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2460</a> | 06S15615Y94 | RES,RK 753J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2461</a> | 06S15615Y94 | RES,RK 753J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2462</a> | 06S15615Y94 | RES,RK 753J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2463</a> | 06S15615Y94 | RES,RK 753J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2464</a> | 06S15615Y94 | RES,RK 753J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2465</a> | 06S15615Y94 | RES,RK 753J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2466</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2467</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2468</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2469</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2470</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2471</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2472</a> | 06S70072F37 | RES,CP .221-J-1/4-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2473</a> | 06S70072F37 | RES,CP .221-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2474</a> | 06S70072F37 | RES,CP .221-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2475</a> | 06S70072F37 | RES,CP .221-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2476</a> | 06S70072F37 | RES,CP .221-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2477</a> | 06S70072F37 | RES,CP .221-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2501</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2502</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2503</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2504</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2505</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2507</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2508</a> | 06S15615Y61 | RES,RK 332J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2510</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2517</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2518</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2521</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2527</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2604</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2605</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2650</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2651</a> | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2652</a> | 06S15615Y47 | RES,RK 821J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2653</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2654</a> | 06S45674W41 | RES,RK 221J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2655</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2850</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2851</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2852</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2853</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2854</a> | 06S65415Y59 | RES,RK 684F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2855</a> | 06S15616Y43 | RES,RK 106J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2856</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2857</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2858</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2859</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2860</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2864</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2866</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2902</a> | 06S15594Y14 | RES,RK 474F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2903</a> | 06S15594Y14 | RES,RK 474F 1/10 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R2904</a> | 06S65415Y11 | RES,RK 68RF 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2905</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2906</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2950</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2963</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2965</a> | 06S65415Y05 | RES,RK 22RF 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2966</a> | 06S65415Y10 | RES,RK 56RF 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R2967</a> | 06S35083Y19 | RES,RK 331F 1/4 -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">R3000</a> | 06S15616Y14 | RES,RK 474J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3007</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3008</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3009</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3010</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3011</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3012</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3014</a> | 06S15615Y19 | RES,RK 56RJ 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3015</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3016</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3019</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3023</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R3025</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3100</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3102</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3103</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3104</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3130</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3131</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3132</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3133</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3134</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3135</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3140</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3141</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3142</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3143</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3144</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3145</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3146</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3147</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3148</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R3149</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3150</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3151</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3152</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3153</a> | 06S70072F51 | RES,CP .821-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3154</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3155</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3156</a> | 06S70072F98 | RES,RK 223J 1/4 -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">R3158</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3159</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3160</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3161</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3162</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3163</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3164</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3165</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3200</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3202</a> | 06S15616Y14 | RES,RK 474J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3203</a> | 06S35083Y39 | RES,RK 153F 1/4 -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">R3204</a> | 06S15593Y86 | RES,RK 363F 1/10 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R3205</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3206</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3207</a> | 06S35083Y43 | RES,RK 333F 1/4 -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">R3208</a> | 06S35083Y40 | RES,RK 183F 1/4 -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">R3209</a> | 06S70072F69 | RES,CP .472-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3210</a> | 06S70072F69 | RES,CP .472-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3211</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3213</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3217</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3218</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3219</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3234</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3235</a> | 06S15593Y61 | RES,RK 332F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3236</a> | 06S45674W65 | RES,RK 222J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3237</a> | 06S15593Y81 | RES,RK 223F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3239</a> | 06S15615Y33 | RES,RK 221J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3246</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3249</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3250</a> | 06S65415Y50 | RES,RK 124F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3251</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R3252</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3254</a> | 06S65415Y50 | RES,RK 124F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3400</a> | 06S15594Y01 | RES,RK 134F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3401</a> | 06S15594Y08 | RES,RK 274F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3402</a> | 06S15593Y91 | RES,RK 563F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3403</a> | 06S15593Y93 | RES,RK 683F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3404</a> | 06S15593Y67 | RES,RK 562F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3405</a> | 06S15594Y17 | RES,RK 624F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3406</a> | 06S15593Y93 | RES,RK 683F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3407</a> | 06S70072F63 | RES,CP .272-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3408</a> | 06S65415Y32 | RES,RK 392F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3409</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3410</a> | 06S70072F77 | RES,CP .103-J-1/4-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3411</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3412</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3413</a> | 06S65415Y43 | RES,RK 333F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3414</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3415</a> | 06S15593Y66 | RES,RK 512F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3430</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3431</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R3432</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3433</a> | 06S15594Y19 | RES,RK 754F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3440</a> | 06S15593Y99 | RES,RK 124F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3442</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3443</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3444</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3445</a> | 06S15593Y66 | RES,RK 512F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3461</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3462</a> | 06S65415Y18 | RES,RK 271F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3463</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3464</a> | 06S15593Y67 | RES,RK 562F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3465</a> | 06S15593Y91 | RES,RK 563F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3471</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3472</a> | 06S65415Y21 | RES,RK 471F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3473</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3474</a> | 06S15593Y71 | RES,RK 822F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3475</a> | 06S15594Y19 | RES,RK 754F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3480</a> | 06S15593Y67 | RES,RK 562F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3482</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3483</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|-----------------|-----|-------|-----------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R3484</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3485</a> | 06S15593Y92 | RES,RK 623F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3492</a> | 06S35083Y64 | RES,RK 3R3F 1/4 -CP  |
| AUDIO-P.W.Board |     |       | <a href="#">R3493</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3510</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3511</a> | 06S15593Y66 | RES,RK 512F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3512</a> | 06S15594Y01 | RES,RK 134F 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3601</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3603</a> | 06S65415Y31 | RES,RK 332F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3604</a> | 06S65415Y42 | RES,RK 273F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3606</a> | 06S65415Y27 | RES,RK 152F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3609</a> | 06S15615Y69 | RES,RK 682J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3610</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3611</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3613</a> | 06S65415Y31 | RES,RK 332F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3614</a> | 06S65415Y42 | RES,RK 273F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3616</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3619</a> | 06S15615Y79 | RES,RK 183J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3620</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">R3630</a> | 06S70072F31 | RES,CP .121-J-1/4-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS | MODEL | Ref.                   | Parts No.   | Parts Name           |
|-----------------|-----|-------|------------------------|-------------|----------------------|
| AUDIO-P.W.Board |     |       | <a href="#">R3631</a>  | 06S45674W45 | RES,RK 331J 1/10 -CP |
| AUDIO-P.W.Board |     |       | <a href="#">SA2901</a> | 08-19391Z01 | VST,IMSA-6803-01Y-CP |
| AUDIO-P.W.Board |     |       | <a href="#">SD2440</a> | 48-22179Z01 | DIO,SHT DB3X313F0LCP |
| AUDIO-P.W.Board |     |       | <a href="#">SD2441</a> | 48T35138Y01 | DIO,SHT RB160L-40-E1 |
| AUDIO-P.W.Board |     |       | <a href="#">SD3601</a> | 48-19296Z01 | DIO,SHT RB056L-40-E1 |
| AUDIO-P.W.Board |     |       | <a href="#">SD3602</a> | 48-19296Z01 | DIO,SHT RB056L-40-E1 |
| AUDIO-P.W.Board |     |       | <a href="#">T3100</a>  | 25-12466Z01 | CHOKE,GLI-UB3442 -DB |
| AUDIO-P.W.Board |     |       | <a href="#">TH2000</a> | 48T75219Y02 | TMT,NCP18WB473F1S-CP |
| AUDIO-P.W.Board |     |       | <a href="#">VT2901</a> | 24-29820Z01 | COIL,RF FM M5-N/R-E5 |
| AUDIO-P.W.Board |     |       | <a href="#">XL2000</a> | 91-16024Z01 | XTL,AT-41CD2 3.98-E9 |
| AUDIO-P.W.Board |     |       | <a href="#">XL2200</a> | 91-26661Z31 | XTL,NX3225SAAG55.4CP |
| AUDIO-P.W.Board |     |       | <a href="#">XL2501</a> | 91-26661Z02 | XTL,NX3225SAAG12.2CP |
| AUDIO-P.W.Board |     |       | <a href="#">XL2850</a> | 91-26198Z03 | XTL,NX3215 32.7NS-E1 |
| AUDIO-P.W.Board |     |       | <a href="#">XL3001</a> | 91-26661Z31 | XTL,NX3225SAAG55.4CP |
| AUDIO-P.W.Board |     |       | <a href="#">ZD3100</a> | 48-23921Z01 | DIO,ZEN ZSH5MAZ27-ED |
| AUDIO-P.W.Board |     |       | <a href="#">ZD3130</a> | 48-21149Z23 | DIO,ZEN DZ2J056M0LCP |
| AUDIO-P.W.Board |     |       | <a href="#">ZD3150</a> | 48-21149Z23 | DIO,ZEN DZ2J056M0LCP |
| AUDIO-P.W.Board |     |       | <a href="#">ZD3151</a> | 48-21149Z23 | DIO,ZEN DZ2J056M0LCP |
| AUDIO-P.W.Board |     |       | <a href="#">ZD3152</a> | 48-21149Z23 | DIO,ZEN DZ2J056M0LCP |
| AUDIO-P.W.Board |     |       | <a href="#">ZD3200</a> | 48-16145Z36 | DIO,ZEN PZU9.1B1 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board       | MIS                                                                               | MODEL | Ref.                    | Parts No.   | Parts Name           |
|-----------------|-----------------------------------------------------------------------------------|-------|-------------------------|-------------|----------------------|
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">ZD3201</a>  | 48-21149Z23 | DIO,ZEN DZ2J056M0LCP |
| AUDIO-P.W.Board |                                                                                   |       | <a href="#">ZD3202</a>  | 48-01607Z08 | DIO,ZEN LUDZ3.9B -CP |
| I.MX-P.W.Board  |  |       | <a href="#">ANT5501</a> | 09-07494Z01 | U.FL-R-SMT-1(80)-E2  |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4000</a>   | 08S45231Y05 | CAP,CER 2R0C-CK1H-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4001</a>   | 08S45231Y05 | CAP,CER 2R0C-CK1H-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4002</a>   | 08S45231Y10 | CAP,CER 7R0D-CH1H-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4003</a>   | 08S45231Y10 | CAP,CER 7R0D-CH1H-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4007</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4008</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4009</a>   | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4010</a>   | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4014</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4015</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4016</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4017</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4018</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4024</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4025</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4026</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board  |                                                                                   |       | <a href="#">C4027</a>   | 08-12461Z01 | CAP,CER 104M-C80J-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C4028</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4029</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4030</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4031</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4032</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4033</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4034</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4035</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4036</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4037</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4038</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4039</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4040</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4041</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4042</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4043</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4044</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4045</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4046</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4047</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C4048</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4049</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4050</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4051</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4052</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4053</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4054</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4055</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4056</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4057</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4058</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4061</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4063</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4064</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4065</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4066</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4067</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4068</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4069</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4070</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C4071</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4072</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4073</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4074</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4075</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4076</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4077</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4078</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4079</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4080</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4081</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4082</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4083</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4200</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4201</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4202</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4203</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4204</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4205</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4206</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C4207</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4208</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4209</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4210</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4211</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4212</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4213</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4214</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4215</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4216</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4217</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4218</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4219</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4220</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4221</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4222</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4223</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4224</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4225</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4226</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C4227</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4228</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4229</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4230</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4231</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4232</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4233</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4234</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4235</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4236</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4237</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4238</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4239</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4240</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4241</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4242</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4243</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4244</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4245</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4246</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C4247</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4248</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4249</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4250</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4251</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4252</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4253</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4254</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4255</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4256</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4257</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4258</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4259</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4260</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4261</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4262</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4263</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4264</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4265</a> | 08-12461Z01 | CAP,CER 104M-C80J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4266</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C4267</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4268</a> | 08-13830Z01 | CAP,CER 476MX6S0G-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4269</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4270</a> | 08-13830Z01 | CAP,CER 476MX6S0G-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4271</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4300</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4301</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4302</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4400</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4401</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4402</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4403</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4404</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4500</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4600</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4601</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4602</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C4603</a> | 08S65668Y07 | CAP,CER 103KX5R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C4700</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5000</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5001</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5002</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5003</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5004</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5005</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5006</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5007</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5008</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5009</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5010</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5011</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5012</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5100</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5101</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5102</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5103</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5104</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5105</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5106</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5107</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5108</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5109</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5110</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5111</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5112</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5113</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5114</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5115</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5200</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5201</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5202</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5203</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5204</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5205</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5206</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5207</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5208</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5209</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5210</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5211</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5212</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5213</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5214</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5215</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5216</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5217</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5218</a> | 08S35374W10 | CAP,CER 225K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5219</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5220</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5221</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5222</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5223</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5224</a> | 08-26091Z01 | CAP,CER 102KX7R2J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5225</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5226</a> | 08-26091Z01 | CAP,CER 102KX7R2J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5227</a> | 08S45231Y15 | CAP,CER 15RJ-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5228</a> | 08S45231Y15 | CAP,CER 15RJ-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5300</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5301</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5302</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5303</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5304</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5305</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5306</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5307</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5308</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5309</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5310</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5311</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5312</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5313</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5314</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5315</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5316</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5317</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5318</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5319</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5320</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5321</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5322</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5323</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5324</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5325</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5326</a> | 08S45231Y09 | CAP,CER 6R0D-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5327</a> | 08S45231Y09 | CAP,CER 6R0D-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5400</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5401</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5402</a> | 08S35349Y17 | CAP,CER 225K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5403</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5404</a> | 08S35349Y17 | CAP,CER 225K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5405</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5406</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5407</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5408</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5409</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5410</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5411</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5412</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5413</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5500</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

|                |  |  |                       |             |                      |
|----------------|--|--|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |  |  | <a href="#">C5501</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5502</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5503</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5504</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5505</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5506</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5509</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5510</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5511</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5512</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5513</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5514</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5515</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5516</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5517</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5518</a> | 08S35349Y12 | CAP,CER 105K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5519</a> | 08S35374W12 | CAP,CER 106K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5600</a> | 08S45232Y17 | CAP,CER 104K-B0J -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5601</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5602</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

|                |  |  |                       |             |                      |
|----------------|--|--|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |  |  | <a href="#">C5603</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5604</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5605</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5606</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5607</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5608</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5609</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5610</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5611</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5612</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5613</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5614</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5615</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5616</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5617</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5618</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| I.MX-P.W.Board |  |  | <a href="#">C5619</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5620</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5621</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |  |  | <a href="#">C5622</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5623</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5624</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5625</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5626</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5627</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5628</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5629</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5630</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5631</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5632</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5633</a> | 08S45676W93 | CAP,CER 224K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5650</a> | 08S65671Y04 | CAP,CER 106KX5R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5651</a> | 08S45232Y08 | CAP,CER 332K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5652</a> | 08S45231Y33 | CAP,CER 471J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5653</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5655</a> | 08-14627Z01 | CAP,CER 107MX5R0J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5657</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5659</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5680</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5700</a> | 08S45231Y05 | CAP,CER 2R0C-CK1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5701</a> | 08S45231Y05 | CAP,CER 2R0C-CK1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5702</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5703</a> | 08S65671Y04 | CAP,CER 106KX5R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5704</a> | 08S65671Y04 | CAP,CER 106KX5R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5705</a> | 08S65676Y09 | CAP,CER 475KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5706</a> | 08S35349Y21 | CAP,CER 104K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5707</a> | 08S65670Y06 | CAP,CER 226KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5708</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5709</a> | 08S65676Y09 | CAP,CER 475KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5710</a> | 08S35349Y16 | CAP,CER 105K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5711</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5712</a> | 08S45231Y13 | CAP,CER 10RD-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5713</a> | 08S45232Y05 | CAP,CER 102K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5714</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5715</a> | 08S45231Y11 | CAP,CER 8R0D-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5716</a> | 08S45231Y11 | CAP,CER 8R0D-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5800</a> | 08S65676Y09 | CAP,CER 475KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5801</a> | 08S35374W10 | CAP,CER 225K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5802</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5803</a> | 08S45676W73 | CAP,CER.103K-B1H -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C5804</a> | 08S45232Y11 | CAP,CER 103K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5806</a> | 08S35374W11 | CAP,CER 475K-B0J -CP |
| I.MX-P.W.Board |     |       | <a href="#">C5807</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C5808</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6000</a> | 08S65676Y10 | CAP,CER 106KX7R1C-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6001</a> | 08S45232Y08 | CAP,CER 332K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6002</a> | 08S45232Y08 | CAP,CER 332K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6003</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6005</a> | 08-14627Z01 | CAP,CER 107MX5R0J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6006</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6007</a> | 08-15113Z03 | CAP,CER 475KX7R1C-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6008</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6009</a> | 08S35374W10 | CAP,CER 225K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6010</a> | 08-15113Z03 | CAP,CER 475KX7R1C-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6011</a> | 08S35374W10 | CAP,CER 225K-B1A -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6012</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6013</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6014</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6015</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6300</a> | 08S65668Y07 | CAP,CER 103KX5R1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C6301</a> | 08S65668Y07 | CAP,CER 103KX5R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6302</a> | 08S65668Y07 | CAP,CER 103KX5R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6310</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6311</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6312</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6313</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6314</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6315</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6320</a> | 08S45231Y38 | CAP,CER 102J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6400</a> | 08S45676W83 | CAP,CER 473K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6401</a> | 08S65670Y04 | CAP,CER 475KX5R1E-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6402</a> | 08S65670Y04 | CAP,CER 475KX5R1E-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6403</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6404</a> | 08S45676W83 | CAP,CER 473K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6405</a> | 08S65670Y04 | CAP,CER 475KX5R1E-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6406</a> | 08S65670Y04 | CAP,CER 475KX5R1E-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6407</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6408</a> | 08S65669Y03 | CAP,CER 224KX7R1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6409</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6410</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">C6411</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6412</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6413</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6414</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| I.MX-P.W.Board |     |       | <a href="#">C6415</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| I.MX-P.W.Board |     |       | <a href="#">C6416</a> | 08S45676W73 | CAP,CER.103K-B1H -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6417</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| I.MX-P.W.Board |     |       | <a href="#">C6418</a> | 08S45231Y31 | CAP,CER 331J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6419</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6420</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| I.MX-P.W.Board |     |       | <a href="#">C6421</a> | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| I.MX-P.W.Board |     |       | <a href="#">C6422</a> | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6423</a> | 08-26091Z01 | CAP,CER 102KX7R2J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6424</a> | 08S65669Y05 | CAP,CER 106KX7R0J-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6425</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6426</a> | 08S65668Y05 | CAP,CER 224KX5R1A-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6427</a> | 08S45231Y17 | CAP,CER 22RJ-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6428</a> | 08S35350Y03 | CAP,CER 224K-B1C -CP |
| I.MX-P.W.Board |     |       | <a href="#">C6429</a> | 08S45231Y17 | CAP,CER 22RJ-CH1H-CP |
| I.MX-P.W.Board |     |       | <a href="#">C6430</a> | 08S65669Y05 | CAP,CER 106KX7R0J-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS                                                                               | MODEL | Ref.                   | Parts No.   | Parts Name           |
|----------------|-----------------------------------------------------------------------------------|-------|------------------------|-------------|----------------------|
| I.MX-P.W.Board |                                                                                   |       | <a href="#">C6431</a>  | 08S65676Y08 | CAP,CER 106K-X7R1ACP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">C6432</a>  | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">C6433</a>  | 08S45231Y25 | CAP,CER 101J-CH1H-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">CB4001</a> | 09-14451Z06 | FFC,502790-3091 -ED  |
| I.MX-P.W.Board |  |       | <a href="#">CB5100</a> | 09-25213Z01 | WTB,TCX3400-011187-T |
| I.MX-P.W.Board |  |       | <a href="#">CB5200</a> | 09-25213Z01 | WTB,TCX3400-011187-T |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">CB6100</a> | 09-19907Z03 | BTB,IMSA9984B-100YEZ |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">CB6300</a> | 09-29652Z01 | BTB,FX23-100P-0.5S-T |
| I.MX-P.W.Board |  |       | <a href="#">CB6400</a> | 09-25106Z05 | WTB,S18B-PUDSS-1 -DB |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D5101</a>  | 48-08988Z01 | VST,EZIZ0V800AA -CP  |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D5102</a>  | 48-08988Z01 | VST,EZIZ0V800AA -CP  |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D5104</a>  | 48-08988Z01 | VST,EZIZ0V800AA -CP  |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D5204</a>  | 48-05164Z01 | DIO,1SS352-TPH3 -CP  |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D5701</a>  | 48-08988Z01 | VST,EZIZ0V800AA -CP  |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D5702</a>  | 48-08988Z01 | VST,EZIZ0V800AA -CP  |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D6400</a>  | 48-19711Z01 | DIO,BAV99W -CP       |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">D6401</a>  | 48T75527Y01 | DIO,1SR154-400 -E1   |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">E4000</a>  | 23-22657Z06 | CAP,CX 221-0G -E2    |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">E4001</a>  | 23-22657Z06 | CAP,CX 221-0G -E2    |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">E5700</a>  | 23S75244Y19 | CAP,ELY 101-1C -E6   |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                   | Parts No.   | Parts Name           |
|----------------|-----|-------|------------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">E5701</a>  | 23-31100Z19 | CAP,MAK 33R-1E -E6   |
| I.MX-P.W.Board |     |       | <a href="#">E6310</a>  | 23-31100Z19 | CAP,MAK 33R-1E -E6   |
| I.MX-P.W.Board |     |       | <a href="#">F6200</a>  | 65-10745Z09 | FUSE,TF16AT 2.00A-CP |
| I.MX-P.W.Board |     |       | <a href="#">IC4000</a> | 51-29541Z01 | MCIMX6D6AVT08AD -BT  |
| I.MX-P.W.Board |     |       | <a href="#">IC4200</a> | 51-27163Z02 | H5TQ4G63CFR-RDC -BT  |
| I.MX-P.W.Board |     |       | <a href="#">IC4201</a> | 51-27163Z02 | H5TQ4G63CFR-RDC -BT  |
| I.MX-P.W.Board |     |       | <a href="#">IC4202</a> | 51-27163Z02 | H5TQ4G63CFR-RDC -BT  |
| I.MX-P.W.Board |     |       | <a href="#">IC4203</a> | 51-27163Z02 | H5TQ4G63CFR-RDC -BT  |
| I.MX-P.W.Board |     |       | <a href="#">IC4300</a> | 83-31628Z12 | V0.960_LIMOGM_nor    |
| I.MX-P.W.Board |     |       | <a href="#">IC4300</a> | 51-27465Z01 | S29GL256S90TFI010-ST |
| I.MX-P.W.Board |     |       | <a href="#">IC4400</a> | 83-31628Z21 | V0.960_LIMOGM_eMMC   |
| I.MX-P.W.Board |     |       | <a href="#">IC4400</a> | 51-29432Z01 | H26M41103HPR -BT     |
| I.MX-P.W.Board |     |       | <a href="#">IC4500</a> | 51-26850Z01 | MFI337S3959 -CP      |
| I.MX-P.W.Board |     |       | <a href="#">IC4600</a> | 51T15185Y03 | TC7SH08FU,LJ -CP     |
| I.MX-P.W.Board |     |       | <a href="#">IC4601</a> | 51T65003Y03 | TC7SZ05FU,LJ -CP     |
| I.MX-P.W.Board |     |       | <a href="#">IC4602</a> | 51T65003Y03 | TC7SZ05FU,LJ -CP     |
| I.MX-P.W.Board |     |       | <a href="#">IC4700</a> | 51T35220Y01 | TC7WH126FU-TE12L-SE1 |
| I.MX-P.W.Board |     |       | <a href="#">IC5000</a> | 51-19098Z01 | BU16002KVT-E2 -QEA   |
| I.MX-P.W.Board |     |       | <a href="#">IC5100</a> | 51-27798Z01 | ADV7511WBSWZ-RL -QEA |
| I.MX-P.W.Board |     |       | <a href="#">IC5200</a> | 51-29819Z01 | ADV7480WBBCZ -BT     |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                   | Parts No.   | Parts Name           |
|----------------|-----|-------|------------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">IC5300</a> | 51-29818Z01 | ML86V8201 -QT        |
| I.MX-P.W.Board |     |       | <a href="#">IC5400</a> | 51-29313Z01 | DS90UH927QSQ -LE6    |
| I.MX-P.W.Board |     |       | <a href="#">IC5500</a> | 51-29718Z01 | UGKZ4D6009A -NE9     |
| I.MX-P.W.Board |     |       | <a href="#">IC5501</a> | 51-13971Z01 | TC74VCX08FT-EL -SE5  |
| I.MX-P.W.Board |     |       | <a href="#">IC5502</a> | 51-15608Z01 | TC7WPN3125FK-TE85LCP |
| I.MX-P.W.Board |     |       | <a href="#">IC5503</a> | 51-15608Z01 | TC7WPN3125FK-TE85LCP |
| I.MX-P.W.Board |     |       | <a href="#">IC5504</a> | 51-15608Z01 | TC7WPN3125FK-TE85LCP |
| I.MX-P.W.Board |     |       | <a href="#">IC5600</a> | 51-29896Z01 | LTC3676HUI#TRA1 -LE6 |
| I.MX-P.W.Board |     |       | <a href="#">IC5650</a> | 51-28779Z02 | BD90640EFJ-CE2 -SE2  |
| I.MX-P.W.Board |     |       | <a href="#">IC5700</a> | 51-28538Z02 | MAX16984RATI/V+ -LE2 |
| I.MX-P.W.Board |     |       | <a href="#">IC5701</a> | 51-21632Z01 | BD11600NUX-E2 -CE1   |
| I.MX-P.W.Board |     |       | <a href="#">IC5800</a> | 51-28614Z01 | BD00FC0EEFJ-ME2 -SE2 |
| I.MX-P.W.Board |     |       | <a href="#">IC5801</a> | 51-28341Z01 | S-1323B52-N4BB30 -CP |
| I.MX-P.W.Board |     |       | <a href="#">IC6000</a> | 51-28779Z01 | BD90620EFJ-CE2 -SE2  |
| I.MX-P.W.Board |     |       | <a href="#">IC6001</a> | 51-23593Z02 | BD00IC0WEFJ-ME2 -SE2 |
| I.MX-P.W.Board |     |       | <a href="#">IC6002</a> | 51-23593Z05 | BD00IA5EEFJ-ME2 -SE2 |
| I.MX-P.W.Board |     |       | <a href="#">IC6400</a> | 51-12745Z01 | BH7073G-TR -CP       |
| I.MX-P.W.Board |     |       | <a href="#">IC6401</a> | 51-12745Z01 | BH7073G-TR -CP       |
| I.MX-P.W.Board |     |       | <a href="#">IC6402</a> | 51T15192Y02 | TC74VHC14FT,K-EL-SE5 |
| I.MX-P.W.Board |     |       | <a href="#">IC6403</a> | 51T25183Y04 | TC7SET08FU,LJ -CP    |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

|                |  |  |                        |             |                      |
|----------------|--|--|------------------------|-------------|----------------------|
| I.MX-P.W.Board |  |  | <a href="#">IC6404</a> | 51T15185Y03 | TC7SH08FU,LJ -CP     |
| I.MX-P.W.Board |  |  | <a href="#">IC6405</a> | 51-31236Z01 | ML22331 -ST          |
| I.MX-P.W.Board |  |  | <a href="#">L5100</a>  | 24-22766Z02 | IND,LBC3225 10RM -CP |
| I.MX-P.W.Board |  |  | <a href="#">L5101</a>  | 24-22766Z02 | IND,LBC3225 10RM -CP |
| I.MX-P.W.Board |  |  | <a href="#">L5102</a>  | 24-22766Z02 | IND,LBC3225 10RM -CP |
| I.MX-P.W.Board |  |  | <a href="#">L5103</a>  | 24-22766Z02 | IND,LBC3225 10RM -CP |
| I.MX-P.W.Board |  |  | <a href="#">L5400</a>  | 24T95456W27 | FBI,BLM18PG181SH1-CP |
| I.MX-P.W.Board |  |  | <a href="#">L5502</a>  | 24-22766Z01 | IND,LBC3225 2R2M -CP |
| I.MX-P.W.Board |  |  | <a href="#">L5503</a>  | 24-22766Z03 | IND,LBC3225 1R0M -CP |
| I.MX-P.W.Board |  |  | <a href="#">L5504</a>  | 24T25164Y09 | IND,FSLM2520 R47J-CP |
| I.MX-P.W.Board |  |  | <a href="#">L5600</a>  | 24-22372Z05 | IND,NRS6045T 2R3N-E2 |
| I.MX-P.W.Board |  |  | <a href="#">L5601</a>  | 24-22372Z05 | IND,NRS6045T 2R3N-E2 |
| I.MX-P.W.Board |  |  | <a href="#">L5602</a>  | 24-22372Z05 | IND,NRS6045T 2R3N-E2 |
| I.MX-P.W.Board |  |  | <a href="#">L5603</a>  | 24-22372Z05 | IND,NRS6045T 2R3N-E2 |
| I.MX-P.W.Board |  |  | <a href="#">L5650</a>  | 24-22372Z05 | IND,NRS6045T 2R3N-E2 |
| I.MX-P.W.Board |  |  | <a href="#">L5651</a>  | 24-08610Z03 | IND,DS106C2 10RM -EA |
| I.MX-P.W.Board |  |  | <a href="#">L5700</a>  | 24-23871Z01 | IND,NRS8040T 10RM-E6 |
| I.MX-P.W.Board |  |  | <a href="#">L5701</a>  | 24T95458W06 | FBI,BLM31PG121SH1-CP |
| I.MX-P.W.Board |  |  | <a href="#">L5704</a>  | 24T75143Y17 | IND,HK1005 R022J -CP |
| I.MX-P.W.Board |  |  | <a href="#">L5705</a>  | 24T75143Y17 | IND,HK1005 R022J -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                   | Parts No.   | Parts Name           |
|----------------|-----|-------|------------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">L6000</a>  | 24-13301Z07 | IND,DS75LC 10RM -E6  |
| I.MX-P.W.Board |     |       | <a href="#">L6030</a>  | 24-22766Z03 | IND,LBC3225 1R0M -CP |
| I.MX-P.W.Board |     |       | <a href="#">L6400</a>  | 24T65067Y02 | FBI,MMZ1005S601AT-CP |
| I.MX-P.W.Board |     |       | <a href="#">L6401</a>  | 24T65067Y02 | FBI,MMZ1005S601AT-CP |
| I.MX-P.W.Board |     |       | <a href="#">PS6400</a> | 48-27319Z01 | POLY,SW1812L150/24E2 |
| I.MX-P.W.Board |     |       | <a href="#">Q4000</a>  | 48-17548Z01 | TR,DSA500100L -CP    |
| I.MX-P.W.Board |     |       | <a href="#">Q4001</a>  | 48-13000Z05 | TR,LTC124EUBFS8-TLCP |
| I.MX-P.W.Board |     |       | <a href="#">Q5200</a>  | 48T25737Y02 | TR,UMD3N-TR -CP      |
| I.MX-P.W.Board |     |       | <a href="#">Q5800</a>  | 48T25737Y02 | TR,UMD3N-TR -CP      |
| I.MX-P.W.Board |     |       | <a href="#">Q6400</a>  | 48T63417F03 | TR,C2412K-BR-96 -CP  |
| I.MX-P.W.Board |     |       | <a href="#">R4000</a>  | 06S15616Y36 | RES,RK 225J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4001</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4003</a>  | 06S15616Y22 | RES,RK 105J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4005</a>  | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4006</a>  | 06S15615Y49 | RES,RK 102J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4007</a>  | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4008</a>  | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4009</a>  | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4010</a>  | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4011</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R4012</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4013</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4014</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4015</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4016</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4017</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4018</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4020</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4021</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4022</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4023</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4024</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4025</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4026</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4027</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4028</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4029</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4030</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4031</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4033</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R4034</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4035</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4036</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4037</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4038</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4044</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4045</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4046</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4047</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4048</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4049</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4050</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4051</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4052</a> | 06S15615Y21 | RES,RK 68RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4053</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4054</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4055</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4056</a> | 06S65415Y85 | RES,RK 241F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4058</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4059</a> | 06-02713Z04 | RES,RK 102D 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R4060</a> | 06-02713Z04 | RES,RK 102D 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4061</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4062</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4064</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4068</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4069</a> | 06-25919Z07 | RES,RK 243F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4070</a> | 06S65415Y55 | RES,RK 334F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4071</a> | 06S65415Y34 | RES,RK 562F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4073</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4074</a> | 06S65415Y63 | RES,RK 6041F 1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4076</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4077</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4079</a> | 06S65415Y48 | RES,RK 823F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4080</a> | 06S65415Y99 | RES,RK 512F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4200</a> | 06S65415Y84 | RES,RK 201F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4201</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4202</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4203</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4204</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4205</a> | 06S65415Y85 | RES,RK 241F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

|                |  |  |                       |             |                      |
|----------------|--|--|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |  |  | <a href="#">R4206</a> | 06S65415Y84 | RES,RK 201F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4207</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4208</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4209</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4210</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4211</a> | 06S65415Y85 | RES,RK 241F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4212</a> | 06S65415Y84 | RES,RK 201F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4213</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4214</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4215</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4216</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4217</a> | 06S65415Y85 | RES,RK 241F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4218</a> | 06S65415Y84 | RES,RK 201F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4219</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4220</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4221</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4222</a> | 06S65415Y25 | RES,RK 102F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4223</a> | 06S65415Y85 | RES,RK 241F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4300</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R4303</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R4304</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4305</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4306</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4307</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4308</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4309</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4310</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4311</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4312</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4314</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4315</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4316</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4317</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4318</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4319</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4320</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4321</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4322</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4323</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4324</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R4325</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4326</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4327</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4328</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4332</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4333</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4334</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4336</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4337</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4338</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4339</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4400</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4401</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4402</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4403</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4404</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4405</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4406</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4407</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4408</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R4409</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4410</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4411</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4500</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4501</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4601</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R4602</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4603</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4604</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4700</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R4701</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5000</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5001</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5002</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5003</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5004</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5005</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5006</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5007</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5008</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5009</a> | 06S15615Y21 | RES,RK 68RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5100</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5101</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5102</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5103</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5104</a> | 06S65415Y87 | RES,RK 431F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5105</a> | 06S65415Y87 | RES,RK 431F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5106</a> | 06S65415Y06 | RES,RK 27RF 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5107</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5108</a> | 06S70072F59 | RES,CP .182-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5109</a> | 06S70072F59 | RES,CP .182-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5110</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5111</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5112</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5115</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5116</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5117</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5119</a> | 06S70072F77 | RES,CP .103-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5120</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5122</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5200</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5201</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5202</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5203</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5204</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5205</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5206</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5207</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5208</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5209</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5210</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5212</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5213</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5214</a> | 06S15615Y83 | RES,RK 273J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5216</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5217</a> | 06S15615Y97 | RES,RK 104J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5218</a> | 06S15615Y89 | RES,RK 473J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5219</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5220</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5221</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5222</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5223</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5224</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5225</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5226</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5227</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5228</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5230</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5232</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5233</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5234</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5235</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5236</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5300</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5301</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5302</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5303</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5304</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5305</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5306</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5308</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5309</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5312</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5313</a> | 06S15616Y22 | RES,RK 105J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5314</a> | 06S15615Y53 | RES,RK 152J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5315</a> | 06S15615Y13 | RES,RK 33RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5401</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5402</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5403</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5404</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5405</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5406</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5407</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5408</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5411</a> | 06S15615Y65 | RES,RK 472J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5413</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5416</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5418</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5500</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5501</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5502</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5503</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5504</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5505</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5506</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5507</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5508</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5509</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5510</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5511</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5512</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5513</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5514</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5520</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5521</a> | 06S45675W43 | RES,RK JUMPER1/10-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5522</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5523</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5524</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5525</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5526</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

|                |  |  |                       |             |                      |
|----------------|--|--|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |  |  | <a href="#">R5527</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |  |  | <a href="#">R5528</a> | 06S15615Y65 | RES,RK 472J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5600</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5601</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5602</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5603</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5604</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5605</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5606</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5607</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5608</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5609</a> | 06S65415Y99 | RES,RK 512F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5610</a> | 06-25919Z17 | RES,RK 164F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5611</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5612</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5613</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5614</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5615</a> | 06S65415Y52 | RES,RK 184F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5616</a> | 06S65415Y34 | RES,RK 562F 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R5617</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5618</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5619</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5620</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5621</a> | 06-25919Z22 | RES,RK 434F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5622</a> | 06-25919Z13 | RES,RK 753F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5623</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5624</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5625</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5627</a> | 06-25919Z17 | RES,RK 164F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5628</a> | 06S65415Y99 | RES,RK 512F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5629</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5630</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5631</a> | 06S65415Y37 | RES,RK 103F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5632</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5633</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5634</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5635</a> | 06S65415Y41 | RES,RK 223F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5636</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5637</a> | 06-25919Z12 | RES,RK 623F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5638</a> | 06S65415Y66 | RES,RK 622F 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5639</a> | 06S65415Y47 | RES,RK 683F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5640</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5641</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5642</a> | 06S65415Y44 | RES,RK 393F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5643</a> | 06-25919Z18 | RES,RK 204F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5644</a> | 06-25919Z13 | RES,RK 753F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5645</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5646</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5647</a> | 06S15615Y41 | RES,RK 471J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5648</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5650</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5651</a> | 06S15615Y67 | RES,RK 562J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5652</a> | 06S65415Y31 | RES,RK 332F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5653</a> | 06S65415Y26 | RES,RK 122F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5654</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5655</a> | 06S65415Y42 | RES,RK 273F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5657</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5658</a> | 06S65415Y59 | RES,RK 684F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5659</a> | 06S65415Y34 | RES,RK 562F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5700</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5704</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5706</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5707</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5708</a> | 06S65415Y46 | RES,RK 563F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5710</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R5713</a> | 06-12176Z01 | RES,RK R10F 1/5 -CP  |
| I.MX-P.W.Board |     |       | <a href="#">R5714</a> | 06-12176Z01 | RES,RK R10F 1/5 -CP  |
| I.MX-P.W.Board |     |       | <a href="#">R5715</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5716</a> | 06S65415Y17 | RES,RK 221F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5717</a> | 06S65415Y32 | RES,RK 392F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5718</a> | 06S65415Y17 | RES,RK 221F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5724</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5800</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5801</a> | 06S65415Y43 | RES,RK 333F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5802</a> | 06S65415Y39 | RES,RK 153F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5803</a> | 06S65415Y35 | RES,RK 682F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5804</a> | 06S15594Y12 | RES,RK 394F 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5805</a> | 06S15593Y92 | RES,RK 623F 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5807</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5808</a> | 06S70072F77 | RES,CP .103-J-1/4-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R5810</a> | 06S15593Y67 | RES,RK 562F 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R5811</a> | 06S15593Y94 | RES,RK 753F 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6001</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6002</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6003</a> | 06S65415Y32 | RES,RK 392F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6004</a> | 06S65415Y20 | RES,RK 391F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6005</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6006</a> | 06S65415Y42 | RES,RK 273F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6009</a> | 06-25919Z13 | RES,RK 753F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6010</a> | 06S65415Y58 | RES,RK 564F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6012</a> | 06S65415Y38 | RES,RK 123F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6013</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6014</a> | 06S65415Y33 | RES,RK 472F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6015</a> | 06S15593Y93 | RES,RK 683F 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6016</a> | 06S15594Y07 | RES,RK 244F 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6019</a> | 06S65415Y30 | RES,RK 272F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6020</a> | 06S65415Y29 | RES,RK 222F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6021</a> | 06S65415Y32 | RES,RK 392F 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6022</a> | 06S15593Y92 | RES,RK 623F 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6023</a> | 06S15593Y67 | RES,RK 562F 1/10 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R6030</a> | 06S45674W45 | RES,RK 331J 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6102</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6103</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6104</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6106</a> | 06S15615Y13 | RES,RK 33RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6107</a> | 06S15615Y13 | RES,RK 33RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6108</a> | 06S15615Y13 | RES,RK 33RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6109</a> | 06S15615Y13 | RES,RK 33RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6110</a> | 06S15615Y13 | RES,RK 33RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6113</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6114</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6115</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6119</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6120</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6121</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6122</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6123</a> | 06S15615Y57 | RES,RK 222J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6210</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6211</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6212</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                  | Parts No.   | Parts Name           |
|----------------|-----|-------|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R6213</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6214</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6215</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6216</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6217</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6218</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6219</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6220</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6221</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6222</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6303</a> | 06S15615Y65 | RES,RK 472J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6304</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6305</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6307</a> | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6309</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6401</a> | 06S70072F41 | RES,CP .331-J-1/4-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6402</a> | 06S35083Y86 | RES,RK 75RF 1/4 -CP  |
| I.MX-P.W.Board |     |       | <a href="#">R6403</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6404</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6406</a> | 06S70072F41 | RES,CP .331-J-1/4-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

|                |  |  |                       |             |                      |
|----------------|--|--|-----------------------|-------------|----------------------|
| I.MX-P.W.Board |  |  | <a href="#">R6407</a> | 06S35083Y86 | RES,RK 75RF 1/4 -CP  |
| I.MX-P.W.Board |  |  | <a href="#">R6408</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6409</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6410</a> | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6411</a> | 06S45674W81 | RES,RK 103J 1/10 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6412</a> | 06S45674W73 | RES,RK 472J 1/10 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6413</a> | 06S45674W93 | RES,RK 333J 1/10 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6414</a> | 06S15615Y09 | RES,RK 22RJ 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6415</a> | 06S15615Y81 | RES,RK 223J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6416</a> | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6418</a> | 06S45674W33 | RES,RK 101J 1/10 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6419</a> | 06S70072F69 | RES,CP .472-J-1/4-CP |
| I.MX-P.W.Board |  |  | <a href="#">R6420</a> | 06S45674W57 | RES,RK 102J 1/10 -CP |
| I.MX-P.W.Board |  |  | <a href="#">R6421</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| I.MX-P.W.Board |  |  | <a href="#">R6422</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| I.MX-P.W.Board |  |  | <a href="#">R6423</a> | 06S70072F29 | RES,CP .101-J-1/4-CP |
| I.MX-P.W.Board |  |  | <a href="#">R6424</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| I.MX-P.W.Board |  |  | <a href="#">R6425</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| I.MX-P.W.Board |  |  | <a href="#">R6426</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |
| I.MX-P.W.Board |  |  | <a href="#">R6427</a> | 06S70072F53 | RES,CP .102-J-1/4-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS | MODEL | Ref.                   | Parts No.   | Parts Name           |
|----------------|-----|-------|------------------------|-------------|----------------------|
| I.MX-P.W.Board |     |       | <a href="#">R6428</a>  | 06S15615Y73 | RES,RK 103J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6431</a>  | 06S15616Y23 | RES,RK JUMPER1/16-CP |
| I.MX-P.W.Board |     |       | <a href="#">R6432</a>  | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6433</a>  | 06S15615Y25 | RES,RK 101J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6434</a>  | 06S15615Y77 | RES,RK 153J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">R6439</a>  | 06S15615Y61 | RES,RK 332J 1/16 -CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4000</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4001</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4002</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4003</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4004</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4005</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4006</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4007</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4008</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA4009</a> | 06S15771Y13 | RES,ARYEXB28V101J-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA5300</a> | 06S15771Y07 | RES,ARYEXB28V33RJ-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA5301</a> | 06S15771Y07 | RES,ARYEXB28V33RJ-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA6100</a> | 06S15771Y07 | RES,ARYEXB28V33RJ-CP |
| I.MX-P.W.Board |     |       | <a href="#">RA6101</a> | 06S15771Y07 | RES,ARYEXB28V33RJ-CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board      | MIS                                                                               | MODEL | Ref.                    | Parts No.   | Parts Name           |
|----------------|-----------------------------------------------------------------------------------|-------|-------------------------|-------------|----------------------|
| I.MX-P.W.Board |                                                                                   |       | <a href="#">RA6102</a>  | 06S15771Y07 | RES,ARYEXB28V33RJ-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">RA6103</a>  | 06S15771Y07 | RES,ARYEXB28V33RJ-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">SD5650</a>  | 48-19296Z01 | DIO,SHT RB056L-40-E1 |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">SD5700</a>  | 48-19296Z01 | DIO,SHT RB056L-40-E1 |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">SD5801</a>  | 48-06526Z01 | DIO,SHT RSX051VA30CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">SD6000</a>  | 48-19296Z01 | DIO,SHT RB056L-40-E1 |
| I.MX-P.W.Board |  |       | <a href="#">SK5400</a>  | 09-30387Z01 | SKT,GT17HNF-4DP-2-DB |
| I.MX-P.W.Board |  |       | <a href="#">SK5700</a>  | 09-31283Z01 | SKT,UBAL-4R-D14-4SDB |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">TML5400</a> | 29-22483Z02 | OG-453065 -E5        |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">TML6300</a> | 29-22483Z02 | OG-453065 -E5        |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">XL4000</a>  | 91-26661Z36 | XTL,NX3225SAAG24.0CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">XL4001</a>  | 91-26198Z03 | XTL,NX3215 32.7NS-E1 |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">XL5200</a>  | 91-26661Z32 | XTL,NX3225SAAG28.6CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">XL5300</a>  | 91-26661Z24 | XTL,NX3225SAAG25.0CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">XL6401</a>  | 91-16024Z01 | XTL,AT-41CD2 3.98-E9 |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">ZD5100</a>  | 48-28494Z01 | DIO,ZEN ECMF04-4H-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">ZD5101</a>  | 48-28494Z01 | DIO,ZEN ECMF04-4H-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">ZD5200</a>  | 48-28494Z01 | DIO,ZEN ECMF04-4H-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">ZD5201</a>  | 48-28494Z01 | DIO,ZEN ECMF04-4H-CP |
| I.MX-P.W.Board |                                                                                   |       | <a href="#">ZD5202</a>  | 48-16145Z20 | DIO,ZEN PZU5.1B3 -CP |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board          | MIS                                                                               | MODEL | Ref.                    | Parts No.   | Parts Name           |
|--------------------|-----------------------------------------------------------------------------------|-------|-------------------------|-------------|----------------------|
| I.MX-P.W.Board     |                                                                                   |       | <a href="#">ZD5203</a>  | 48-25907Z01 | DIO,ZEN PESD5V0F1-CP |
| I.MX-P.W.Board     |                                                                                   |       | <a href="#">ZD5204</a>  | 48-25907Z01 | DIO,ZEN PESD5V0F1-CP |
| I.MX-P.W.Board     |                                                                                   |       | <a href="#">ZD5205</a>  | 48-25907Z01 | DIO,ZEN PESD5V0F1-CP |
| I.MX-P.W.Board     |                                                                                   |       | <a href="#">ZD5206</a>  | 48-25907Z01 | DIO,ZEN PESD5V0F1-CP |
| I.MX-P.W.Board     |                                                                                   |       | <a href="#">ZD6402</a>  | 48-16145Z22 | DIO,ZEN PZU5.6B2 -CP |
| I.MX-P.W.Board     |                                                                                   |       | <a href="#">ZD6403</a>  | 48-16145Z22 | DIO,ZEN PZU5.6B2 -CP |
| WIFI.ANT-P.W.Board |  |       | <a href="#">ANT9001</a> | 09-07494Z01 | U.FL-R-SMT-1(80)-E2  |
| WIFI.ANT-P.W.Board |                                                                                   |       | <a href="#">C9003</a>   | 08S45231Y40 | CAP,CER 3R9C-CH1H-CP |
| Miscellaneous      |  |       | <a href="#">ANT5502</a> | 09-24492Z04 | ASSY,U.FL-2LP-066N1  |
| Miscellaneous      |  |       | <a href="#">ET3150</a>  | 09-19615Z02 | ASSY,ANID-0139-02A   |
| Miscellaneous      |  |       | <a href="#">M3490</a>   | 59-14185Z03 | MOTOR,ASB0412MA-9D11 |

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).

| P.W.Board | MIS | MODEL | Ref. | Parts No. | Parts Name |
|-----------|-----|-------|------|-----------|------------|
|-----------|-----|-------|------|-----------|------------|

Model Code  
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(\*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(\*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(\*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(\*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(\*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (\*).