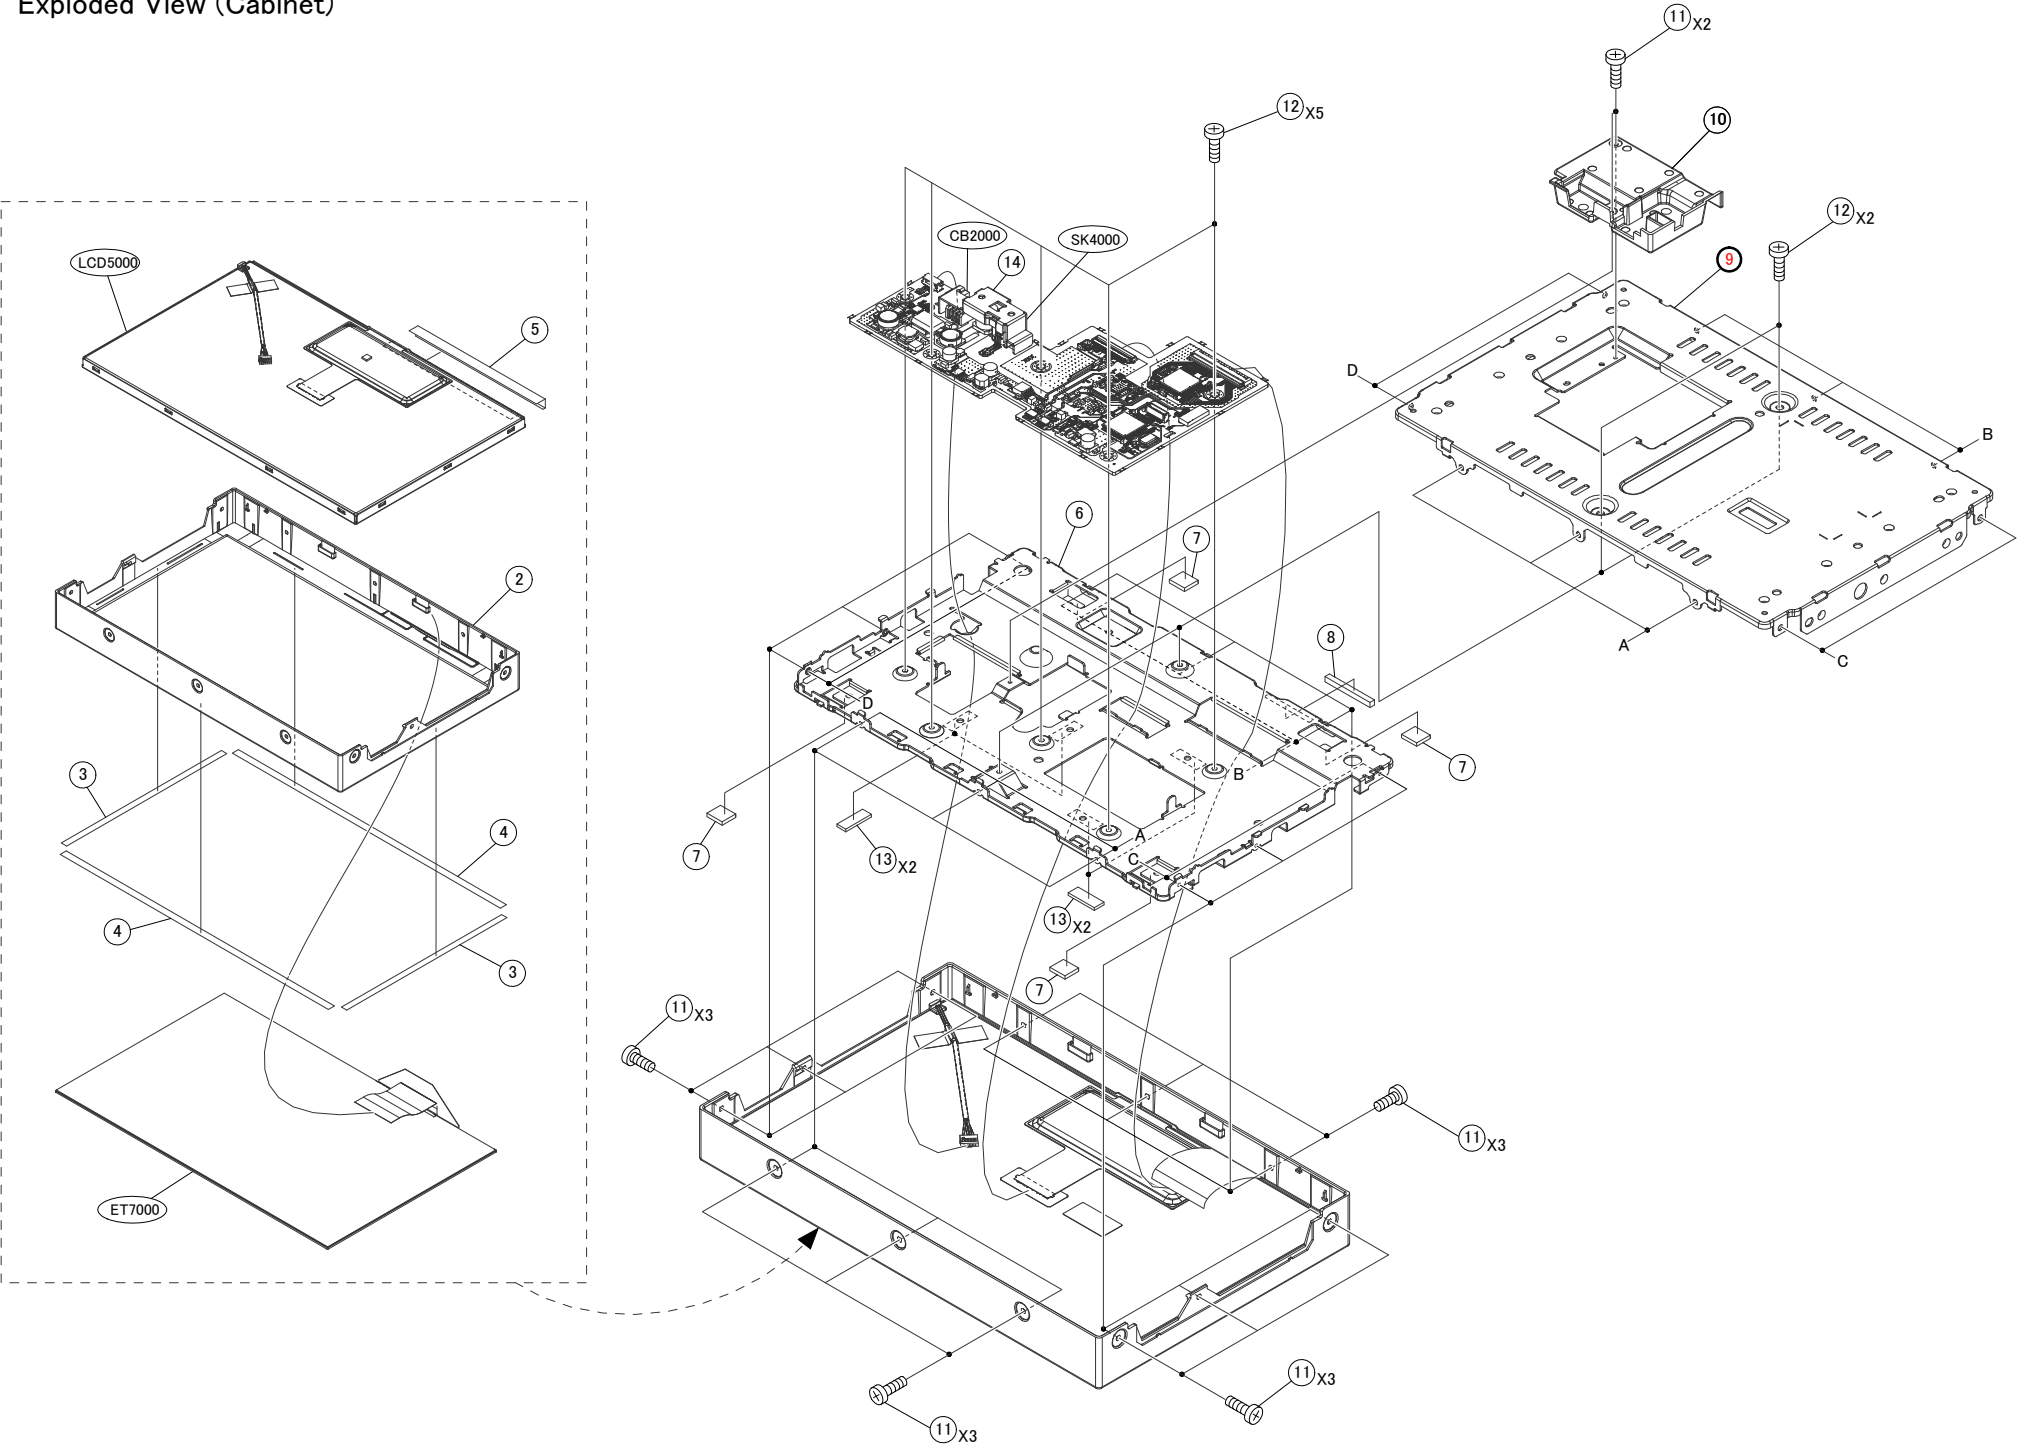


Exploded View (Cabinet)




MODEL	Symbol No.	Parts No.	Description
2	13-30237Z01	NOSE,MONITOR	
3	14-28478Z04		INS,CVR 135X2XT0.4
4	14-28478Z05		INS,CVR 225X2.5XT0.4
5	14-28478Z06		INS,CVR 100X22XT0.05
6	07-30238Z01		BKT,LCD
7	14-28478Z68		INS,CVR 10X10XT2
8	14-28478Z84		INS,CVR 30X6XT10
9	- - - - -		BKT,REAR
10	15-30169Z01		COVER,BASE
11	03-00712Z74		SCR,MCH 2X5 ZBEA
12	03S60822Y13		SCR,S-T 2.6X6 ZN A
13	75-20737Z01		65TSV 7-7(KD3)H L=20
14	07-30168Z01		BKT,CONN FPD
CB2000	09-25106Z09		WTB,S08B-PUDSS-1 -DB
ET7000	40-30438Z02		ASSY,HCDSP0B014B
LCD5000	65-30481Z01		ASSY,C101EAN01.0
SK4000	09-29404Z02		SKT,GT17HN2-4DP -EE

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

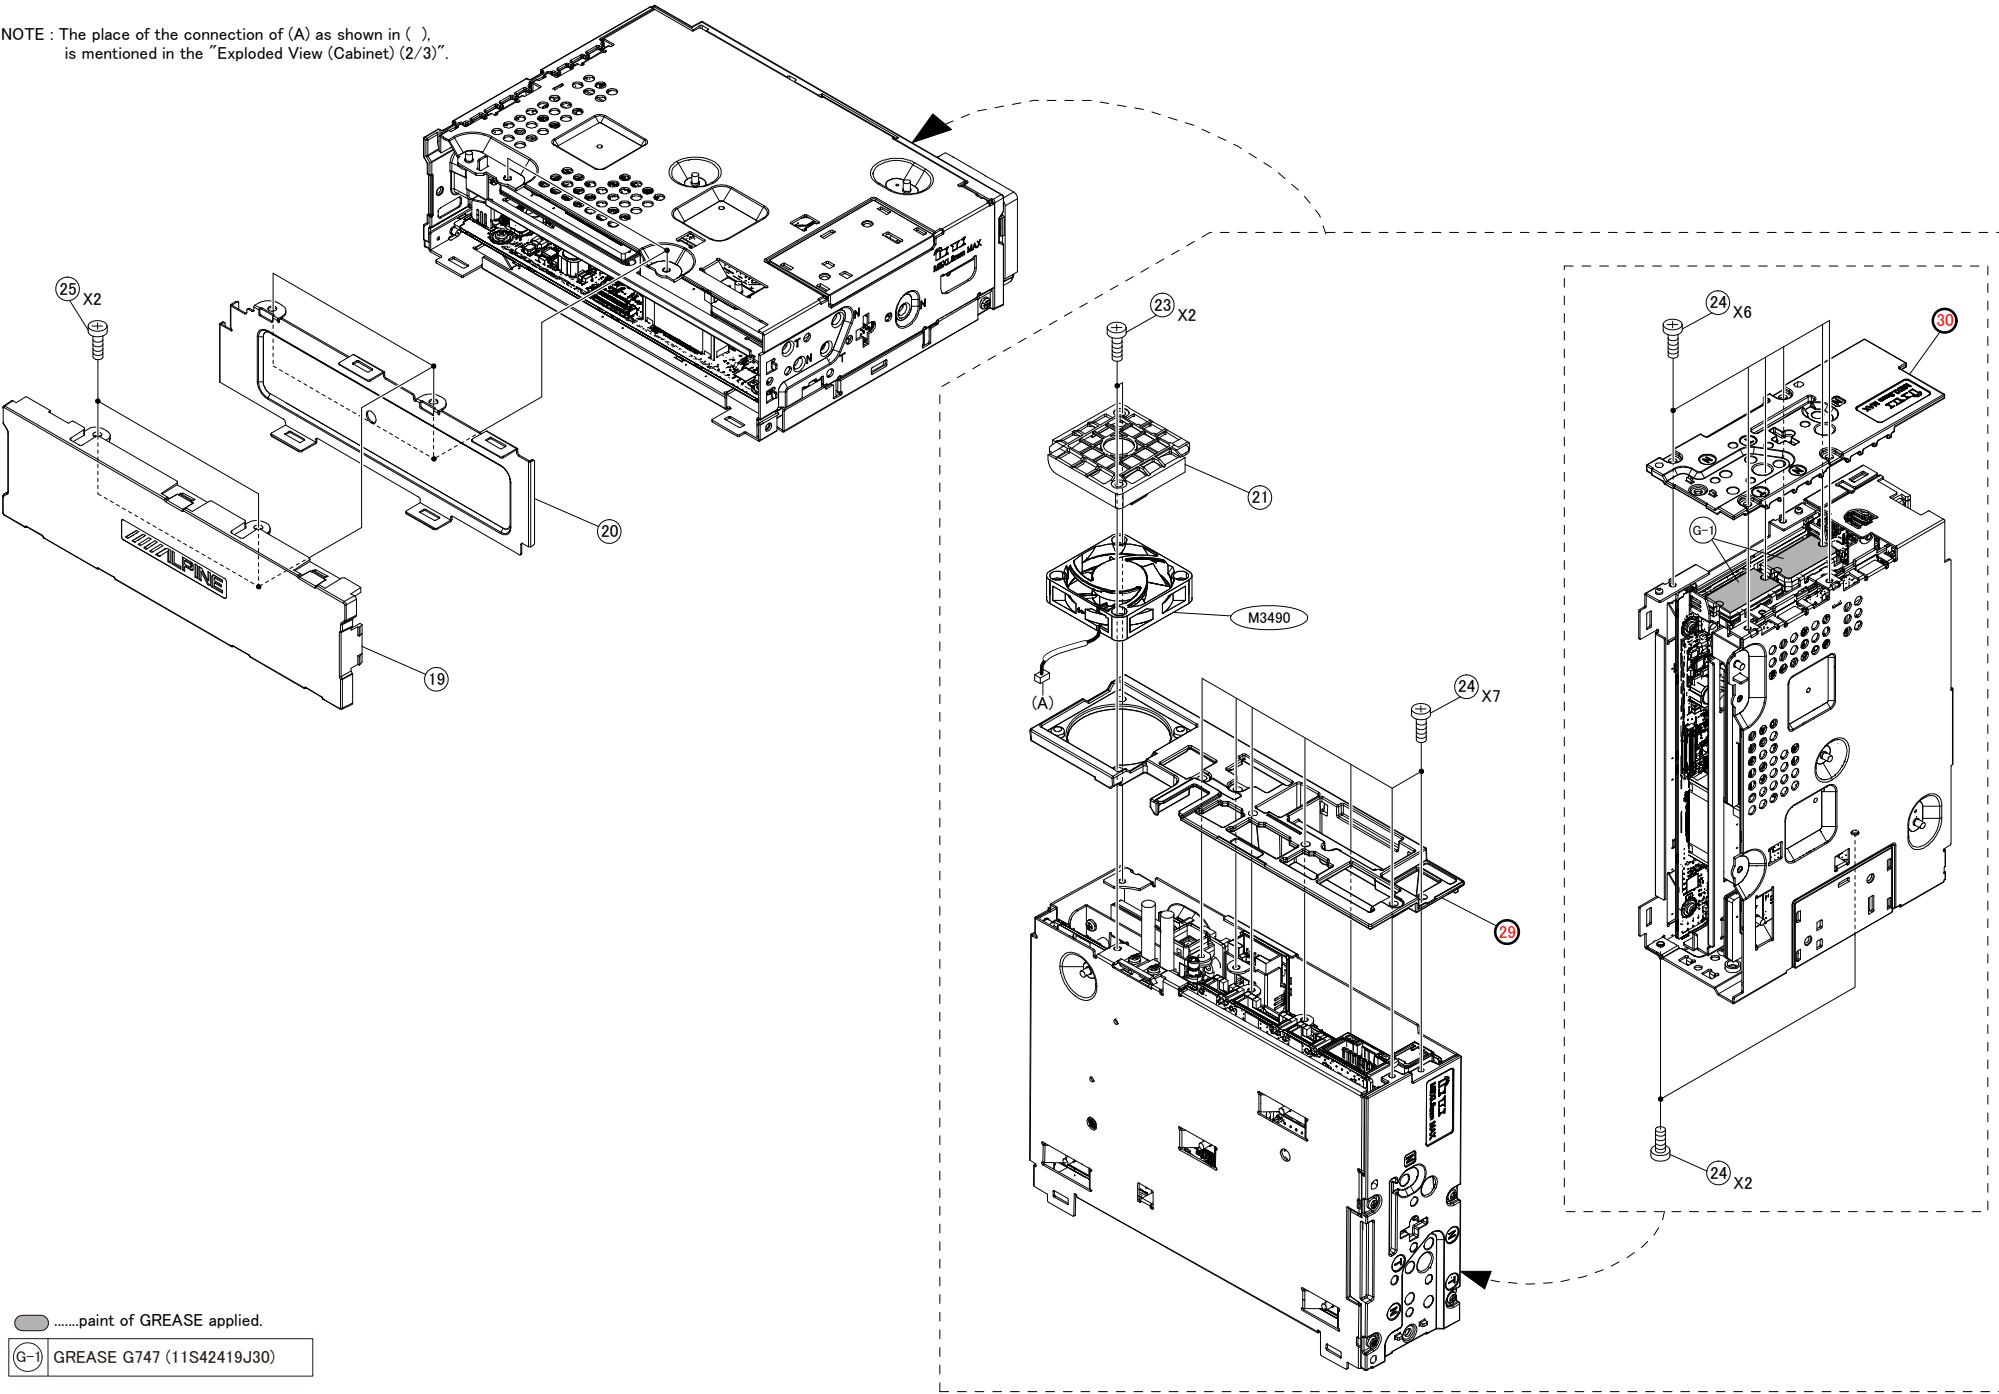NOTE:The part that has not PART NUMBER will not be supplied



Exploded View (Cabinet) (1/3)

NOTE : The place of the connection of (A) as shown in (), is mentioned in the "Exploded View (Cabinet) (2/3)".




Exploded View (Cabinet) (2/3)

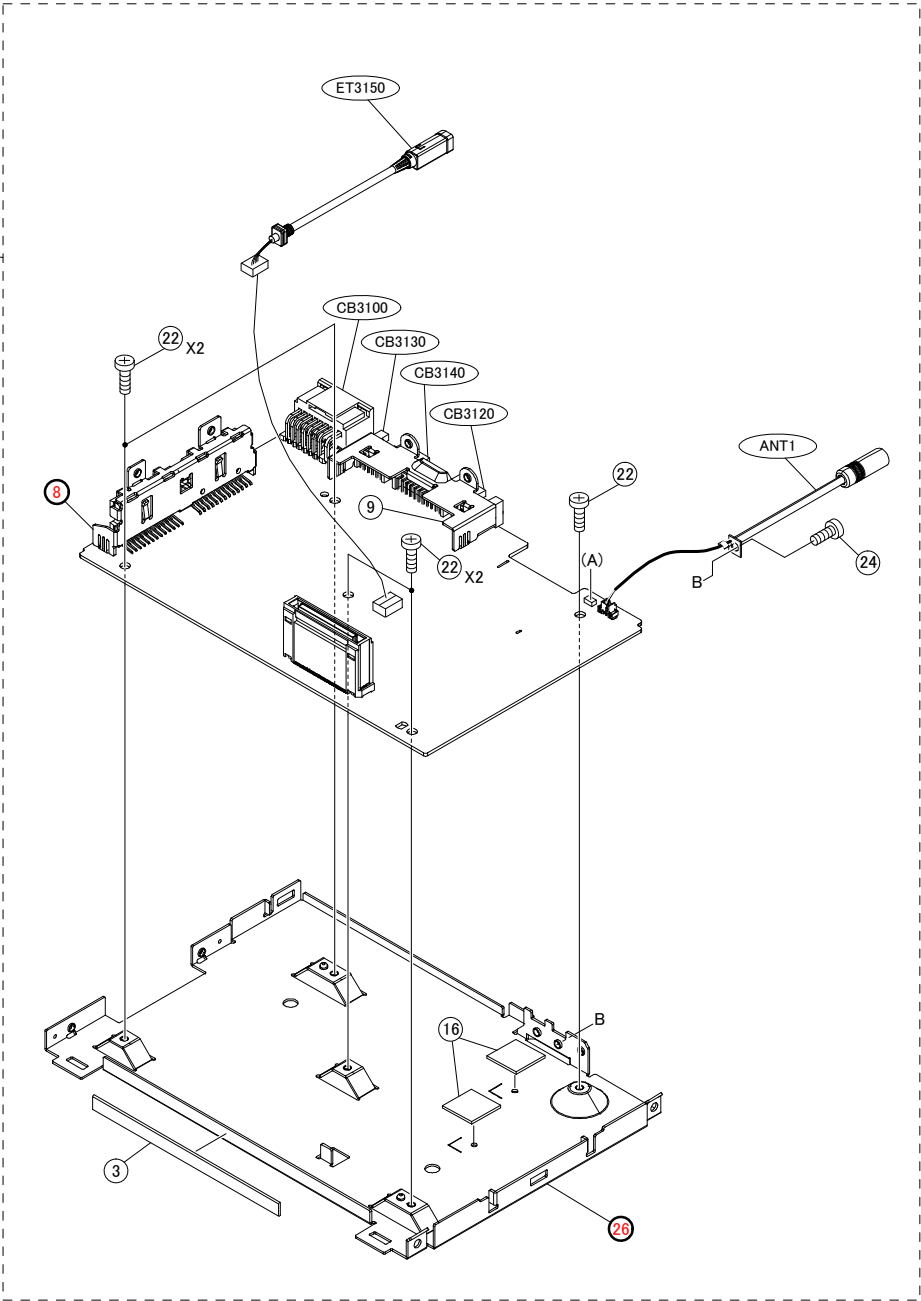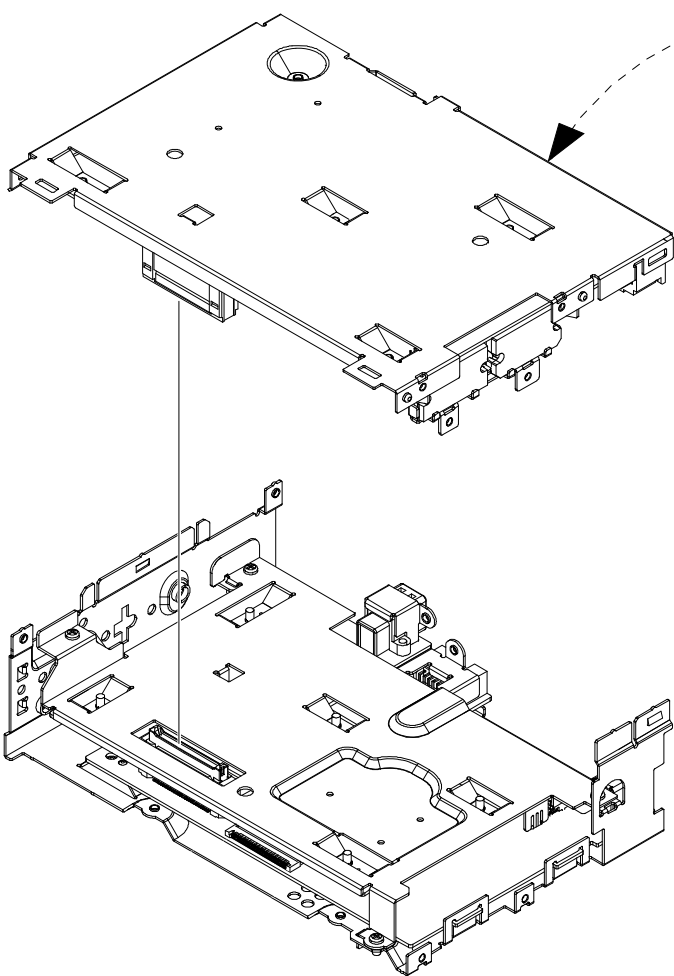NOTE : The place of the connection of (A) as shown in (),
is mentioned in the "Exploded View (Cabinet) (1/3)".



Exploded View (Cabinet) (3/3)

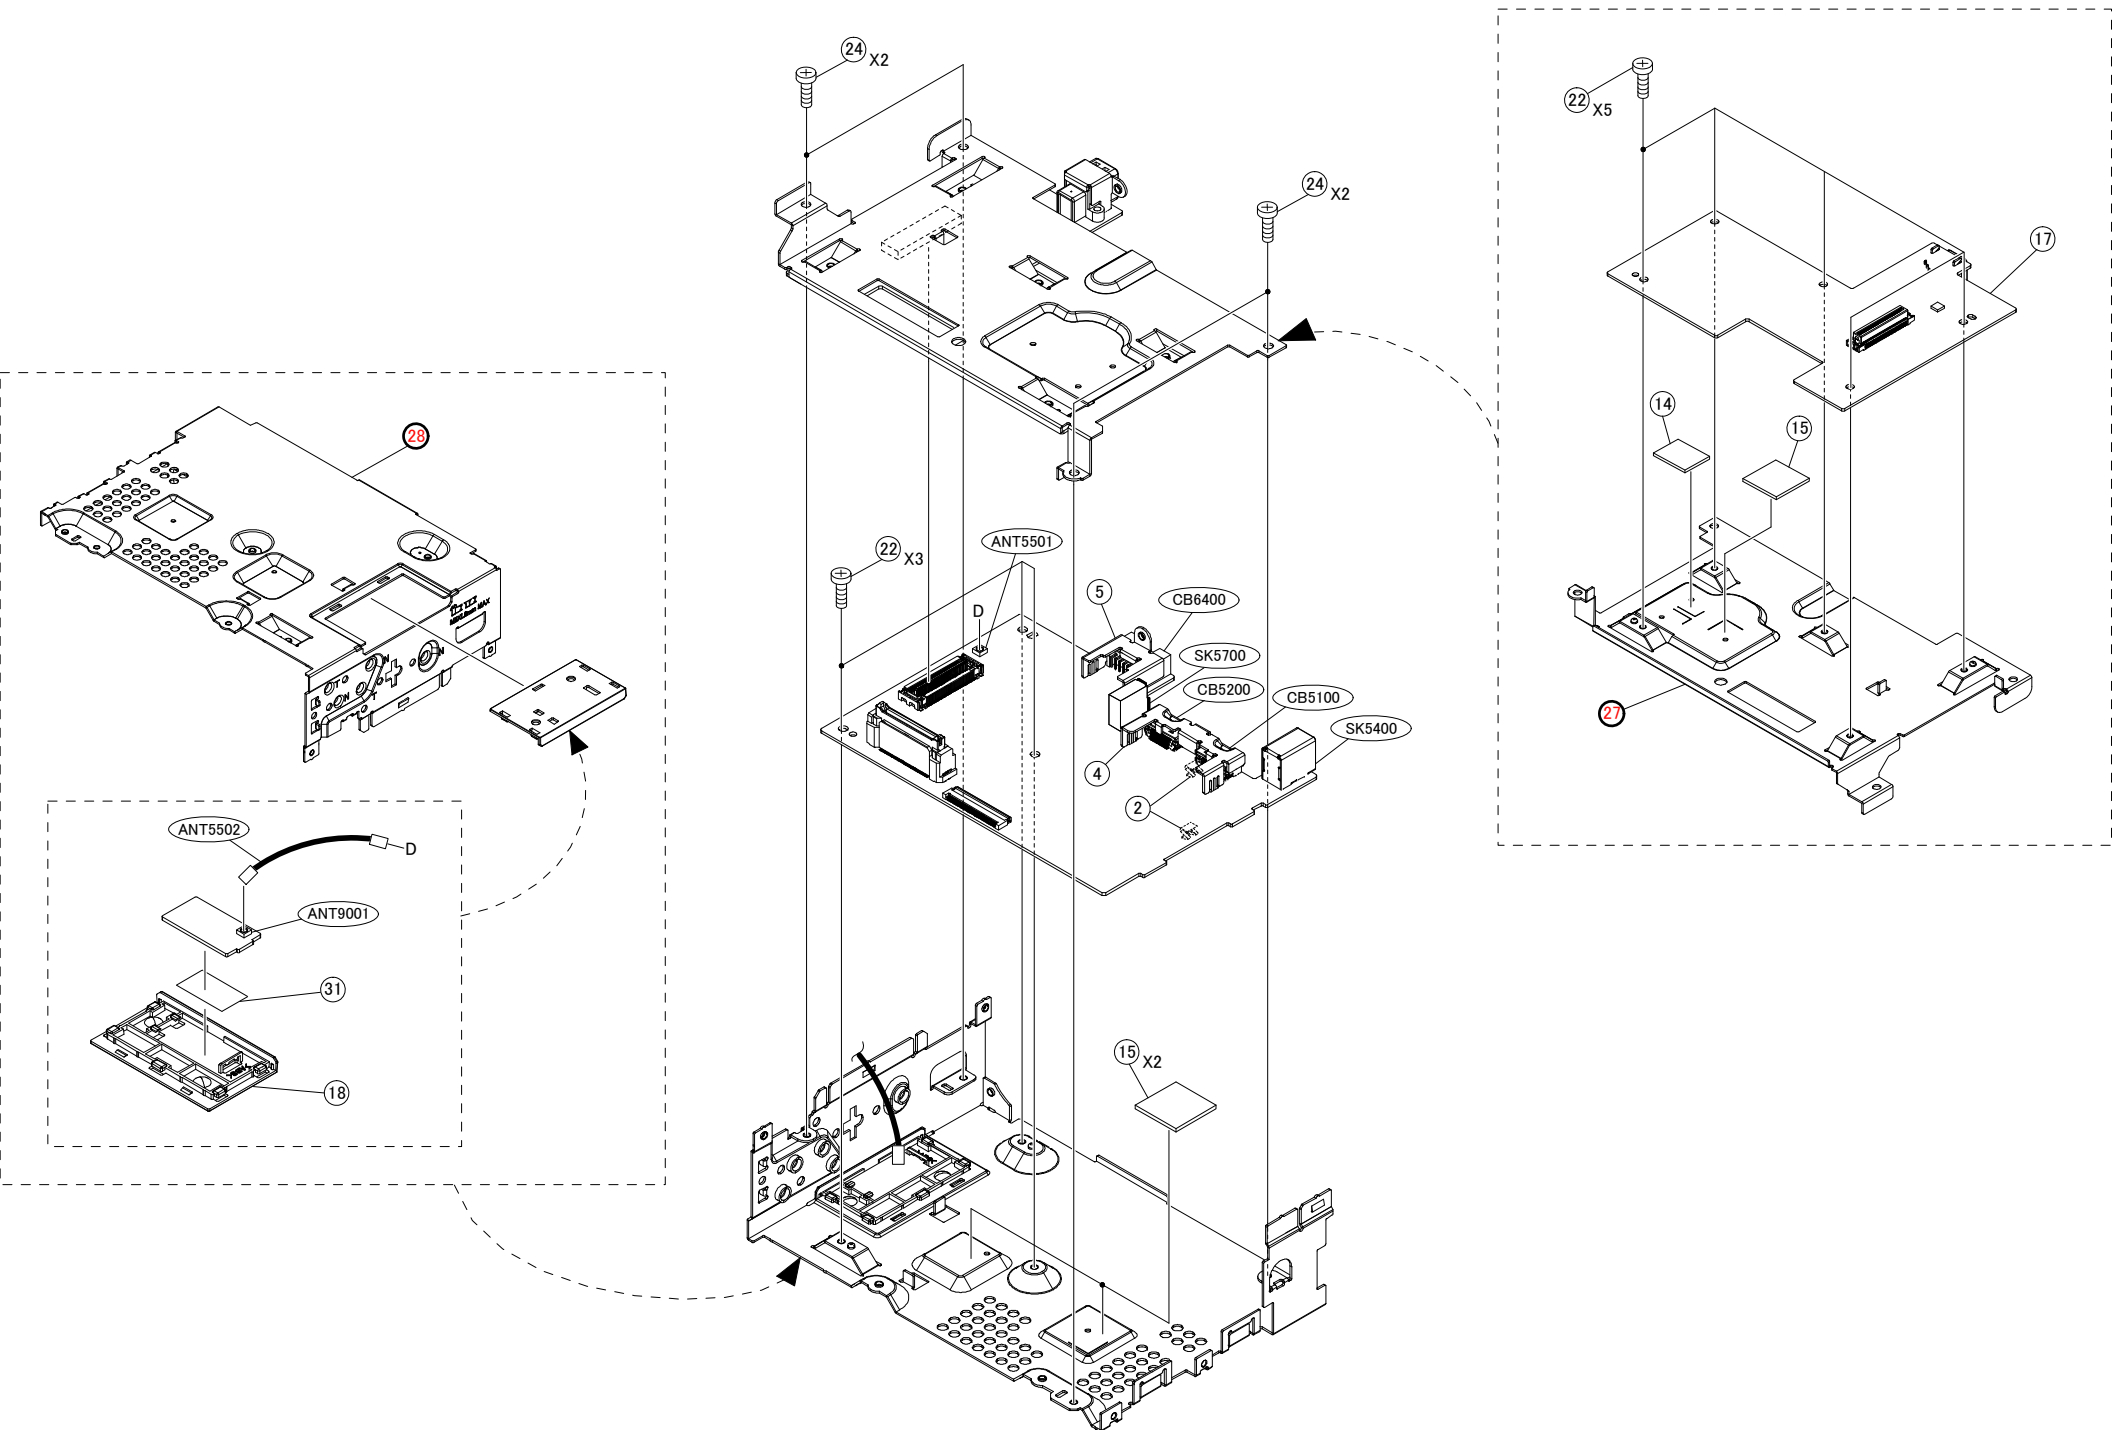

MODEL	Symbol No.	Parts No.	Description
-------	------------	-----------	-------------









2	29-22483Z02	OG-453065 -E5	
3		14-19217Z19	INS,CVR 104X4XT0.15
4		07-30182Z01	BKT,CONN HDMI
5		07-30183Z01	BKT,CONN CAN
8		-----	BKT,IC
9		07-30184Z01	BKT,CONN PREOUT
14		75-31381Z01	5580H-1.5-19-15
15		75-31381Z02	5580H-1.5-20-20
16		75-31381Z03	5580H-5.5-12-12
17		84-30004Z01	ASSY,NAVI,LIMO_US
18		15-29982Z01	COVER,PLATE TOP
19		15-30180Z01	COVER,FRONT
20		26-30398Z01	SHIELD,FRONT
21		15-12877Z01	COVER,FAN
22		03-12686Z01	SCR,S-T 2.6X6 ZN ATP
23		03S60822Y31	SCR,S-T 2.6X18 ZN A
24		03S60822Y10	SCR,S-T 2.6X5 ZN A
25		03-00340Z01	SCR,S-T 2.6X6 ZB A
26		-----	CHAS,BASE
27		-----	SHIELD,MIDDLE
28		-----	COVER,TOP
29		-----	BKT,REAR
30		-----	HEAT,SINK
31		14-28478Z77	INS,CVR 24X14XT0.15
ANT1		09-17241Z06	ASSY,ANID-0116-06A
ANT5501		09-07494Z01	U.FL-R-SMT-1(80)-E2

NOTE:The part that has not PART NUMBER will not be supplied.






MODEL	Symbol No.	Parts No.	Description
	ANT5502	09-24492Z04	ASSY,U.FL-2LP-066N1
	ANT9001	09-07494Z01	U.FL-R-SMT-1(80)-E2
	CB3100	09T35473Y16	WTB,F169B001-16 -DB
	CB3120	09-25106Z01	WTB,S10B-PUDSS-1 -DB
	CB3130	09-25106Z02	WTB,S12B-PUDSS-1 -DB
	CB3140	09-25106Z07	WTB,S22B-PUDSS-1 -DB
	CB5100	09-25213Z01	WTB,TCX3400-011187-T
	CB5200	09-25213Z01	WTB,TCX3400-011187-T
	CB6400	09-25106Z05	WTB,S18B-PUDSS-1 -DB
	ET3150	09-19615Z02	ASSY,ANID-0139-02A
	M3490	59-14185Z03	MOTOR,ASB0412MA-9D11
	SK5400	09-30387Z01	SKT,GT17HNF-4DP-2-DB
	SK5700	09-31283Z01	SKT,UBAL-4R-D14-4SDB

NOTE:The part that has not PART NUMBER will not be supplied.

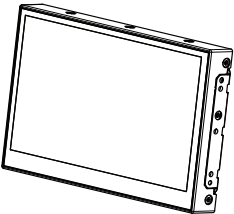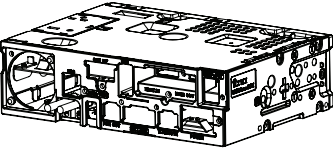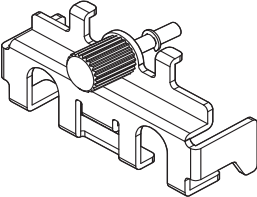
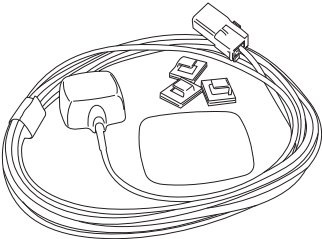
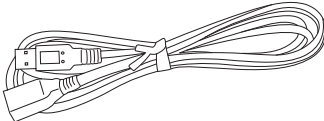


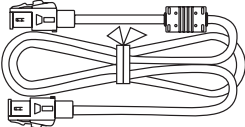
Accessory List**Source Unit Box Parts (X110-G)**

Display Monitor	X110-G Source Unit	HDMI Cable Bracket
		
8mm x 8 Screws	GPS Antenna	USB Extension Cable
		
Pre Out Harness	Direct Camera Adapter	Display Cable
		

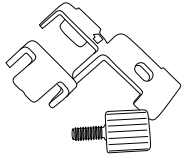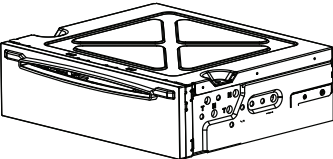

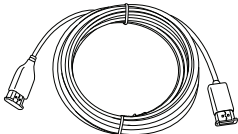
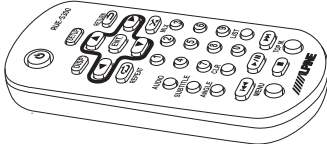
DVD Player Box Parts (DVE-5300X)


HDMI Cable Bracket	DVE-5300X DVD Player Unit	8mm x 4 Screws
		
HDMI Cable	Remote Control	
		

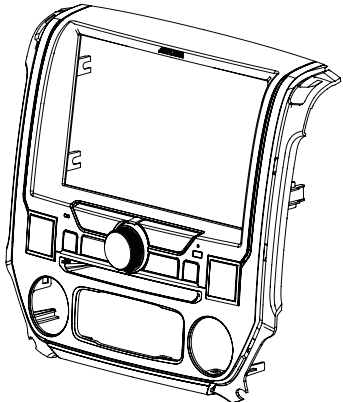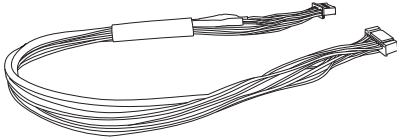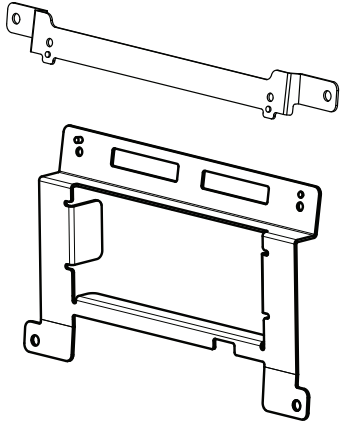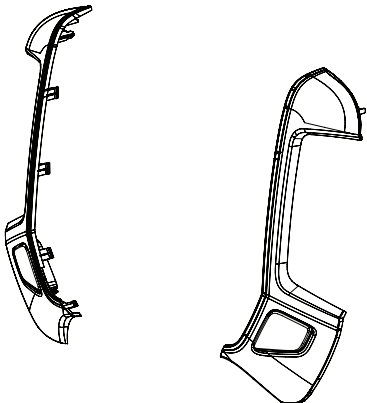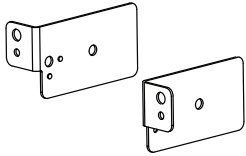
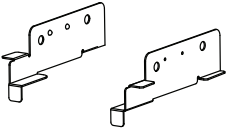
Installation Kit Parts (G-KTX110-GM1/GM2)

Radio Dash Bezel	Key Harness	Display Mounting Brackets
		
Vent Covers	DVD Player Mounting Brackets	Source Unit Mounting Brackets
		

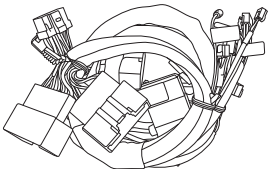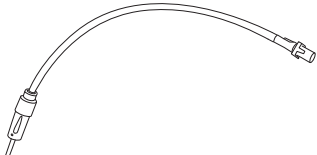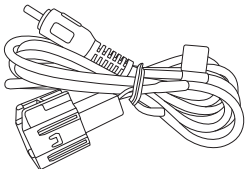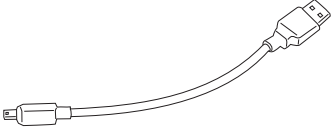
iDatalink Maestro Box Parts (ALP-MRR V2.0/ALP-HRN-GM3)

Main Harness	Antenna Adapter	Factory Camera Harness
		
SAT Radio Antenna Adapter	Maestro USB Update Cable	iDatalink Maestro Module
		

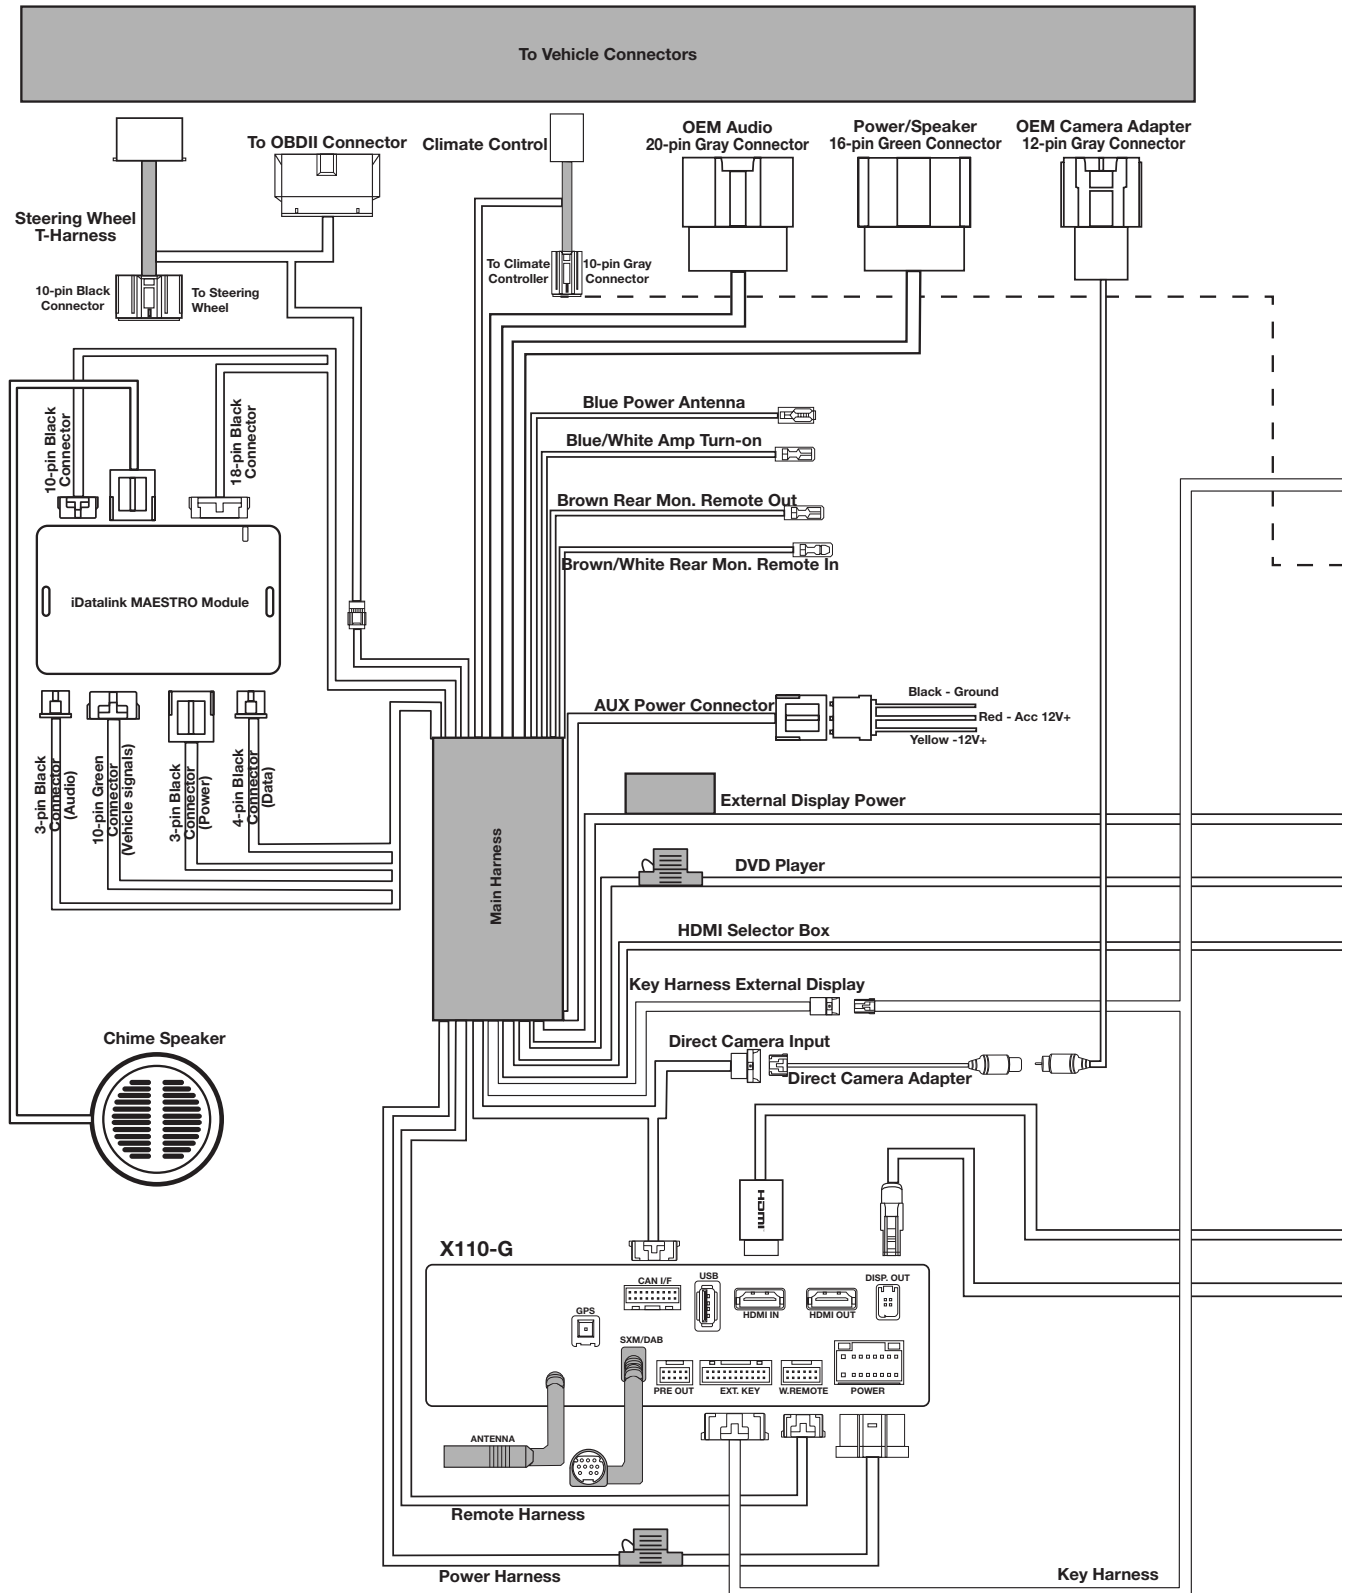
X110-G Wiring Diagram

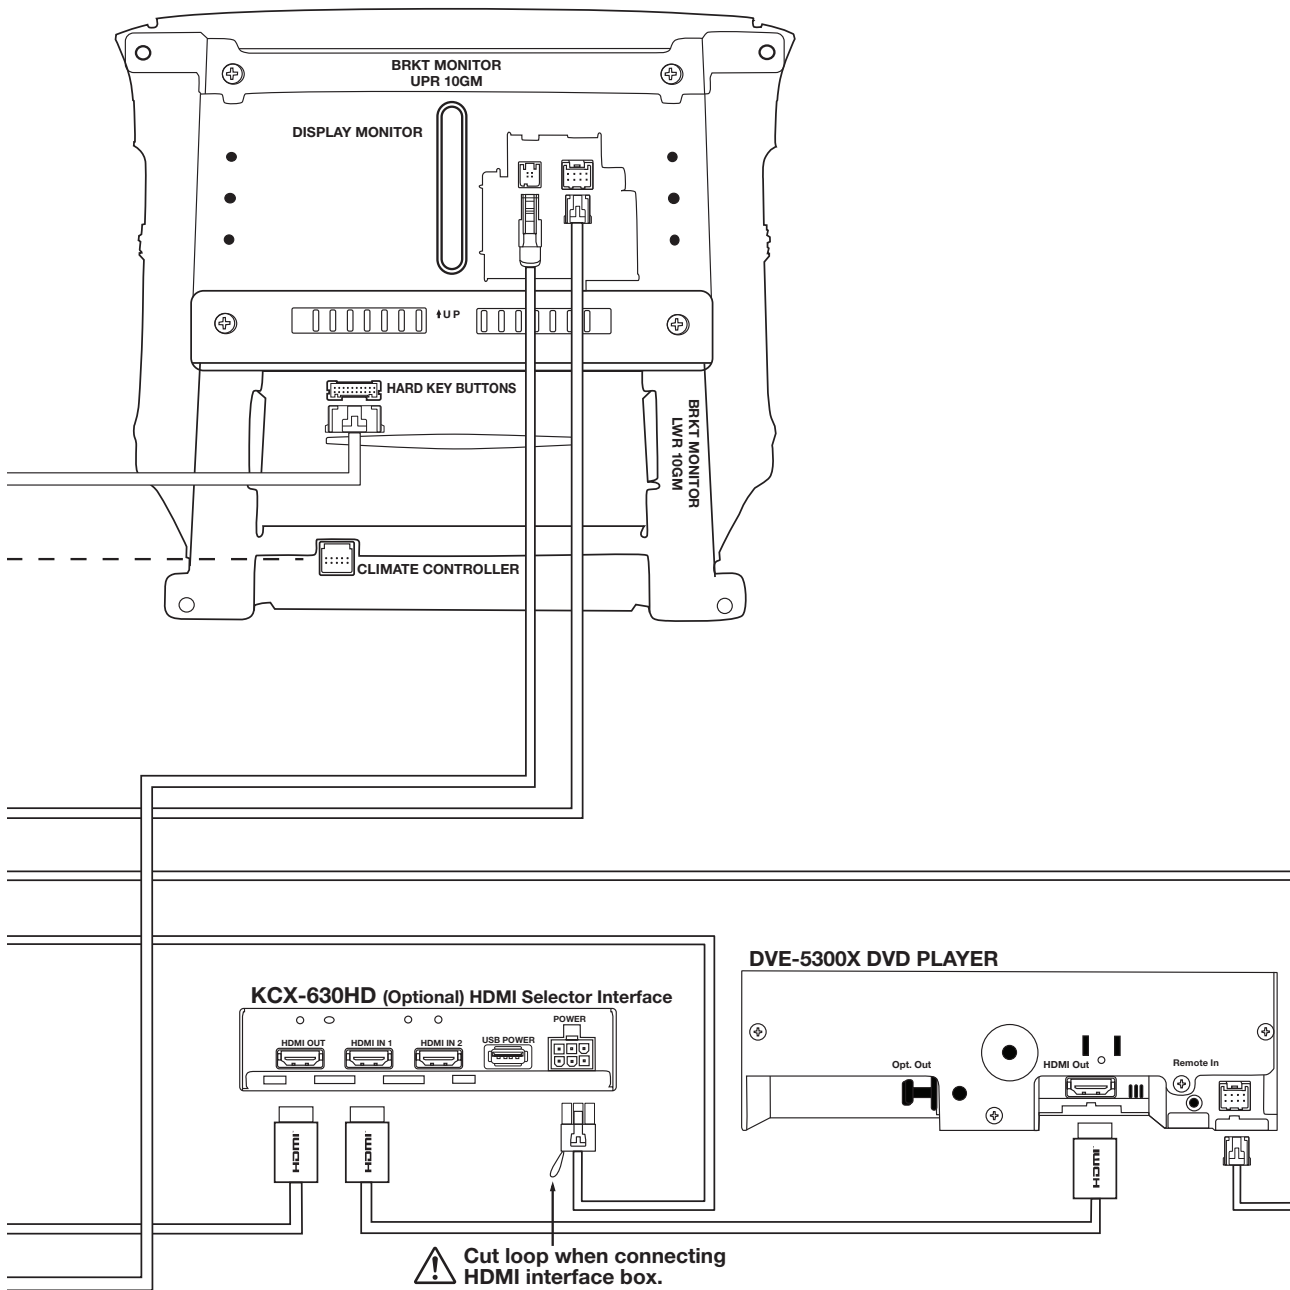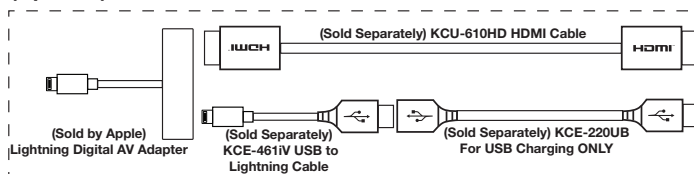**(Optional) iPhone Connection**

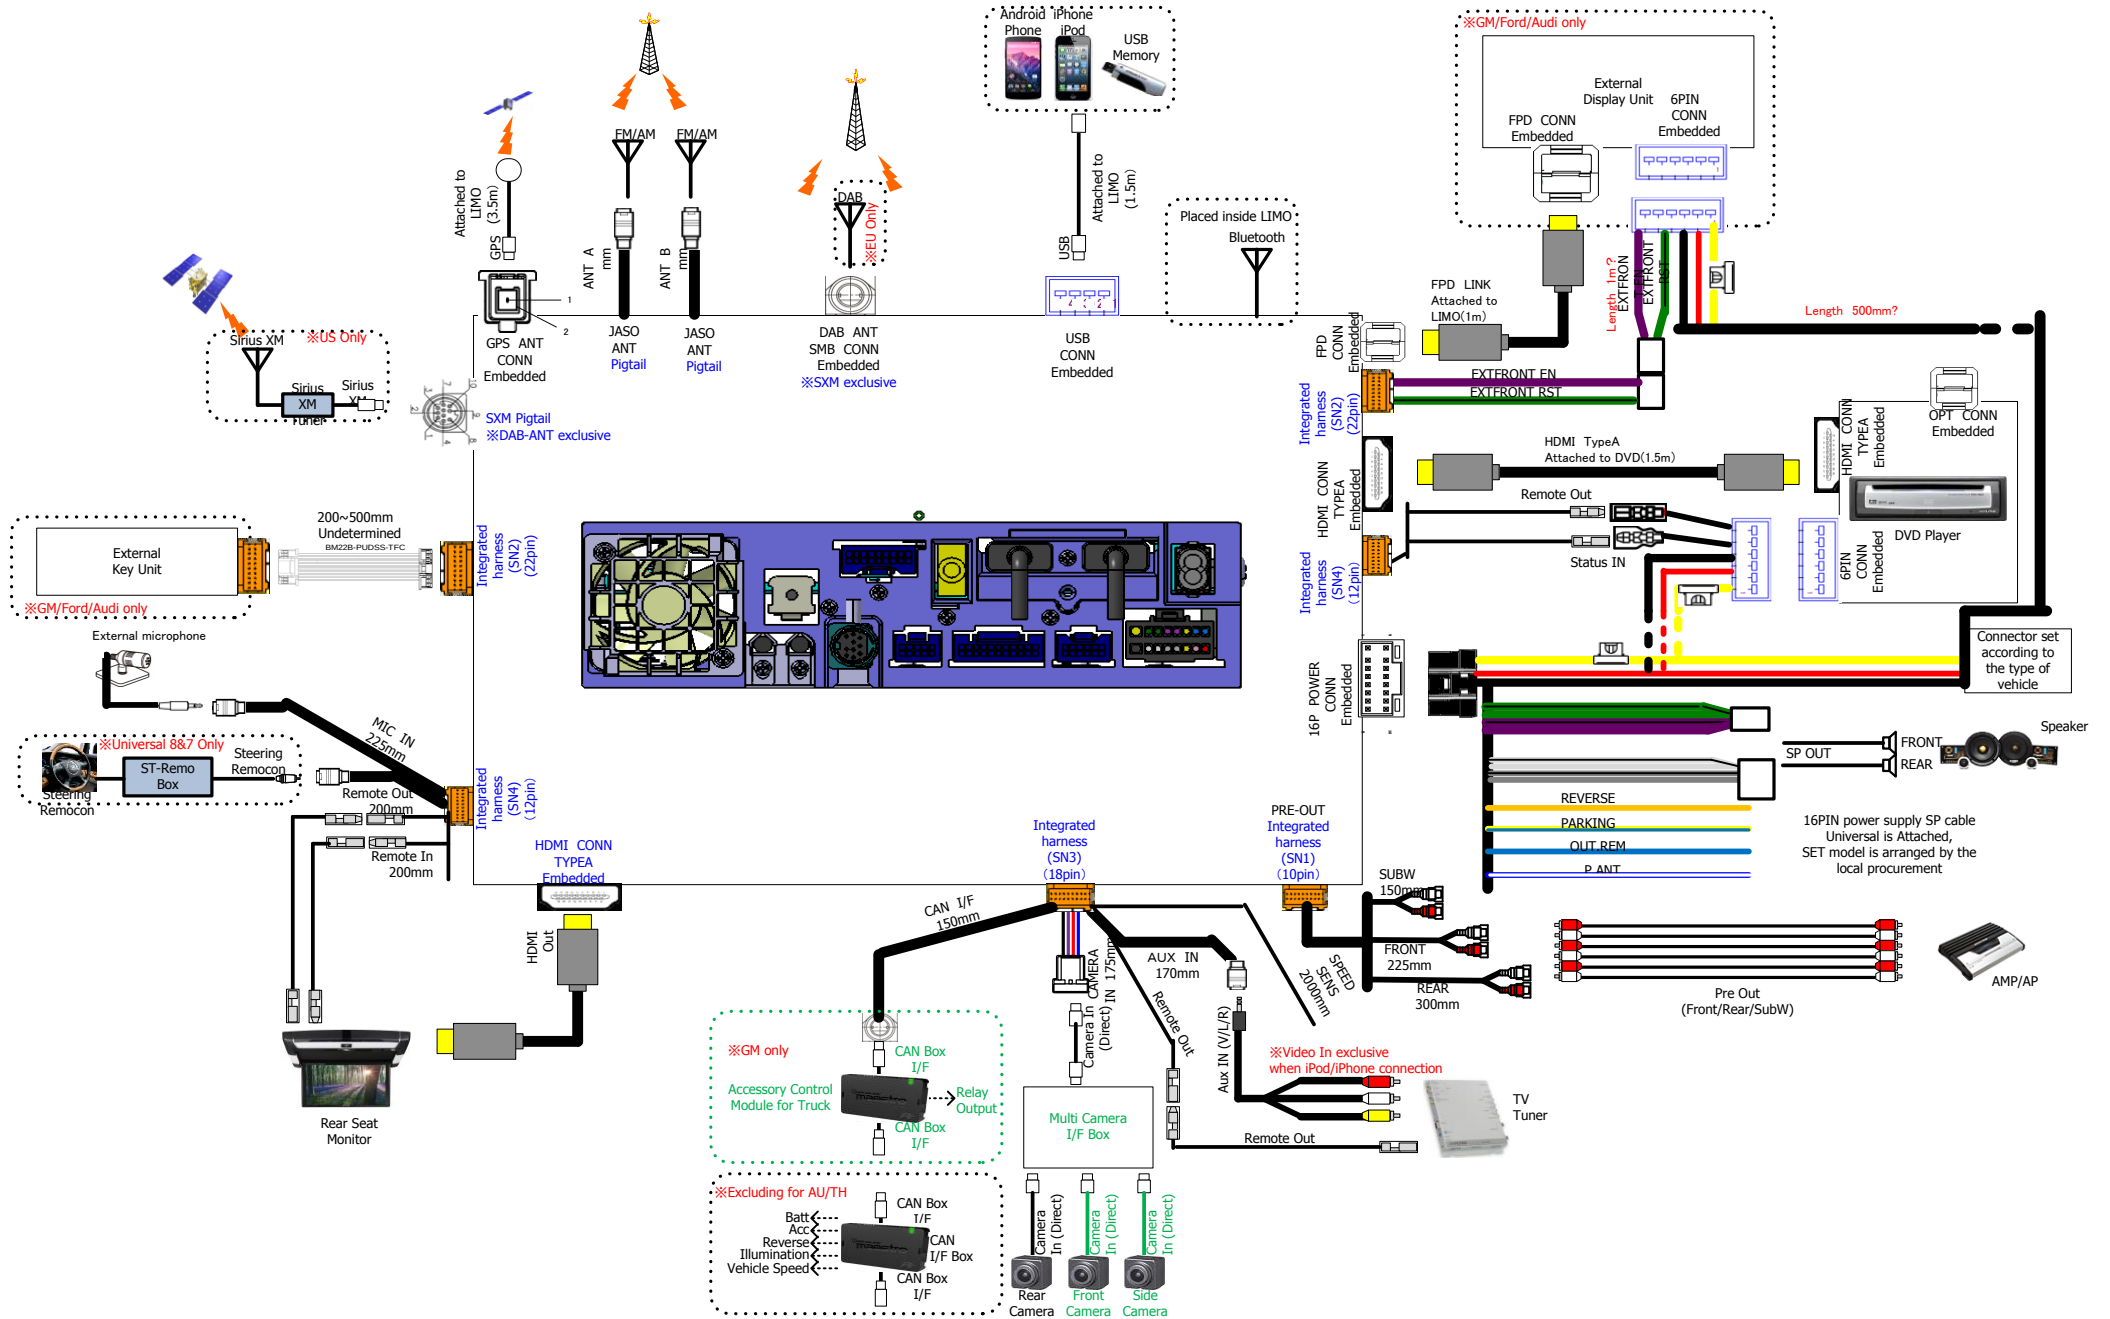
System Connection



Parts Identification

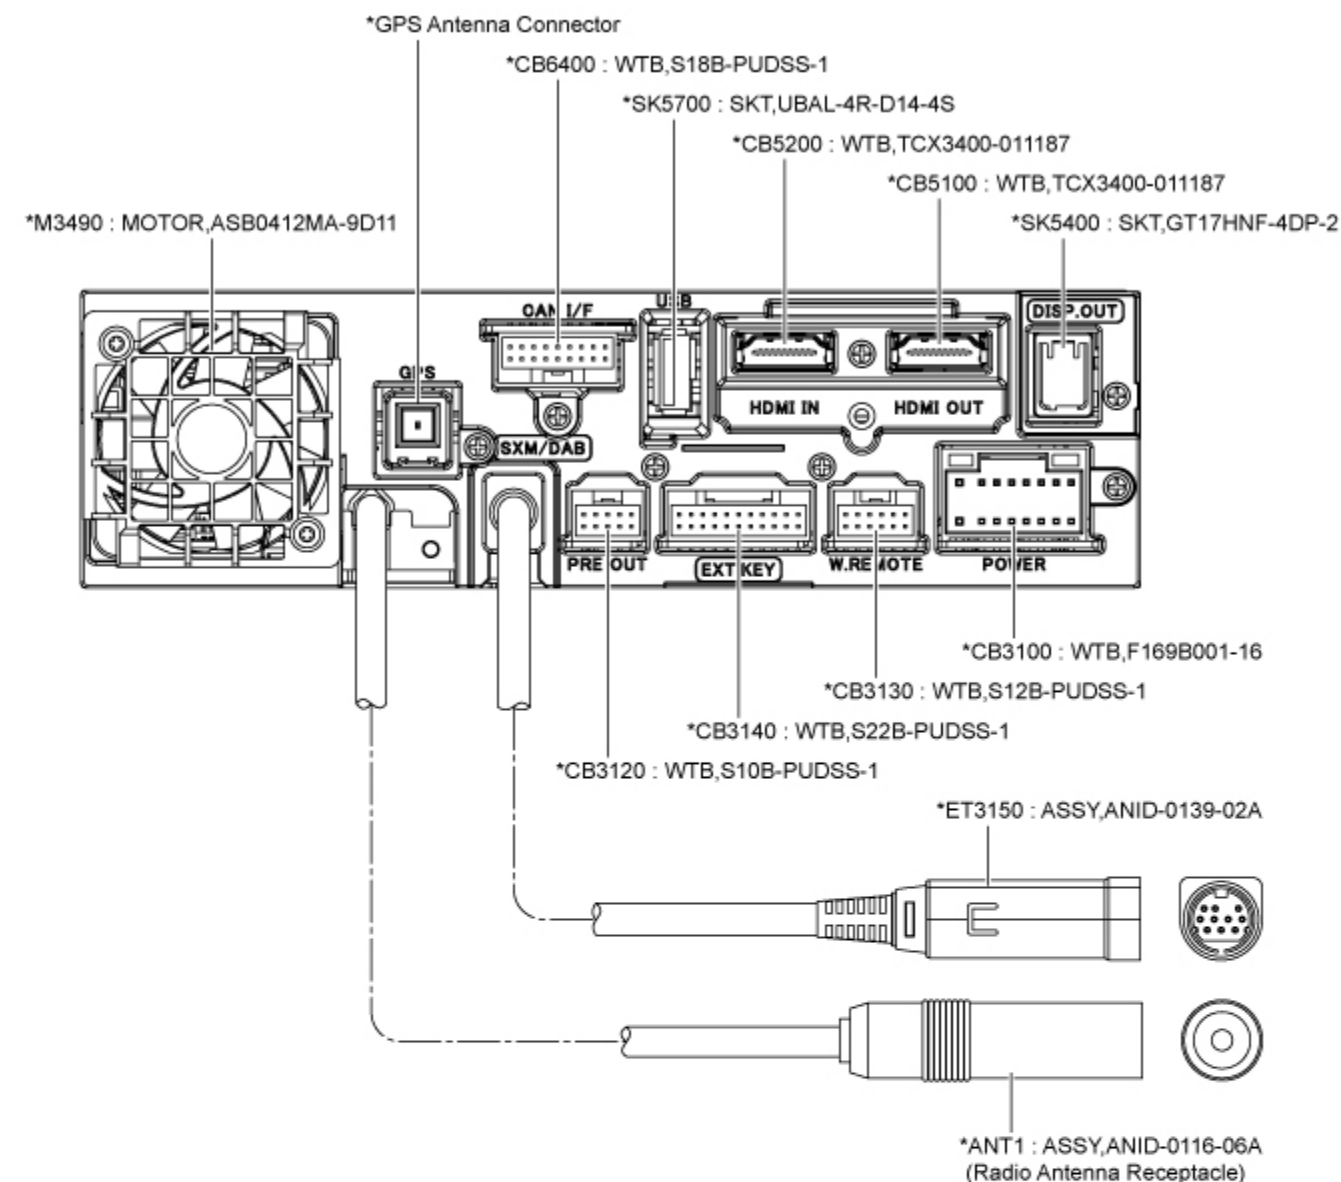


*ET3150 : ASSY,ANID-0139-02A

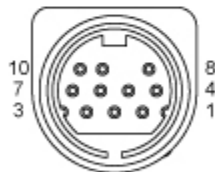


①	AUDIO_L	⑥	SXM_RX
②	SXM_TX	⑦	NC
③	NC	⑧	GND_D
④	AUDIO_R	⑨	POWER
⑤	GND_A	⑩	PWR_EN

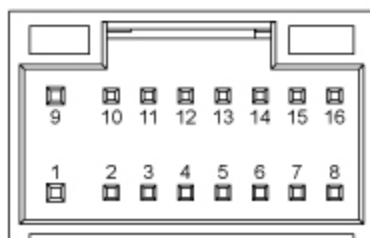*CB3100 : WTB,F169B001-16




①	GND	⑨	BATT
②	FL-	⑩	RL-
③	FL+	⑪	RL+
④	FR-	⑫	RR-
⑤	FR+	⑬	RR+
⑥	NC (F_PARKING)	⑭	PARKING
⑦	REVERSE	⑮	O-REM
⑧	ACC	⑯	P-ANT

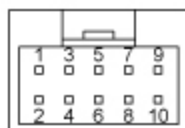*CB3120 : WTB,S10B-PUDSS-1



①	GND	⑥	RR
②	SWL	⑦	GND
③	GND	⑧	FL
④	SWR	⑨	FR
⑤	RL	⑩	NC

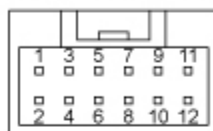*CB3130 : WTB,S12B-PUDSS-1




①	ST_REMIN	⑦	REAR_REM_OUT
②	ST_REM5V	⑧	HDMI_ST_IN
③	GND	⑨	NC
④	REAR_REM_IN	⑩	NC
⑤	AUX_REM_OUT	⑪	HFT_MIC+
⑥	HDMI_REM_OUT	⑫	HFT_MIC-

*CB3140 : WTB,S22B-PUDSS-1




①	EXT_LED_8.5V	⑫	REMOCON_EYE
②	LED_GND	⑬	DG_3.3V
③	NC	⑭	EXT_KEY_AD2
④	LED_GND	⑮	EXT_KEY_AD1
⑤	HARD_KEY_PWM	⑯	EXT_KEY_GND
⑥	EXT_DISP_GND	⑰	MIC_GND
⑦	DIMMER	⑱	EXT_MIC+
⑧	EXT_DISP_WDOG	⑲	RESET_SW
⑨	DIMMER_GND	⑳	EXT_MIC-
⑩	EXT_DISP_EN	㉑	ENC_1
⑪	EXT_KEY_AD3	㉒	ENC_2

*CB5100 : WTB,TCX3400-011187



①	TMDS Data2+	⑪	TMDS Clock Shield
②	TMDS Data2 Shield	⑫	TMDS Clock-
③	TMDS Data2-	⑬	NC (CEC)
④	TMDS Data1+	⑭	NC (Utility)
⑤	TMDS Data1 Shield	⑮	SCL
⑥	TMDS Data1-	⑯	SDA
⑦	TMDS Data0+	⑰	DDC/CEC Ground
⑧	TMDS Data0 Shield	⑱	+5V Power
⑨	TMDS Data0-		Hot Plug Detect
⑩	TMDS Clock+		

*CB5200 : WTB,TCX3400-011187



①	TMDS Data2+	⑪	TMDS Clock Shield
②	TMDS Data2 Shield	⑫	TMDS Clock-
③	TMDS Data2-	⑬	NC (CEC)
④	TMDS Data1+	⑭	NC (Utility)
⑤	TMDS Data1 Shield	⑮	SCL

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			C1000	08S45232Y05	CAP,CER 102K-B1H -CP
FRONT-P.W.Board			C1001	08S35374W01	CAP,CER 104K-B1E-CP
FRONT-P.W.Board			C1002	08S35374W01	CAP,CER 104K-B1E-CP
FRONT-P.W.Board			C1003	08S45676W65	CAP,CER.222K-B1H -CP
FRONT-P.W.Board			C1004	08S35374W12	CAP,CER 106K-B0J -CP
FRONT-P.W.Board			C1005	08S35374W01	CAP,CER 104K-B1E-CP
FRONT-P.W.Board			C1006	08S45231Y11	CAP,CER 8R0D-CH1H-CP
FRONT-P.W.Board			C1007	08S45231Y13	CAP,CER 10RD-CH1H-CP
FRONT-P.W.Board			C1008	08S35374W01	CAP,CER 104K-B1E-CP
FRONT-P.W.Board			C1009	08S35374W01	CAP,CER 104K-B1E-CP
FRONT-P.W.Board			C1011	08S45232Y05	CAP,CER 102K-B1H -CP
FRONT-P.W.Board			C1013	08S35374W01	CAP,CER 104K-B1E-CP
FRONT-P.W.Board			C2001	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C2002	08S45539Y07	CAP,CER 333KX7R2J-CP
FRONT-P.W.Board			C2004	08S45231Y25	CAP,CER 101J-CH1H-CP
FRONT-P.W.Board			C2005	08S45232Y05	CAP,CER 102K-B1H -CP
FRONT-P.W.Board			C2006	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C2008	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C2009	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C2011	08S65670Y08	CAP,CER 225KX5R1H-CP
FRONT-P.W.Board			C3000	08S65676Y03	CAP,CER 225KX7R1C-CP
FRONT-P.W.Board			C3001	08S65669Y03	CAP,CER 224KX7R1H-CP

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			C3002	08S35374W10	CAP,CER 225K-B1A -CP
FRONT-P.W.Board			C3003	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3004	08S45232Y08	CAP,CER 332K-B1H -CP
FRONT-P.W.Board			C3005	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3007	08S45231Y25	CAP,CER 101J-CH1H-CP
FRONT-P.W.Board			C3009	08S65676Y09	CAP,CER 475KX7R1H-CP
FRONT-P.W.Board			C3010	08S65670Y01	CAP,CER 106KX5R1C-CP
FRONT-P.W.Board			C3011	08S65677Y06	CAP,CER 226MX7R1C-CP
FRONT-P.W.Board			C3012	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3013	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3014	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3015	08S65677Y06	CAP,CER 226MX7R1C-CP
FRONT-P.W.Board			C3016	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3032	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3033	08S35374W10	CAP,CER 225K-B1A -CP
FRONT-P.W.Board			C3047	08S35374W10	CAP,CER 225K-B1A -CP
FRONT-P.W.Board			C3048	08S65670Y09	CAP,CER 106KX5R1E-CP
FRONT-P.W.Board			C3049	08S45232Y07	CAP,CER 222K-B1H -CP
FRONT-P.W.Board			C3051	08S65670Y02	CAP,CER 225KX5R1E-CP
FRONT-P.W.Board			C3052	08S45232Y11	CAP,CER 103K-B1C -CP
FRONT-P.W.Board			C3053	08S65670Y07	CAP,CER 105KX5R1H-CP
FRONT-P.W.Board			C3054	08S65670Y07	CAP,CER 105KX5R1H-CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			C3056	08S65671Y03	CAP,CER 475KX5R1H-CP
FRONT-P.W.Board			C3057	08S65670Y08	CAP,CER 225KX5R1H-CP
FRONT-P.W.Board			C3058	08S35374W08	CAP,CER 474K-B1C -CP
FRONT-P.W.Board			C3059	08S45231Y31	CAP,CER 331J-CH1H-CP
FRONT-P.W.Board			C3060	08S45232Y05	CAP,CER 102K-B1H -CP
FRONT-P.W.Board			C3061	08S45232Y07	CAP,CER 222K-B1H -CP
FRONT-P.W.Board			C3062	08S45232Y07	CAP,CER 222K-B1H -CP
FRONT-P.W.Board			C3063	08S65670Y07	CAP,CER 105KX5R1H-CP
FRONT-P.W.Board			C3064	08S45232Y05	CAP,CER 102K-B1H -CP
FRONT-P.W.Board			C3065	08S65670Y09	CAP,CER 106KX5R1E-CP
FRONT-P.W.Board			C3066	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C3068	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			C4000	08S65128F88	CAP,CER 104K-B1H -CP
FRONT-P.W.Board			C4001	08S65128F88	CAP,CER 104K-B1H -CP
FRONT-P.W.Board			C4002	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4003	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4004	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4005	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4006	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4007	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4008	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4009	08S45232Y17	CAP,CER 104K-B0J -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			C4011	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4012	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4013	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C4014	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C4015	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C4017	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C4018	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C4019	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5000	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5001	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5002	08S35374W12	CAP,CER 106K-B0J -CP
FRONT-P.W.Board			C5003	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5004	08S35374W12	CAP,CER 106K-B0J -CP
FRONT-P.W.Board			C5005	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5006	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5007	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5008	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5009	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5010	08S45231Y11	CAP,CER 8R0D-CH1H-CP
FRONT-P.W.Board			C5011	08S45231Y10	CAP,CER 7R0D-CH1H-CP
FRONT-P.W.Board			C5012	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5013	08S45232Y17	CAP,CER 104K-B0J -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			C5014	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5015	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5016	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5017	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5018	08S35374W12	CAP,CER 106K-B0J -CP
FRONT-P.W.Board			C5019	08S35374W12	CAP,CER 106K-B0J -CP
FRONT-P.W.Board			C5020	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C5021	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C5022	08S45232Y03	CAP,CER 471K-B1H -CP
FRONT-P.W.Board			C5023	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C5024	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5025	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5027	08S35350Y04	CAP,CER 105K-B1C -CP
FRONT-P.W.Board			C5028	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5029	08S45232Y17	CAP,CER 104K-B0J -CP
FRONT-P.W.Board			C5030	08S45232Y03	CAP,CER 471K-B1H -CP
FRONT-P.W.Board			C5031	08S45231Y25	CAP,CER 101J-CH1H-CP
FRONT-P.W.Board			C5032	08S45231Y25	CAP,CER 101J-CH1H-CP
FRONT-P.W.Board			C5033	08S45231Y25	CAP,CER 101J-CH1H-CP
FRONT-P.W.Board			C5034	08S35374W11	CAP,CER 475K-B0J -CP
FRONT-P.W.Board			C5035	08S65670Y06	CAP,CER 226KX5R1A-CP
FRONT-P.W.Board			C5036	08S65670Y06	CAP,CER 226KX5R1A-CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			C7000	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7001	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7002	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7003	08S35374W12	CAP,CER 106K-B0J -CP
FRONT-P.W.Board			C7004	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7005	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7006	08S65667Y05	CAP,CER 105KX5R1A-CP
FRONT-P.W.Board			C7007	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7008	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7009	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7010	08S45676W85	CAP,CER 104K-B1C -CP
FRONT-P.W.Board			C7011	08S45231Y20	CAP,CER 39RJ-CH1H-CP
FRONT-P.W.Board			C7012	08S45231Y20	CAP,CER 39RJ-CH1H-CP
FRONT-P.W.Board			C7013	08S45231Y20	CAP,CER 39RJ-CH1H-CP
FRONT-P.W.Board			C7014	08S45231Y20	CAP,CER 39RJ-CH1H-CP
FRONT-P.W.Board			C7015	08S45232Y11	CAP,CER 103K-B1C -CP
FRONT-P.W.Board			C7016	08S65667Y05	CAP,CER 105KX5R1A-CP
FRONT-P.W.Board			C7017	08S65667Y05	CAP,CER 105KX5R1A-CP
FRONT-P.W.Board			C7018	08S65669Y03	CAP,CER 224KX7R1H-CP
FRONT-P.W.Board			CB1000	09T25286Y10	WTB,BM(10)B-SRSS -E9
FRONT-P.W.Board			CB2000	09-25106Z09	WTB,S08B-PUDSS-1 -DB
FRONT-P.W.Board			CB3001	09-01488Z07	WTB,SM05B-GHS-TB -E5

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			CB5000	09-23546Z06	FFC,FH52-40S-0.5SHEQ
FRONT-P.W.Board			CB7000	09-29915Z05	FFC,60FHH-SM1-GAN-EZ
FRONT-P.W.Board			CB7001	09-05384Z11	FFC,52745-1597 -E9
FRONT-P.W.Board			D2000	48-05164Z01	DIO,1SS352-TPH3 -CP
FRONT-P.W.Board			E2000	23T35612Y03	CAP,WX 101-1E -E6
FRONT-P.W.Board			E2001	23T65114Y31	CAP,FK 471-1E-G -EA
FRONT-P.W.Board			E2002	23T75543Y04	CAP,MVA 221-0JF55-E6
FRONT-P.W.Board			E3000	23T35612Y03	CAP,WX 101-1E -E6
FRONT-P.W.Board			E3001	23T35612Y03	CAP,WX 101-1E -E6
FRONT-P.W.Board			E3002	23T65114Y06	CAP,FK 221-0J-D -E6
FRONT-P.W.Board			IC1000	51T75063Y07	BD5229G-TR -CP
FRONT-P.W.Board			IC1001	83-30860Z26	15Limo 10inch SOFTWARE
FRONT-P.W.Board			IC1001	51-12505Z01	MTP,R5F3640MDFB -QT
FRONT-P.W.Board			IC2000	51-30768Z01	NJW4183DL1-33BTE1NE5
FRONT-P.W.Board			IC2001	51T65016Y26	S-80937CNMC-T2 -CP
FRONT-P.W.Board			IC3000	51-23593Z02	BD00IC0WEFJ-ME2 -SE2
FRONT-P.W.Board			IC3002	51-28779Z01	BD90620EFJ-CE2 -SE2
FRONT-P.W.Board			IC3004	51-25969Z01	MAX16813ATP/V+T -LE2
FRONT-P.W.Board			IC3005	51-23593Z02	BD00IC0WEFJ-ME2 -SE2
FRONT-P.W.Board			IC3006	51-19754Z02	NJM2857DL3-33TE1-NE5
FRONT-P.W.Board			IC4000	51-27405Z01	DS90UH928QSQ -LE6
FRONT-P.W.Board			IC5000	51-29348Z01	TW8834AT-TA2-GR -QT

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			IC5001	51T85276W02	TC7WH74FK-TE85L -CP
FRONT-P.W.Board			IC5002	51T55336Y02	TC7SH04FU,JF-L -CP
FRONT-P.W.Board			IC7000	51T15456Y01	TC74HC4066AFT-EL-SE5
FRONT-P.W.Board			IC7001	83-30860Z27	15Limo 10inch TP_SOFTWARE
FRONT-P.W.Board			IC7001	51-28000Z01	CY8CTMA884AE-12 -QT
FRONT-P.W.Board			L3001	24-17231Z03	IND,NR8040 6R8N -E6
FRONT-P.W.Board			L3004	24-05547Z06	IND,SLF10145-H22RMEA
FRONT-P.W.Board			L3005	24T95456W12	FBI,BLM18AG102SH1-CP
FRONT-P.W.Board			L3006	24-22371Z01	IND,NRS4018T 2R2M-E2
FRONT-P.W.Board			L3007	24-22372Z08	IND,NRS6045T 22RM-E2
FRONT-P.W.Board			L5000	24T95458W07	FBI,BLM31PG601SH1-CP
FRONT-P.W.Board			L5001	24T95456W27	FBI,BLM18PG181SH1-CP
FRONT-P.W.Board			L5002	24T95456W27	FBI,BLM18PG181SH1-CP
FRONT-P.W.Board			L5003	24T95458W07	FBI,BLM31PG601SH1-CP
FRONT-P.W.Board			L5004	24-06212Z01	FBI,BLM15AG601SH1-CP
FRONT-P.W.Board			L5005	24T95456W27	FBI,BLM18PG181SH1-CP
FRONT-P.W.Board			Q1000	48T25737Y02	TR,UMD3N-TR -CP
FRONT-P.W.Board			Q1001	48T25737Y02	TR,UMD3N-TR -CP
FRONT-P.W.Board			Q2001	48T25737Y01	TR,UMD2N-TR -CP
FRONT-P.W.Board			Q2002	48T94606F06	TR,DTC114EUA-T106-CP
FRONT-P.W.Board			Q3006	48-24943Z02	FET,RSH065N06-TB -E2
FRONT-P.W.Board			Q5000	48T35687Y01	TR,UMH11N-TN -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			Q5001	48-20288Z01	FET,MTM981400BBF -E2
FRONT-P.W.Board			Q5002	48-20288Z01	FET,MTM981400BBF -E2
FRONT-P.W.Board			R1000	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1001	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1002	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1003	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1004	06S15593Y91	RES,RK 563F 1/10 -CP
FRONT-P.W.Board			R1005	06S15593Y41	RES,RK 471F 1/10 -CP
FRONT-P.W.Board			R1006	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1007	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R1008	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R1009	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1010	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1011	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1014	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1015	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1016	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1017	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1018	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1019	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1020	06S15615Y81	RES,RK 223J 1/16 -CP
FRONT-P.W.Board			R1021	06S15615Y89	RES,RK 473J 1/16 -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R1022	06S15615Y81	RES,RK 223J 1/16 -CP
FRONT-P.W.Board			R1023	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R1024	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R1025	06S15615Y81	RES,RK 223J 1/16 -CP
FRONT-P.W.Board			R1028	06S15615Y81	RES,RK 223J 1/16 -CP
FRONT-P.W.Board			R1030	06S15615Y89	RES,RK 473J 1/16 -CP
FRONT-P.W.Board			R1031	06S15615Y89	RES,RK 473J 1/16 -CP
FRONT-P.W.Board			R1032	06S15615Y81	RES,RK 223J 1/16 -CP
FRONT-P.W.Board			R1033	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R1034	06S45674W89	RES,RK 223J 1/10 -CP
FRONT-P.W.Board			R1036	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R1037	06S45674W89	RES,RK 223J 1/10 -CP
FRONT-P.W.Board			R1038	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R1043	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R2000	06S70072F53	RES,CP .102-J-1/4-CP
FRONT-P.W.Board			R2001	06S35095Y01	RES,RK 333J 1/4 -CP
FRONT-P.W.Board			R2002	06S15593Y96	RES,RK 913F 1/10 -CP
FRONT-P.W.Board			R2003	06S15615Y59	RES,RK 272J 1/16 -CP
FRONT-P.W.Board			R2005	06S35083Y44	RES,RK 393F 1/4 -CP
FRONT-P.W.Board			R2006	06S70072F98	RES,RK 223J 1/4 -CP
FRONT-P.W.Board			R2011	06S70072F53	RES,CP .102-J-1/4-CP
FRONT-P.W.Board			R3000	06S45675W01	RES,RK 623J 1/10 -CP

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R3001	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R3002	06S65415Y30	RES,RK 272F 1/16 -CP
FRONT-P.W.Board			R3003	06S65415Y29	RES,RK 222F 1/16 -CP
FRONT-P.W.Board			R3004	06S65415Y32	RES,RK 392F 1/16 -CP
FRONT-P.W.Board			R3005	06S45675W23	RES,RK 514J 1/10 -CP
FRONT-P.W.Board			R3008	06S15615Y85	RES,RK 333J 1/16 -CP
FRONT-P.W.Board			R3009	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R3010	06-25919Z04	RES,RK 133F 1/16 -CP
FRONT-P.W.Board			R3011	06S15615Y83	RES,RK 273J 1/16 -CP
FRONT-P.W.Board			R3013	06S65415Y31	RES,RK 332F 1/16 -CP
FRONT-P.W.Board			R3014	06S45675W21	RES,RK 434J 1/10 -CP
FRONT-P.W.Board			R3015	06S45674W99	RES,RK 563J 1/10 -CP
FRONT-P.W.Board			R3016	06S15594Y23	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R3017	06S45675W18	RES,RK 334J 1/10 -CP
FRONT-P.W.Board			R3019	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R3023	06S45674W74	RES,RK 512J 1/10 -CP
FRONT-P.W.Board			R3068	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R3069	06S65415Y38	RES,RK 123F 1/16 -CP
FRONT-P.W.Board			R3070	06S65415Y30	RES,RK 272F 1/16 -CP
FRONT-P.W.Board			R3071	06S65415Y33	RES,RK 472F 1/16 -CP
FRONT-P.W.Board			R3073	06S65415Y34	RES,RK 562F 1/16 -CP
FRONT-P.W.Board			R3075	06S65415Y37	RES,RK 103F 1/16 -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R3076	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R3077	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R3078	06S15593Y57	RES,RK 222F 1/10 -CP
FRONT-P.W.Board			R3079	06S65522Y08	RES,RK R39F 1/4 -CP
FRONT-P.W.Board			R3080	06S65415Y32	RES,RK 392F 1/16 -CP
FRONT-P.W.Board			R3081	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R3082	06S65415Y32	RES,RK 392F 1/16 -CP
FRONT-P.W.Board			R3083	06S65415Y21	RES,RK 471F 1/16 -CP
FRONT-P.W.Board			R3084	06S65415Y39	RES,RK 153F 1/16 -CP
FRONT-P.W.Board			R3085	06S65415Y55	RES,RK 334F 1/16 -CP
FRONT-P.W.Board			R3086	06S65415Y38	RES,RK 123F 1/16 -CP
FRONT-P.W.Board			R3087	06S65415Y37	RES,RK 103F 1/16 -CP
FRONT-P.W.Board			R3088	06S65415Y35	RES,RK 682F 1/16 -CP
FRONT-P.W.Board			R3090	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R3091	06S15615Y81	RES,RK 223J 1/16 -CP
FRONT-P.W.Board			R3092	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R3093	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R3094	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R4000	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R4001	06S35095Y08	RES,RK JUMPER 1/4-CP
FRONT-P.W.Board			R4003	06S15615Y97	RES,RK 104J 1/16 -CP
FRONT-P.W.Board			R4004	06S35095Y08	RES,RK JUMPER 1/4-CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R4005	06S45674W33	RES,RK 101J 1/10 -CP
FRONT-P.W.Board			R4006	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R4008	06S15615Y97	RES,RK 104J 1/16 -CP
FRONT-P.W.Board			R4009	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5000	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5001	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5002	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R5003	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5004	06S15615Y39	RES,RK 391J 1/16 -CP
FRONT-P.W.Board			R5005	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5006	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5007	06S15615Y53	RES,RK 152J 1/16 -CP
FRONT-P.W.Board			R5008	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5009	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5010	06S15615Y57	RES,RK 222J 1/16 -CP
FRONT-P.W.Board			R5011	06S15615Y57	RES,RK 222J 1/16 -CP
FRONT-P.W.Board			R5012	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R5013	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5014	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5015	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5016	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5017	06S15615Y25	RES,RK 101J 1/16 -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R5018	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5019	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5020	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5021	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5022	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5023	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5024	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5025	06S15616Y22	RES,RK 105J 1/16 -CP
FRONT-P.W.Board			R5026	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5027	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5028	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5029	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5030	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5031	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5032	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5033	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5034	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5035	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5036	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5037	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5038	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5039	06S15615Y25	RES,RK 101J 1/16 -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R5040	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5041	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5042	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5043	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R5044	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5045	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5046	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5047	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5048	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5049	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5050	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5051	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5052	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5053	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R5054	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R5055	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R5056	06S45675W43	RES,RK JUMPER1/10-CP
FRONT-P.W.Board			R5057	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			R5058	06S15615Y39	RES,RK 391J 1/16 -CP
FRONT-P.W.Board			R7000	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7001	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7002	06S15615Y49	RES,RK 102J 1/16 -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R7003	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7004	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7005	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7006	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7007	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7008	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7009	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7010	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7011	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7012	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7013	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7014	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7015	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7016	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7017	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7018	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7019	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7020	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7021	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7022	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7023	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7024	06S15615Y49	RES,RK 102J 1/16 -CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R7025	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7026	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7027	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7028	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7029	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7030	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7031	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7032	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7033	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7034	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7035	06S15615Y49	RES,RK 102J 1/16 -CP
FRONT-P.W.Board			R7036	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7037	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7038	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7039	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7040	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7041	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7042	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7043	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7044	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7045	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7046	06S15616Y23	RES,RK JUMPER1/16-CP

#1 X110-G Only,
\$1 X110-F Only,
Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			R7047	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7048	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7049	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7050	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7051	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7052	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7053	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7054	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7055	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7056	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7057	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7061	06S15615Y65	RES,RK 472J 1/16 -CP
FRONT-P.W.Board			R7062	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R7063	06S15615Y09	RES,RK 22RJ 1/16 -CP
FRONT-P.W.Board			R7064	06S15615Y25	RES,RK 101J 1/16 -CP
FRONT-P.W.Board			R7065	06S15616Y23	RES,RK JUMPER1/16-CP
FRONT-P.W.Board			R7066	06S15615Y73	RES,RK 103J 1/16 -CP
FRONT-P.W.Board			SD3001	48-19296Z01	DIO,SHT RB056L-40-E1
FRONT-P.W.Board			SD3004	48-17988Z01	DIO,SHT RB060M-60-CP
FRONT-P.W.Board			SK4000	09-29404Z02	SKT,GT17HN2-4DP -EE
FRONT-P.W.Board			XL1000	91-10720Z04	XTL,NX8045GB 6.0M-E5
FRONT-P.W.Board			XL5000	91-26661Z12	XTL,NX3225SAAG27.0CP

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
FRONT-P.W.Board			Z4000	91T65123Y02	EMI,DLW21SN900SQ2-CP
FRONT-P.W.Board			ZD2000	48-21149Z09	DIO,ZEN DZ2J036L0LCP
FRONT-P.W.Board			ZD2001	48-16145Z36	DIO,ZEN PZU9.1B1 -CP
FRONT-P.W.Board			ZD2002	48-21149Z26	DIO,ZEN DZ2J062M0LCP
FRONT-P.W.Board			ZD2003	48-21879Z01	DIO,ZEN SM5S24A -EA
FRONT-P.W.Board			ZD2004	48-21149Z09	DIO,ZEN DZ2J036L0LCP
Miscellaneous			ET7000	40-30438Z02	ASSY,HCDSP0B014B
Miscellaneous			LCD5000	65-30481Z01	ASSY,C101EAN01.0

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

#1 X110-G Only,

\$1 X110-F Only,

Others:Common.

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC1001(*) :51-12505Z01(MTP,R5F3640MDFB -QT)

IC7001(*) :51-28000Z01(CY8CTMA884AE-12 -QT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			ANT1	09-17241Z06	ASSY,ANID-0116-06A
AUDIO-P.W.Board			C2000	08S45231Y17	CAP,CER 22RJ-CH1H-CP
AUDIO-P.W.Board			C2001	08S45231Y17	CAP,CER 22RJ-CH1H-CP
AUDIO-P.W.Board			C2004	08S45232Y05	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C2005	08S45232Y05	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C2006	08S45232Y05	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C2008	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2009	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2010	08S45676W93	CAP,CER 224K-B1A -CP
AUDIO-P.W.Board			C2011	08S45676W93	CAP,CER 224K-B1A -CP
AUDIO-P.W.Board			C2012	08S45676W93	CAP,CER 224K-B1A -CP
AUDIO-P.W.Board			C2013	08S45676W93	CAP,CER 224K-B1A -CP
AUDIO-P.W.Board			C2014	08S45676W93	CAP,CER 224K-B1A -CP
AUDIO-P.W.Board			C2015	08-15113Z03	CAP,CER 475KX7R1C-CP
AUDIO-P.W.Board			C2016	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2017	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2018	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2019	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2020	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2021	08S45232Y21	CAP,CER 104K-B1A-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2023	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2050	08S45231Y31	CAP,CER 331J-CH1H-CP
AUDIO-P.W.Board			C2180	08-23325Z19	CAP,CER 224KX7R1C-CP
AUDIO-P.W.Board			C2190	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2192	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2200	08S65668Y05	CAP,CER 224KX5R1A-CP
AUDIO-P.W.Board			C2201	08S65668Y05	CAP,CER 224KX5R1A-CP
AUDIO-P.W.Board			C2206	08-23326Z06	CAP,CER 225KX7R0J-CP
AUDIO-P.W.Board			C2207	08-23326Z06	CAP,CER 225KX7R0J-CP
AUDIO-P.W.Board			C2208	08-15113Z01	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C2209	08-15113Z01	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C2210	08-15113Z01	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C2211	08-15113Z01	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C2212	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2213	08-23326Z03	CAP,CER 224KX7R1A-CP
AUDIO-P.W.Board			C2214	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2215	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2216	08S65669Y05	CAP,CER 106KX7R0J-CP
AUDIO-P.W.Board			C2217	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2218	08S45232Y21	CAP,CER 104K-B1A-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2219	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2220	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2221	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2222	08-23325Z07	CAP,CER 103KX7R1C-CP
AUDIO-P.W.Board			C2223	08S45677W69	CAP,CER 222J-CH1H-CP
AUDIO-P.W.Board			C2224	08-23325Z07	CAP,CER 103KX7R1C-CP
AUDIO-P.W.Board			C2225	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2226	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2227	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2228	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2229	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2230	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2231	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2232	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2234	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2235	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2236	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2237	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2238	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2239	08S65676Y05	CAP,CER 105KX7R1E-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2240	08S65676Y02	CAP,CER 475KX7R1A-CP
AUDIO-P.W.Board			C2241	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2242	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2243	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2244	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2245	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2246	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2247	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2248	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2249	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2250	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2251	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2252	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2253	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2254	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2255	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C2256	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2257	08S45231Y31	CAP,CER 331J-CH1H-CP
AUDIO-P.W.Board			C2258	08S45231Y31	CAP,CER 331J-CH1H-CP
AUDIO-P.W.Board			C2259	08S45232Y21	CAP,CER 104K-B1A-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2400	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2401	08-30898Z01	CAP,TF 155K-1C -CP
AUDIO-P.W.Board			C2402	08-30898Z01	CAP,TF 155K-1C -CP
AUDIO-P.W.Board			C2403	08-30898Z01	CAP,TF 155K-1C -CP
AUDIO-P.W.Board			C2404	08-30898Z01	CAP,TF 155K-1C -CP
AUDIO-P.W.Board			C2405	08-15113Z02	CAP,CER 335KX7R1C-CP
AUDIO-P.W.Board			C2406	08-15113Z02	CAP,CER 335KX7R1C-CP
AUDIO-P.W.Board			C2407	08S65667Y07	CAP,CER 225KX5R1A-CP
AUDIO-P.W.Board			C2408	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2409	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2410	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2411	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2412	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2413	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2414	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2416	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2417	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2418	08S45232Y08	CAP,CER 332K-B1H -CP
AUDIO-P.W.Board			C2419	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2420	08-30898Z01	CAP,TF 155K-1C -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2421	08-30898Z01	CAP,TF 155K-1C -CP
AUDIO-P.W.Board			C2422	08-30898Z01	CAP,TF 155K-1C -CP
AUDIO-P.W.Board			C2423	08-30898Z01	CAP,TF 155K-1C -CP
AUDIO-P.W.Board			C2424	08-15113Z03	CAP,CER 475KX7R1C-CP
AUDIO-P.W.Board			C2425	08-15113Z03	CAP,CER 475KX7R1C-CP
AUDIO-P.W.Board			C2426	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2427	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2428	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2429	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2430	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2431	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2432	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2433	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2434	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2435	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2440	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C2441	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C2442	08S65676Y05	CAP,CER 105KX7R1E-CP
AUDIO-P.W.Board			C2443	08S65676Y05	CAP,CER 105KX7R1E-CP
AUDIO-P.W.Board			C2444	08S65677Y06	CAP,CER 226MX7R1C-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2445	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2446	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2447	08S65676Y10	CAP,CER 106KX7R1C-CP
AUDIO-P.W.Board			C2451	08S45676W85	CAP,CER 104K-B1C -CP
AUDIO-P.W.Board			C2460	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2461	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2462	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2463	08S65670Y03	CAP,CER 335KX5R1E-CP
AUDIO-P.W.Board			C2470	08S65676Y10	CAP,CER 106KX7R1C-CP
AUDIO-P.W.Board			C2500	08-23325Z19	CAP,CER 224KX7R1C-CP
AUDIO-P.W.Board			C2501	08S45231Y10	CAP,CER 7R0D-CH1H-CP
AUDIO-P.W.Board			C2502	08S45231Y11	CAP,CER 8R0D-CH1H-CP
AUDIO-P.W.Board			C2503	08S65669Y05	CAP,CER 106KX7R0J-CP
AUDIO-P.W.Board			C2504	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2505	08-23325Z07	CAP,CER 103KX7R1C-CP
AUDIO-P.W.Board			C2506	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2507	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2508	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2509	08-23326Z05	CAP,CER 105KX7R1A-CP
AUDIO-P.W.Board			C2510	08S45232Y21	CAP,CER 104K-B1A-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2600	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2601	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2602	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2603	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2604	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2605	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2606	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2607	08S65676Y03	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C2611	08-30898Z02	CAP,TF 105K-1E -CP
AUDIO-P.W.Board			C2612	08-23326Z05	CAP,CER 105KX7R1A-CP
AUDIO-P.W.Board			C2613	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C2650	08-23326Z05	CAP,CER 105KX7R1A-CP
AUDIO-P.W.Board			C2800	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2850	08S45231Y17	CAP,CER 22RJ-CH1H-CP
AUDIO-P.W.Board			C2851	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2852	08S45231Y17	CAP,CER 22RJ-CH1H-CP
AUDIO-P.W.Board			C2853	08S45676W93	CAP,CER 224K-B1A -CP
AUDIO-P.W.Board			C2854	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C2855	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C2901	08S65669Y06	CAP,CER 103KX7R1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C2903	08S45677W16	CAP,CER.15RJ-CH1H-CP
AUDIO-P.W.Board			C2905	08S45677W60	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2906	08S45231Y06	CAP,CER 3R0C-CJ1H-CP
AUDIO-P.W.Board			C2907	08S45231Y15	CAP,CER 15RJ-CH1H-CP
AUDIO-P.W.Board			C2908	08S45231Y21	CAP,CER 47RJ-CH1H-CP
AUDIO-P.W.Board			C2912	08S45231Y04	CAP,CER 1R5C-CK1H-CP
AUDIO-P.W.Board			C2913	08S45231Y16	CAP,CER 18RJ-CH1H-CP
AUDIO-P.W.Board			C2914	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2918	08S45231Y24	CAP,CER 82RJ-CH1H-CP
AUDIO-P.W.Board			C2950	08S45677W60	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2955	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C2960	08S45231Y13	CAP,CER 10RD-CH1H-CP
AUDIO-P.W.Board			C2962	08S45231Y21	CAP,CER 47RJ-CH1H-CP
AUDIO-P.W.Board			C2963	08S35350Y04	CAP,CER 105K-B1C -CP
AUDIO-P.W.Board			C2964	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C2965	08S45677W60	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C2966	08S65676Y08	CAP,CER 106K-X7R1ACP
AUDIO-P.W.Board			C3002	08S45231Y14	CAP,CER 12RJ-CH1H-CP
AUDIO-P.W.Board			C3017	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3018	08S45232Y21	CAP,CER 104K-B1A-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C3019	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3020	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3021	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3022	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3026	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3029	08-23325Z19	CAP,CER 224KX7R1C-CP
AUDIO-P.W.Board			C3030	08S65676Y08	CAP,CER 106K-X7R1ACP
AUDIO-P.W.Board			C3031	08S65676Y08	CAP,CER 106K-X7R1ACP
AUDIO-P.W.Board			C3032	08S65676Y08	CAP,CER 106K-X7R1ACP
AUDIO-P.W.Board			C3047	08S45231Y14	CAP,CER 12RJ-CH1H-CP
AUDIO-P.W.Board			C3101	08S45539Y01	CAP,CER 102KX7R2J-CP
AUDIO-P.W.Board			C3103	08-26091Z01	CAP,CER 102KX7R2J-CP
AUDIO-P.W.Board			C3104	08-26091Z05	CAP,CER 103KX7R2J-CP
AUDIO-P.W.Board			C3130	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C3131	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C3132	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C3133	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C3134	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C3135	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C3136	08S45231Y38	CAP,CER 102J-CH1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C3140	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3143	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3146	08-19311Z03	CAP,CER 103KX7R1H-CP
AUDIO-P.W.Board			C3147	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3148	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3150	08S45677W44	CAP,CER.221J-CH1H-CP
AUDIO-P.W.Board			C3151	08S45677W44	CAP,CER.221J-CH1H-CP
AUDIO-P.W.Board			C3152	08S45677W44	CAP,CER.221J-CH1H-CP
AUDIO-P.W.Board			C3153	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3155	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3156	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3159	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3160	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3161	08-19311Z03	CAP,CER 103KX7R1H-CP
AUDIO-P.W.Board			C3163	08S35349Y08	CAP,CER 102K-B1H -CP
AUDIO-P.W.Board			C3203	08S45231Y25	CAP,CER 101J-CH1H-CP
AUDIO-P.W.Board			C3204	08S45231Y38	CAP,CER 102J-CH1H-CP
AUDIO-P.W.Board			C3205	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C3206	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C3210	08S65676Y10	CAP,CER 106KX7R1C-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C3221	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3222	08-19311Z03	CAP,CER 103KX7R1H-CP
AUDIO-P.W.Board			C3223	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3224	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3225	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3226	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3227	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3230	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3233	08-15113Z01	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C3236	08S45231Y31	CAP,CER 331J-CH1H-CP
AUDIO-P.W.Board			C3238	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3239	08-23326Z08	CAP,CER 473KX7R1H-CP
AUDIO-P.W.Board			C3240	08S45231Y31	CAP,CER 331J-CH1H-CP
AUDIO-P.W.Board			C3350	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C3351	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C3352	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3353	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3354	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3400	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3401	08S65669Y03	CAP,CER 224KX7R1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C3402	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3403	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3404	08-19311Z03	CAP,CER 103KX7R1H-CP
AUDIO-P.W.Board			C3405	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C3406	08-19311Z01	CAP,CER 104KX7R1H-CP
AUDIO-P.W.Board			C3407	08-23326Z05	CAP,CER 105KX7R1A-CP
AUDIO-P.W.Board			C3408	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3410	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C3411	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C3412	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C3430	08S65670Y08	CAP,CER 225KX5R1H-CP
AUDIO-P.W.Board			C3431	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3432	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3440	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3441	08S65676Y08	CAP,CER 106K-X7R1ACP
AUDIO-P.W.Board			C3442	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3460	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3461	08-15113Z01	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C3462	08S65669Y05	CAP,CER 106KX7R0J-CP
AUDIO-P.W.Board			C3464	08S65669Y03	CAP,CER 224KX7R1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C3470	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3471	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3480	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3481	08S65676Y08	CAP,CER 106K-X7R1ACP
AUDIO-P.W.Board			C3482	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3490	08S65676Y02	CAP,CER 475KX7R1A-CP
AUDIO-P.W.Board			C3492	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3493	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3494	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3495	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3496	08-15113Z03	CAP,CER 475KX7R1C-CP
AUDIO-P.W.Board			C3499	08-23326Z05	CAP,CER 105KX7R1A-CP
AUDIO-P.W.Board			C3502	08-15113Z01	CAP,CER 225KX7R1C-CP
AUDIO-P.W.Board			C3510	08-23325Z07	CAP,CER 103KX7R1C-CP
AUDIO-P.W.Board			C3512	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3550	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3551	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3552	08S45232Y21	CAP,CER 104K-B1A-CP
AUDIO-P.W.Board			C3602	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C3603	08S65669Y03	CAP,CER 224KX7R1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			C3604	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C3605	08S65676Y10	CAP,CER 106KX7R1C-CP
AUDIO-P.W.Board			C3607	08S45231Y25	CAP,CER 101J-CH1H-CP
AUDIO-P.W.Board			C3608	08S65676Y09	CAP,CER 475KX7R1H-CP
AUDIO-P.W.Board			C3610	08-23325Z04	CAP,CER 332KX7R1H-CP
AUDIO-P.W.Board			C3611	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3612	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			C3613	08S65677Y06	CAP,CER 226MX7R1C-CP
AUDIO-P.W.Board			C3615	08S45231Y25	CAP,CER 101J-CH1H-CP
AUDIO-P.W.Board			C3616	08S65676Y09	CAP,CER 475KX7R1H-CP
AUDIO-P.W.Board			C3617	08S65669Y03	CAP,CER 224KX7R1H-CP
AUDIO-P.W.Board			CB2000	09-14451Z06	FFC,502790-3091 -ED
AUDIO-P.W.Board			CB3100	09T35473Y16	WTB,F169B001-16 -DB
AUDIO-P.W.Board			CB3120	09-25106Z01	WTB,S10B-PUDSS-1 -DB
AUDIO-P.W.Board			CB3130	09-25106Z02	WTB,S12B-PUDSS-1 -DB
AUDIO-P.W.Board			CB3140	09-25106Z07	WTB,S22B-PUDSS-1 -DB
AUDIO-P.W.Board			CB3150	09-16961Z09	WTB,A1257WV0-10PS-ED
AUDIO-P.W.Board			CB3490	09T85454W03	WTB,53398-0371 -E6
AUDIO-P.W.Board			CH3300	09-29653Z01	BTB,FX23-100S-0.5S-T
AUDIO-P.W.Board			D2460	48-17624Z01	DIO,DA3J102D0L -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			D2461	48-17624Z01	DIO,DA3J102D0L -CP
AUDIO-P.W.Board			D2462	48-17624Z01	DIO,DA3J102D0L -CP
AUDIO-P.W.Board			D2650	48-05965Z01	DIO,1SS361-L -CP
AUDIO-P.W.Board			D2901	48-17547Z01	DIO,DA3J101F0L -CP
AUDIO-P.W.Board			D3200	48-05965Z01	DIO,1SS361-L -CP
AUDIO-P.W.Board			D3201	48-05164Z01	DIO,1SS352-TPH3 -CP
AUDIO-P.W.Board			D3202	48-05965Z01	DIO,1SS361-L -CP
AUDIO-P.W.Board			D3204	48-05965Z01	DIO,1SS361-L -CP
AUDIO-P.W.Board			D3205	48-05164Z01	DIO,1SS352-TPH3 -CP
AUDIO-P.W.Board			D3400	48T75527Y01	DIO,1SR154-400 -E1
AUDIO-P.W.Board			E2404	23-31100Z12	CAP,MAK 101-1C -E6
AUDIO-P.W.Board			E2405	23-31100Z07	CAP,MAK 101-1A -E6
AUDIO-P.W.Board			E2420	23-31100Z10	CAP,MAK 22R-1C -E3
AUDIO-P.W.Board			E2421	23-31100Z10	CAP,MAK 22R-1C -E3
AUDIO-P.W.Board			E2440	23S75244Y19	CAP,ELY 101-1C -E6
AUDIO-P.W.Board			E2441	23S75244Y17	CAP,ELY 22R-1C -E2
AUDIO-P.W.Board			E2442	23S75244Y17	CAP,ELY 22R-1C -E2
AUDIO-P.W.Board			E2460	23-31100Z26	CAP,MAK 3R3-1H -E2
AUDIO-P.W.Board			E2461	23-31100Z26	CAP,MAK 3R3-1H -E2
AUDIO-P.W.Board			E2600	23-31100Z17	CAP,MAK 10R-1E -E3

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			E2601	23-31100Z17	CAP,MAK 10R-1E -E3
AUDIO-P.W.Board			E2650	23S75244Y19	CAP,ELY 101-1C -E6
AUDIO-P.W.Board			E3100	23-19876Z04	CAP,CST 472-1E +
AUDIO-P.W.Board			E3200	23-31100Z17	CAP,MAK 10R-1E -E3
AUDIO-P.W.Board			E3300	23S75244Y31	CAP,ELY 471-1E -EA
AUDIO-P.W.Board			E3301	23S75244Y22	CAP,ELY 471-1C -EA
AUDIO-P.W.Board			E3400	23S75244Y19	CAP,ELY 101-1C -E6
AUDIO-P.W.Board			E3404	23S75244Y24	CAP,ELY 10R-1E -E2
AUDIO-P.W.Board			E3405	23S75244Y25	CAP,ELY 22R-1E -E3
AUDIO-P.W.Board			E3406	23S75244Y14	CAP,ELY 681-1A -EA
AUDIO-P.W.Board			E3430	23S75244Y25	CAP,ELY 22R-1E -E3
AUDIO-P.W.Board			E3440	23S75244Y01	CAP,ELY 22R-0J -E2
AUDIO-P.W.Board			E3470	23S75244Y01	CAP,ELY 22R-0J -E2
AUDIO-P.W.Board			E3471	23-31100Z11	CAP,MAK 47R-1C -E6
AUDIO-P.W.Board			E3480	23S75244Y01	CAP,ELY 22R-0J -E2
AUDIO-P.W.Board			E3510	23S75244Y01	CAP,ELY 22R-0J -E2
AUDIO-P.W.Board			E3511	23-31100Z06	CAP,MAK 33R-1A -E3
AUDIO-P.W.Board			E3600	23S75244Y05	CAP,ELY 331-0J -E6
AUDIO-P.W.Board			E3601	23S75244Y24	CAP,ELY 10R-1E -E2
AUDIO-P.W.Board			E3602	23S75244Y24	CAP,ELY 10R-1E -E2

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			IC2000	83-31628Z30	V0.960_LIMOGM_BU
AUDIO-P.W.Board			IC2000	51-23912Z01	MTP,D70F3479AGJAQ-QT
AUDIO-P.W.Board			IC2001	51T15185Y03	TC7SH08FU,LJ -CP
AUDIO-P.W.Board			IC2180	51-24805Z01	BR24T16F-WGE2 -SE2
AUDIO-P.W.Board			IC2190	51-04315Z22	BU4229G-TR -CP
AUDIO-P.W.Board			IC2200	51-30382Z02	SAF7754HV/N205 -QT
AUDIO-P.W.Board			IC2201	51-29083Z01	SN74AHC04QPWRG4-SE2
AUDIO-P.W.Board			IC2202	83-31628Z34	V1.100_LIMO_DiRaNA3
AUDIO-P.W.Board			IC2202	51-18520Z01	MX25L8035EM21-10G-ST
AUDIO-P.W.Board			IC2203	51-29083Z01	SN74AHC04QPWRG4-SE2
AUDIO-P.W.Board			IC2400	51-16740Z01	BD3461FS-E2 -SE6
AUDIO-P.W.Board			IC2420	51T25576W07	NJM4580V-TE2 -SE2
AUDIO-P.W.Board			IC2421	51T25576W07	NJM4580V-TE2 -SE2
AUDIO-P.W.Board			IC2422	51T25576W07	NJM4580V-TE2 -SE2
AUDIO-P.W.Board			IC2440	51-20907Z01	TPS60402QDBVRQ1 -CP
AUDIO-P.W.Board			IC2441	51-16845Z04	TAR5S50U-TE85L -CP
AUDIO-P.W.Board			IC2501	51-27602Z01	AK7736AVQ -QE6
AUDIO-P.W.Board			IC2600	51-30375Z01	STPA003OD-4WX -ZS
AUDIO-P.W.Board			IC2850	51T25141Y03	TC7SHU04FU,LJ -CP
AUDIO-P.W.Board			IC2851	51-27637Z01	SI4749-C10-AMR -LE2

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			IC3000	51-29945Z01	SAF3600EL/V1040A-BEA
AUDIO-P.W.Board			IC3001	83-31628Z35	VC0004.004R1_LIMOUS_Saturn
AUDIO-P.W.Board			IC3001	51-30259Z02	S25FL116K0XMFA040-ST
AUDIO-P.W.Board			IC3150	51T15194Y03	74VHCT08AFT-EL -SE2
AUDIO-P.W.Board			IC3200	51T65016Y26	S-80937CNMC-T2 -CP
AUDIO-P.W.Board			IC3206	51-02032Z02	TC7SET02FU,LJ -CP
AUDIO-P.W.Board			IC3207	51T15614Y01	TC74HC4051AFT-EL-SE5
AUDIO-P.W.Board			IC3208	51T15614Y01	TC74HC4051AFT-EL-SE5
AUDIO-P.W.Board			IC3209	51T35360Y01	TC7WH08FU-L -SE1
AUDIO-P.W.Board			IC3210	51T15194Y03	74VHCT08AFT-EL -SE2
AUDIO-P.W.Board			IC3211	51T15647Y01	NJM4558V-TE2 -SE2
AUDIO-P.W.Board			IC3400	51-13711Z02	TB2920AHQ -ZS
AUDIO-P.W.Board			IC3430	51-28614Z01	BD00FC0EEFJ-ME2 -SE2
AUDIO-P.W.Board			IC3440	51-23593Z02	BD00IC0WEFJ-ME2 -SE2
AUDIO-P.W.Board			IC3460	51-23593Z02	BD00IC0WEFJ-ME2 -SE2
AUDIO-P.W.Board			IC3470	51-23593Z05	BD00IA5EEFJ-ME2 -SE2
AUDIO-P.W.Board			IC3480	51-23593Z02	BD00IC0WEFJ-ME2 -SE2
AUDIO-P.W.Board			IC3510	51-07902Z02	NJM2871BF33-TE1 -CP
AUDIO-P.W.Board			IC3601	51-28779Z02	BD90640EFJ-CE2 -SE2
AUDIO-P.W.Board			IC3602	51-28779Z01	BD90620EFJ-CE2 -SE2

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			L2200	24-24463Z01	FBI,BLM15HD601SH1-CP
AUDIO-P.W.Board			L2201	24-24463Z01	FBI,BLM15HD601SH1-CP
AUDIO-P.W.Board			L2202	24-24463Z01	FBI,BLM15HD601SH1-CP
AUDIO-P.W.Board			L2203	24-17733Z06	IND,NLCV32T 47RK -CP
AUDIO-P.W.Board			L2204	24-17733Z06	IND,NLCV32T 47RK -CP
AUDIO-P.W.Board			L2205	24-24463Z01	FBI,BLM15HD601SH1-CP
AUDIO-P.W.Board			L2206	24-24463Z01	FBI,BLM15HD601SH1-CP
AUDIO-P.W.Board			L2210	24-24463Z01	FBI,BLM15HD601SH1-CP
AUDIO-P.W.Board			L2440	24T95202W25	IND,CDRH64B 102M -E6
AUDIO-P.W.Board			L2441	24T95202W25	IND,CDRH64B 102M -E6
AUDIO-P.W.Board			L2501	24-06212Z05	FBI,BLM15BB121SH1-CP
AUDIO-P.W.Board			L2502	24-06212Z05	FBI,BLM15BB121SH1-CP
AUDIO-P.W.Board			L2503	24-06212Z05	FBI,BLM15BB121SH1-CP
AUDIO-P.W.Board			L2850	24-06212Z01	FBI,BLM15AG601SH1-CP
AUDIO-P.W.Board			L2851	24-09036Z10	IND,LQW18AN R18J -CP
AUDIO-P.W.Board			L2852	24-06212Z01	FBI,BLM15AG601SH1-CP
AUDIO-P.W.Board			L2902	24-30185Z23	IND,LQW2BAS R22J -CP
AUDIO-P.W.Board			L2904	24T25164Y12	IND,FSLM2520 R82J-CP
AUDIO-P.W.Board			L2905	24-09036Z11	IND,LQW18AN R27J -CP
AUDIO-P.W.Board			L2906	24T25164Y19	IND,FSLM2520 3R3J-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			L2950	24T25164Y21	IND,FSLM2520 4R7J-CP
AUDIO-P.W.Board			L2951	24T25164Y05	IND,FSLM2520 R22J-CP
AUDIO-P.W.Board			L2952	24T15278Y03	IND,BM-7A -DB
AUDIO-P.W.Board			L2953	24T95456W27	FBI,BLM18PG181SH1-CP
AUDIO-P.W.Board			L3150	24-06212Z08	FBI,BLM15BD102SH1-CP
AUDIO-P.W.Board			L3490	24T95456W27	FBI,BLM18PG181SH1-CP
AUDIO-P.W.Board			L3492	24T95456W27	FBI,BLM18PG181SH1-CP
AUDIO-P.W.Board			L3493	24T95456W27	FBI,BLM18PG181SH1-CP
AUDIO-P.W.Board			L3494	24T95456W27	FBI,BLM18PG181SH1-CP
AUDIO-P.W.Board			L3495	24-28869Z04	FBI,BKP1608HS121 -CP
AUDIO-P.W.Board			L3601	24-17581Z02	IND,NRS5020T 1R5N-E2
AUDIO-P.W.Board			L3602	24-08610Z03	IND,DS106C2 10RM -EA
AUDIO-P.W.Board			L3603	24-22371Z01	IND,NRS4018T 2R2M-E2
AUDIO-P.W.Board			L3604	24-08610Z05	IND,DS106C2 33RM -EA
AUDIO-P.W.Board			PS3101	48-16589Z01	POLY,SW SMDC075F -E2
AUDIO-P.W.Board			PS3150	48-16589Z03	POLY,SW SMDC150F -E2
AUDIO-P.W.Board			Q2000	48T25737Y02	TR,UMD3N-TR -CP
AUDIO-P.W.Board			Q2001	48T25737Y02	TR,UMD3N-TR -CP
AUDIO-P.W.Board			Q2460	48T75180Y04	TR,IMH23-T110 -CP
AUDIO-P.W.Board			Q2461	48T75180Y04	TR,IMH23-T110 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			Q2462	48T75180Y04	TR,IMH23-T110 -CP
AUDIO-P.W.Board			Q2650	48T25737Y02	TR,UMD3N-TR -CP
AUDIO-P.W.Board			Q2651	48-20093Z01	TR,DMC561010R -CP
AUDIO-P.W.Board			Q2652	48T25737Y01	TR,UMD2N-TR -CP
AUDIO-P.W.Board			Q2950	48-29875Z01	TR,2SC5084-O -CP
AUDIO-P.W.Board			Q3200	48-12999Z01	TR,LTA114EUBFS8-TLCP
AUDIO-P.W.Board			Q3202	48-13000Z05	TR,LTC124EUBFS8-TLCP
AUDIO-P.W.Board			Q3203	48T25737Y01	TR,UMD2N-TR -CP
AUDIO-P.W.Board			Q3204	48-13000Z01	TR,LTC114EUBFS8-TLCP
AUDIO-P.W.Board			Q3205	48T25737Y01	TR,UMD2N-TR -CP
AUDIO-P.W.Board			Q3207	48-13000Z01	TR,LTC114EUBFS8-TLCP
AUDIO-P.W.Board			Q3208	48-17548Z01	TR,DSA500100L -CP
AUDIO-P.W.Board			R2001	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2005	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2006	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2007	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2008	06S65415Y30	RES,RK 272F 1/16 -CP
AUDIO-P.W.Board			R2009	06S65415Y30	RES,RK 272F 1/16 -CP
AUDIO-P.W.Board			R2010	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2011	06S65415Y29	RES,RK 222F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2012	06S65415Y29	RES,RK 222F 1/16 -CP
AUDIO-P.W.Board			R2014	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2015	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2016	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2017	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2019	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2023	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2024	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2025	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2026	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2027	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2028	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2030	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2031	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2032	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2033	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2034	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2036	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2039	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2040	06S65415Y41	RES,RK 223F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2042	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2043	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2044	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2045	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2046	06S65415Y29	RES,RK 222F 1/16 -CP
AUDIO-P.W.Board			R2047	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2048	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2060	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2061	06S15615Y49	RES,RK 102J 1/16 -CP
AUDIO-P.W.Board			R2062	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R2063	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2064	06S15615Y41	RES,RK 471J 1/16 -CP
AUDIO-P.W.Board			R2070	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2071	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2072	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2073	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2074	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2076	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2077	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2078	06S15615Y25	RES,RK 101J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2083	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2089	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2092	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2093	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2100	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2101	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2103	06S15615Y49	RES,RK 102J 1/16 -CP
AUDIO-P.W.Board			R2104	06S15615Y49	RES,RK 102J 1/16 -CP
AUDIO-P.W.Board			R2105	06S15615Y49	RES,RK 102J 1/16 -CP
AUDIO-P.W.Board			R2108	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2109	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2110	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2111	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2170	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2171	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2180	06S65415Y33	RES,RK 472F 1/16 -CP
AUDIO-P.W.Board			R2181	06S65415Y33	RES,RK 472F 1/16 -CP
AUDIO-P.W.Board			R2190	06S45674W81	RES,RK 103J 1/10 -CP
AUDIO-P.W.Board			R2191	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R2192	06S15615Y25	RES,RK 101J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2204	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2207	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2211	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2212	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2213	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2214	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2215	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2216	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2217	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2218	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2219	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2220	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2221	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2222	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2224	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2225	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2226	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2227	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2228	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2229	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2230	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2231	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2232	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2233	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2249	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2250	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2251	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2253	06S15615Y09	RES,RK 22RJ 1/16 -CP
AUDIO-P.W.Board			R2254	06S15615Y09	RES,RK 22RJ 1/16 -CP
AUDIO-P.W.Board			R2255	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2256	06S15615Y09	RES,RK 22RJ 1/16 -CP
AUDIO-P.W.Board			R2258	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2260	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2262	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2263	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2265	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2268	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2270	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2273	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2274	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2400	06S65415Y34	RES,RK 562F 1/16 -CP
AUDIO-P.W.Board			R2401	06-25919Z12	RES,RK 623F 1/16 -CP
AUDIO-P.W.Board			R2402	06S15615Y57	RES,RK 222J 1/16 -CP
AUDIO-P.W.Board			R2404	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2405	06S65415Y48	RES,RK 823F 1/16 -CP
AUDIO-P.W.Board			R2406	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2407	06S65415Y48	RES,RK 823F 1/16 -CP
AUDIO-P.W.Board			R2408	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2409	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2420	06S65415Y49	RES,RK 104F 1/16 -CP
AUDIO-P.W.Board			R2421	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2422	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2423	06S65415Y49	RES,RK 104F 1/16 -CP
AUDIO-P.W.Board			R2424	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2425	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2426	06S65415Y49	RES,RK 104F 1/16 -CP
AUDIO-P.W.Board			R2427	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2428	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2429	06S65415Y49	RES,RK 104F 1/16 -CP
AUDIO-P.W.Board			R2430	06S65415Y49	RES,RK 104F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2431	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2432	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2433	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2434	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2435	06S65415Y49	RES,RK 104F 1/16 -CP
AUDIO-P.W.Board			R2436	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2437	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R2460	06S15615Y94	RES,RK 753J 1/16 -CP
AUDIO-P.W.Board			R2461	06S15615Y94	RES,RK 753J 1/16 -CP
AUDIO-P.W.Board			R2462	06S15615Y94	RES,RK 753J 1/16 -CP
AUDIO-P.W.Board			R2463	06S15615Y94	RES,RK 753J 1/16 -CP
AUDIO-P.W.Board			R2464	06S15615Y94	RES,RK 753J 1/16 -CP
AUDIO-P.W.Board			R2465	06S15615Y94	RES,RK 753J 1/16 -CP
AUDIO-P.W.Board			R2466	06S70072F29	RES,CP .101-J-1/4-CP
AUDIO-P.W.Board			R2467	06S70072F29	RES,CP .101-J-1/4-CP
AUDIO-P.W.Board			R2468	06S70072F29	RES,CP .101-J-1/4-CP
AUDIO-P.W.Board			R2469	06S70072F29	RES,CP .101-J-1/4-CP
AUDIO-P.W.Board			R2470	06S70072F29	RES,CP .101-J-1/4-CP
AUDIO-P.W.Board			R2471	06S70072F29	RES,CP .101-J-1/4-CP
AUDIO-P.W.Board			R2472	06S70072F37	RES,CP .221-J-1/4-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2473	06S70072F37	RES,CP .221-J-1/4-CP
AUDIO-P.W.Board			R2474	06S70072F37	RES,CP .221-J-1/4-CP
AUDIO-P.W.Board			R2475	06S70072F37	RES,CP .221-J-1/4-CP
AUDIO-P.W.Board			R2476	06S70072F37	RES,CP .221-J-1/4-CP
AUDIO-P.W.Board			R2477	06S70072F37	RES,CP .221-J-1/4-CP
AUDIO-P.W.Board			R2501	06S15615Y41	RES,RK 471J 1/16 -CP
AUDIO-P.W.Board			R2502	06S15615Y41	RES,RK 471J 1/16 -CP
AUDIO-P.W.Board			R2503	06S15615Y41	RES,RK 471J 1/16 -CP
AUDIO-P.W.Board			R2504	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2505	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2507	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R2508	06S15615Y61	RES,RK 332J 1/16 -CP
AUDIO-P.W.Board			R2510	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2517	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2518	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2521	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2527	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2604	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R2605	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2650	06S15615Y25	RES,RK 101J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2651	06S15615Y49	RES,RK 102J 1/16 -CP
AUDIO-P.W.Board			R2652	06S15615Y47	RES,RK 821J 1/16 -CP
AUDIO-P.W.Board			R2653	06S15615Y89	RES,RK 473J 1/16 -CP
AUDIO-P.W.Board			R2654	06S45674W41	RES,RK 221J 1/10 -CP
AUDIO-P.W.Board			R2655	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2850	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2851	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2852	06S15615Y89	RES,RK 473J 1/16 -CP
AUDIO-P.W.Board			R2853	06S15615Y89	RES,RK 473J 1/16 -CP
AUDIO-P.W.Board			R2854	06S65415Y59	RES,RK 684F 1/16 -CP
AUDIO-P.W.Board			R2855	06S15616Y43	RES,RK 106J 1/16 -CP
AUDIO-P.W.Board			R2856	06S65415Y33	RES,RK 472F 1/16 -CP
AUDIO-P.W.Board			R2857	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2858	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2859	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R2860	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R2864	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R2866	06S65415Y29	RES,RK 222F 1/16 -CP
AUDIO-P.W.Board			R2902	06S15594Y14	RES,RK 474F 1/10 -CP
AUDIO-P.W.Board			R2903	06S15594Y14	RES,RK 474F 1/10 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R2904	06S65415Y11	RES,RK 68RF 1/16 -CP
AUDIO-P.W.Board			R2905	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R2906	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R2950	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R2963	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R2965	06S65415Y05	RES,RK 22RF 1/16 -CP
AUDIO-P.W.Board			R2966	06S65415Y10	RES,RK 56RF 1/16 -CP
AUDIO-P.W.Board			R2967	06S35083Y19	RES,RK 331F 1/4 -CP
AUDIO-P.W.Board			R3000	06S15616Y14	RES,RK 474J 1/16 -CP
AUDIO-P.W.Board			R3007	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R3008	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R3009	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R3010	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3011	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3012	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3014	06S15615Y19	RES,RK 56RJ 1/16 -CP
AUDIO-P.W.Board			R3015	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R3016	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R3019	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3023	06S65415Y37	RES,RK 103F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R3025	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R3100	06S45674W81	RES,RK 103J 1/10 -CP
AUDIO-P.W.Board			R3102	06S45674W81	RES,RK 103J 1/10 -CP
AUDIO-P.W.Board			R3103	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3104	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3130	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3131	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3132	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3133	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3134	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3135	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3140	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3141	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3142	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3143	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3144	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3145	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3146	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3147	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3148	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R3149	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3150	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R3151	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R3152	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R3153	06S70072F51	RES,CP .821-J-1/4-CP
AUDIO-P.W.Board			R3154	06S70072F53	RES,CP .102-J-1/4-CP
AUDIO-P.W.Board			R3155	06S70072F53	RES,CP .102-J-1/4-CP
AUDIO-P.W.Board			R3156	06S70072F98	RES,RK 223J 1/4 -CP
AUDIO-P.W.Board			R3158	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R3159	06S15615Y41	RES,RK 471J 1/16 -CP
AUDIO-P.W.Board			R3160	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3161	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3162	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3163	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3164	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3165	06S45674W33	RES,RK 101J 1/10 -CP
AUDIO-P.W.Board			R3200	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R3202	06S15616Y14	RES,RK 474J 1/16 -CP
AUDIO-P.W.Board			R3203	06S35083Y39	RES,RK 153F 1/4 -CP
AUDIO-P.W.Board			R3204	06S15593Y86	RES,RK 363F 1/10 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R3205	06S65415Y30	RES,RK 272F 1/16 -CP
AUDIO-P.W.Board			R3206	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R3207	06S35083Y43	RES,RK 333F 1/4 -CP
AUDIO-P.W.Board			R3208	06S35083Y40	RES,RK 183F 1/4 -CP
AUDIO-P.W.Board			R3209	06S70072F69	RES,CP .472-J-1/4-CP
AUDIO-P.W.Board			R3210	06S70072F69	RES,CP .472-J-1/4-CP
AUDIO-P.W.Board			R3211	06S15615Y89	RES,RK 473J 1/16 -CP
AUDIO-P.W.Board			R3213	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3217	06S15616Y23	RES,RK JUMPER1/16-CP
AUDIO-P.W.Board			R3218	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R3219	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R3234	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R3235	06S15593Y61	RES,RK 332F 1/10 -CP
AUDIO-P.W.Board			R3236	06S45674W65	RES,RK 222J 1/10 -CP
AUDIO-P.W.Board			R3237	06S15593Y81	RES,RK 223F 1/10 -CP
AUDIO-P.W.Board			R3239	06S15615Y33	RES,RK 221J 1/16 -CP
AUDIO-P.W.Board			R3246	06S65415Y29	RES,RK 222F 1/16 -CP
AUDIO-P.W.Board			R3249	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3250	06S65415Y50	RES,RK 124F 1/16 -CP
AUDIO-P.W.Board			R3251	06S65415Y29	RES,RK 222F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R3252	06S45674W57	RES,RK 102J 1/10 -CP
AUDIO-P.W.Board			R3254	06S65415Y50	RES,RK 124F 1/16 -CP
AUDIO-P.W.Board			R3400	06S15594Y01	RES,RK 134F 1/10 -CP
AUDIO-P.W.Board			R3401	06S15594Y08	RES,RK 274F 1/10 -CP
AUDIO-P.W.Board			R3402	06S15593Y91	RES,RK 563F 1/10 -CP
AUDIO-P.W.Board			R3403	06S15593Y93	RES,RK 683F 1/10 -CP
AUDIO-P.W.Board			R3404	06S15593Y67	RES,RK 562F 1/10 -CP
AUDIO-P.W.Board			R3405	06S15594Y17	RES,RK 624F 1/10 -CP
AUDIO-P.W.Board			R3406	06S15593Y93	RES,RK 683F 1/10 -CP
AUDIO-P.W.Board			R3407	06S70072F63	RES,CP .272-J-1/4-CP
AUDIO-P.W.Board			R3408	06S65415Y32	RES,RK 392F 1/16 -CP
AUDIO-P.W.Board			R3409	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R3410	06S70072F77	RES,CP .103-J-1/4-CP
AUDIO-P.W.Board			R3411	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R3412	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R3413	06S65415Y43	RES,RK 333F 1/16 -CP
AUDIO-P.W.Board			R3414	06S65415Y41	RES,RK 223F 1/16 -CP
AUDIO-P.W.Board			R3415	06S15593Y66	RES,RK 512F 1/10 -CP
AUDIO-P.W.Board			R3430	06S65415Y47	RES,RK 683F 1/16 -CP
AUDIO-P.W.Board			R3431	06S65415Y30	RES,RK 272F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R3432	06S65415Y35	RES,RK 682F 1/16 -CP
AUDIO-P.W.Board			R3433	06S15594Y19	RES,RK 754F 1/10 -CP
AUDIO-P.W.Board			R3440	06S15593Y99	RES,RK 124F 1/10 -CP
AUDIO-P.W.Board			R3442	06S65415Y38	RES,RK 123F 1/16 -CP
AUDIO-P.W.Board			R3443	06S65415Y30	RES,RK 272F 1/16 -CP
AUDIO-P.W.Board			R3444	06S65415Y33	RES,RK 472F 1/16 -CP
AUDIO-P.W.Board			R3445	06S15593Y66	RES,RK 512F 1/10 -CP
AUDIO-P.W.Board			R3461	06S65415Y29	RES,RK 222F 1/16 -CP
AUDIO-P.W.Board			R3462	06S65415Y18	RES,RK 271F 1/16 -CP
AUDIO-P.W.Board			R3463	06S65415Y33	RES,RK 472F 1/16 -CP
AUDIO-P.W.Board			R3464	06S15593Y67	RES,RK 562F 1/10 -CP
AUDIO-P.W.Board			R3465	06S15593Y91	RES,RK 563F 1/10 -CP
AUDIO-P.W.Board			R3471	06S65415Y29	RES,RK 222F 1/16 -CP
AUDIO-P.W.Board			R3472	06S65415Y21	RES,RK 471F 1/16 -CP
AUDIO-P.W.Board			R3473	06S65415Y33	RES,RK 472F 1/16 -CP
AUDIO-P.W.Board			R3474	06S15593Y71	RES,RK 822F 1/10 -CP
AUDIO-P.W.Board			R3475	06S15594Y19	RES,RK 754F 1/10 -CP
AUDIO-P.W.Board			R3480	06S15593Y67	RES,RK 562F 1/10 -CP
AUDIO-P.W.Board			R3482	06S65415Y38	RES,RK 123F 1/16 -CP
AUDIO-P.W.Board			R3483	06S65415Y30	RES,RK 272F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R3484	06S65415Y33	RES,RK 472F 1/16 -CP
AUDIO-P.W.Board			R3485	06S15593Y92	RES,RK 623F 1/10 -CP
AUDIO-P.W.Board			R3492	06S35083Y64	RES,RK 3R3F 1/4 -CP
AUDIO-P.W.Board			R3493	06S45675W43	RES,RK JUMPER1/10-CP
AUDIO-P.W.Board			R3510	06S65415Y37	RES,RK 103F 1/16 -CP
AUDIO-P.W.Board			R3511	06S15593Y66	RES,RK 512F 1/10 -CP
AUDIO-P.W.Board			R3512	06S15594Y01	RES,RK 134F 1/10 -CP
AUDIO-P.W.Board			R3601	06S65415Y38	RES,RK 123F 1/16 -CP
AUDIO-P.W.Board			R3603	06S65415Y31	RES,RK 332F 1/16 -CP
AUDIO-P.W.Board			R3604	06S65415Y42	RES,RK 273F 1/16 -CP
AUDIO-P.W.Board			R3606	06S65415Y27	RES,RK 152F 1/16 -CP
AUDIO-P.W.Board			R3609	06S15615Y69	RES,RK 682J 1/16 -CP
AUDIO-P.W.Board			R3610	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R3611	06S65415Y38	RES,RK 123F 1/16 -CP
AUDIO-P.W.Board			R3613	06S65415Y31	RES,RK 332F 1/16 -CP
AUDIO-P.W.Board			R3614	06S65415Y42	RES,RK 273F 1/16 -CP
AUDIO-P.W.Board			R3616	06S65415Y29	RES,RK 222F 1/16 -CP
AUDIO-P.W.Board			R3619	06S15615Y79	RES,RK 183J 1/16 -CP
AUDIO-P.W.Board			R3620	06S15615Y25	RES,RK 101J 1/16 -CP
AUDIO-P.W.Board			R3630	06S70072F31	RES,CP .121-J-1/4-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			R3631	06S45674W45	RES,RK 331J 1/10 -CP
AUDIO-P.W.Board			SA2901	08-19391Z01	VST,IMSA-6803-01Y-CP
AUDIO-P.W.Board			SD2440	48-22179Z01	DIO,SHT DB3X313F0LCP
AUDIO-P.W.Board			SD2441	48T35138Y01	DIO,SHT RB160L-40-E1
AUDIO-P.W.Board			SD3601	48-19296Z01	DIO,SHT RB056L-40-E1
AUDIO-P.W.Board			SD3602	48-19296Z01	DIO,SHT RB056L-40-E1
AUDIO-P.W.Board			T3100	25-12466Z01	CHOKE,GLI-UB3442 -DB
AUDIO-P.W.Board			TH2000	48T75219Y02	TMT,NCP18WB473F1S-CP
AUDIO-P.W.Board			VT2901	24-29820Z01	COIL,RF FM M5-N/R-E5
AUDIO-P.W.Board			XL2000	91-16024Z01	XTL,AT-41CD2 3.98-E9
AUDIO-P.W.Board			XL2200	91-26661Z31	XTL,NX3225SAAG55.4CP
AUDIO-P.W.Board			XL2501	91-26661Z02	XTL,NX3225SAAG12.2CP
AUDIO-P.W.Board			XL2850	91-26198Z03	XTL,NX3215 32.7NS-E1
AUDIO-P.W.Board			XL3001	91-26661Z31	XTL,NX3225SAAG55.4CP
AUDIO-P.W.Board			ZD3100	48-23921Z01	DIO,ZEN ZSH5MAZ27-ED
AUDIO-P.W.Board			ZD3130	48-21149Z23	DIO,ZEN DZ2J056M0LCP
AUDIO-P.W.Board			ZD3150	48-21149Z23	DIO,ZEN DZ2J056M0LCP
AUDIO-P.W.Board			ZD3151	48-21149Z23	DIO,ZEN DZ2J056M0LCP
AUDIO-P.W.Board			ZD3152	48-21149Z23	DIO,ZEN DZ2J056M0LCP
AUDIO-P.W.Board			ZD3200	48-16145Z36	DIO,ZEN PZU9.1B1 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
AUDIO-P.W.Board			ZD3201	48-21149Z23	DIO,ZEN DZ2J056M0LCP
AUDIO-P.W.Board			ZD3202	48-01607Z08	DIO,ZEN LUDZ3.9B -CP
I.MX-P.W.Board			ANT5501	09-07494Z01	U.FL-R-SMT-1(80)-E2
I.MX-P.W.Board			C4000	08S45231Y05	CAP,CER 2R0C-CK1H-CP
I.MX-P.W.Board			C4001	08S45231Y05	CAP,CER 2R0C-CK1H-CP
I.MX-P.W.Board			C4002	08S45231Y10	CAP,CER 7R0D-CH1H-CP
I.MX-P.W.Board			C4003	08S45231Y10	CAP,CER 7R0D-CH1H-CP
I.MX-P.W.Board			C4007	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4008	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4009	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4010	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4014	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4015	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4016	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4017	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4018	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4024	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4025	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4026	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4027	08-12461Z01	CAP,CER 104M-C80J-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C4028	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4029	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C4030	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4031	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4032	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C4033	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4034	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4035	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4036	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4037	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4038	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4039	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4040	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4041	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C4042	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4043	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4044	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4045	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4046	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4047	08S45232Y17	CAP,CER 104K-B0J -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C4048	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4049	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C4050	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4051	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C4052	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4053	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C4054	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4055	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4056	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4057	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4058	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4061	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C4063	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4064	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4065	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4066	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4067	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C4068	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4069	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4070	08-12461Z01	CAP,CER 104M-C80J-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C4071	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4072	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4073	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4074	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4075	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4076	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C4077	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4078	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4079	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C4080	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4081	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C4082	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C4083	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C4200	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4201	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4202	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4203	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4204	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4205	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4206	08-12461Z01	CAP,CER 104M-C80J-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C4207	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4208	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4209	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4210	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4211	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4212	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4213	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4214	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4215	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4216	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4217	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4218	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4219	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4220	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4221	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4222	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4223	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4224	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4225	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4226	08-12461Z01	CAP,CER 104M-C80J-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C4227	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4228	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4229	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4230	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4231	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4232	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4233	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4234	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4235	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4236	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4237	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4238	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4239	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4240	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4241	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4242	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4243	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4244	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4245	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4246	08S45232Y05	CAP,CER 102K-B1H -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C4247	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4248	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4249	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4250	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4251	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4252	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4253	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4254	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4255	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4256	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4257	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4258	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4259	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4260	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4261	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4262	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4263	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4264	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4265	08-12461Z01	CAP,CER 104M-C80J-CP
I.MX-P.W.Board			C4266	08S45232Y05	CAP,CER 102K-B1H -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C4267	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C4268	08-13830Z01	CAP,CER 476MX6S0G-CP
I.MX-P.W.Board			C4269	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4270	08-13830Z01	CAP,CER 476MX6S0G-CP
I.MX-P.W.Board			C4271	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4300	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C4301	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4302	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4400	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4401	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4402	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4403	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4404	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C4500	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4600	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C4601	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4602	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C4603	08S65668Y07	CAP,CER 103KX5R1H-CP
I.MX-P.W.Board			C4700	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5000	08S35374W12	CAP,CER 106K-B0J -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			C5001	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5002	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5003	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5004	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5005	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5006	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5007	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5008	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5009	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5010	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5011	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5012	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5100	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5101	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5102	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5103	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5104	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5105	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5106	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5107	08S45232Y17	CAP,CER 104K-B0J -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C5108	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5109	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5110	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5111	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5112	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5113	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5114	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5115	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C5200	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5201	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5202	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5203	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5204	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5205	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5206	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5207	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5208	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5209	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5210	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5211	08S45232Y11	CAP,CER 103K-B1C -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C5212	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5213	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5214	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5215	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5216	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5217	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5218	08S35374W10	CAP,CER 225K-B1A -CP
I.MX-P.W.Board			C5219	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5220	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5221	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5222	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5223	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5224	08-26091Z01	CAP,CER 102KX7R2J-CP
I.MX-P.W.Board			C5225	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C5226	08-26091Z01	CAP,CER 102KX7R2J-CP
I.MX-P.W.Board			C5227	08S45231Y15	CAP,CER 15RJ-CH1H-CP
I.MX-P.W.Board			C5228	08S45231Y15	CAP,CER 15RJ-CH1H-CP
I.MX-P.W.Board			C5300	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5301	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5302	08S45232Y17	CAP,CER 104K-B0J -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C5303	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5304	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5305	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5306	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5307	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5308	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C5309	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5310	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C5311	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5312	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5313	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5314	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5315	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5316	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5317	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5318	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5319	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5320	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5321	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5322	08S45232Y17	CAP,CER 104K-B0J -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C5323	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5324	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5325	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5326	08S45231Y09	CAP,CER 6R0D-CH1H-CP
I.MX-P.W.Board			C5327	08S45231Y09	CAP,CER 6R0D-CH1H-CP
I.MX-P.W.Board			C5400	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5401	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5402	08S35349Y17	CAP,CER 225K-B0J -CP
I.MX-P.W.Board			C5403	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5404	08S35349Y17	CAP,CER 225K-B0J -CP
I.MX-P.W.Board			C5405	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5406	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5407	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5408	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5409	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5410	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5411	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5412	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5413	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5500	08S65668Y05	CAP,CER 224KX5R1A-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			C5501	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5502	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5503	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5504	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5505	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5506	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5509	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5510	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5511	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5512	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5513	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5514	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5515	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5516	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5517	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5518	08S35349Y12	CAP,CER 105K-B0J -CP
I.MX-P.W.Board			C5519	08S35374W12	CAP,CER 106K-B0J -CP
I.MX-P.W.Board			C5600	08S45232Y17	CAP,CER 104K-B0J -CP
I.MX-P.W.Board			C5601	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5602	08S65670Y06	CAP,CER 226KX5R1A-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			C5603	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5604	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5605	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5606	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5607	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C5608	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5609	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5610	08S45676W93	CAP,CER 224K-B1A -CP
I.MX-P.W.Board			C5611	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C5612	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5613	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5614	08S45676W93	CAP,CER 224K-B1A -CP
I.MX-P.W.Board			C5615	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C5616	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5617	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5618	08S45676W93	CAP,CER 224K-B1A -CP
I.MX-P.W.Board			C5619	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C5620	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5621	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5622	08S45676W93	CAP,CER 224K-B1A -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C5623	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5624	08S45676W93	CAP,CER 224K-B1A -CP
I.MX-P.W.Board			C5625	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5626	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5627	08S45676W93	CAP,CER 224K-B1A -CP
I.MX-P.W.Board			C5628	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5629	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5630	08S45676W93	CAP,CER 224K-B1A -CP
I.MX-P.W.Board			C5631	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5632	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5633	08S45676W93	CAP,CER 224K-B1A -CP
I.MX-P.W.Board			C5650	08S65671Y04	CAP,CER 106KX5R1H-CP
I.MX-P.W.Board			C5651	08S45232Y08	CAP,CER 332K-B1H -CP
I.MX-P.W.Board			C5652	08S45231Y33	CAP,CER 471J-CH1H-CP
I.MX-P.W.Board			C5653	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C5655	08-14627Z01	CAP,CER 107MX5R0J-CP
I.MX-P.W.Board			C5657	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C5659	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C5680	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C5700	08S45231Y05	CAP,CER 2R0C-CK1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C5701	08S45231Y05	CAP,CER 2R0C-CK1H-CP
I.MX-P.W.Board			C5702	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5703	08S65671Y04	CAP,CER 106KX5R1H-CP
I.MX-P.W.Board			C5704	08S65671Y04	CAP,CER 106KX5R1H-CP
I.MX-P.W.Board			C5705	08S65676Y09	CAP,CER 475KX7R1H-CP
I.MX-P.W.Board			C5706	08S35349Y21	CAP,CER 104K-B1H -CP
I.MX-P.W.Board			C5707	08S65670Y06	CAP,CER 226KX5R1A-CP
I.MX-P.W.Board			C5708	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C5709	08S65676Y09	CAP,CER 475KX7R1H-CP
I.MX-P.W.Board			C5710	08S35349Y16	CAP,CER 105K-B1A -CP
I.MX-P.W.Board			C5711	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C5712	08S45231Y13	CAP,CER 10RD-CH1H-CP
I.MX-P.W.Board			C5713	08S45232Y05	CAP,CER 102K-B1H -CP
I.MX-P.W.Board			C5714	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C5715	08S45231Y11	CAP,CER 8R0D-CH1H-CP
I.MX-P.W.Board			C5716	08S45231Y11	CAP,CER 8R0D-CH1H-CP
I.MX-P.W.Board			C5800	08S65676Y09	CAP,CER 475KX7R1H-CP
I.MX-P.W.Board			C5801	08S35374W10	CAP,CER 225K-B1A -CP
I.MX-P.W.Board			C5802	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C5803	08S45676W73	CAP,CER.103K-B1H -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C5804	08S45232Y11	CAP,CER 103K-B1C -CP
I.MX-P.W.Board			C5806	08S35374W11	CAP,CER 475K-B0J -CP
I.MX-P.W.Board			C5807	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C5808	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6000	08S65676Y10	CAP,CER 106KX7R1C-CP
I.MX-P.W.Board			C6001	08S45232Y08	CAP,CER 332K-B1H -CP
I.MX-P.W.Board			C6002	08S45232Y08	CAP,CER 332K-B1H -CP
I.MX-P.W.Board			C6003	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C6005	08-14627Z01	CAP,CER 107MX5R0J-CP
I.MX-P.W.Board			C6006	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6007	08-15113Z03	CAP,CER 475KX7R1C-CP
I.MX-P.W.Board			C6008	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6009	08S35374W10	CAP,CER 225K-B1A -CP
I.MX-P.W.Board			C6010	08-15113Z03	CAP,CER 475KX7R1C-CP
I.MX-P.W.Board			C6011	08S35374W10	CAP,CER 225K-B1A -CP
I.MX-P.W.Board			C6012	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6013	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6014	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6015	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6300	08S65668Y07	CAP,CER 103KX5R1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C6301	08S65668Y07	CAP,CER 103KX5R1H-CP
I.MX-P.W.Board			C6302	08S65668Y07	CAP,CER 103KX5R1H-CP
I.MX-P.W.Board			C6310	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6311	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6312	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6313	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6314	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6315	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6320	08S45231Y38	CAP,CER 102J-CH1H-CP
I.MX-P.W.Board			C6400	08S45676W83	CAP,CER 473K-B1C -CP
I.MX-P.W.Board			C6401	08S65670Y04	CAP,CER 475KX5R1E-CP
I.MX-P.W.Board			C6402	08S65670Y04	CAP,CER 475KX5R1E-CP
I.MX-P.W.Board			C6403	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6404	08S45676W83	CAP,CER 473K-B1C -CP
I.MX-P.W.Board			C6405	08S65670Y04	CAP,CER 475KX5R1E-CP
I.MX-P.W.Board			C6406	08S65670Y04	CAP,CER 475KX5R1E-CP
I.MX-P.W.Board			C6407	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6408	08S65669Y03	CAP,CER 224KX7R1H-CP
I.MX-P.W.Board			C6409	08S45231Y31	CAP,CER 331J-CH1H-CP
I.MX-P.W.Board			C6410	08S45231Y31	CAP,CER 331J-CH1H-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C6411	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C6412	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6413	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6414	08S65676Y08	CAP,CER 106K-X7R1ACP
I.MX-P.W.Board			C6415	08S65676Y08	CAP,CER 106K-X7R1ACP
I.MX-P.W.Board			C6416	08S45676W73	CAP,CER.103K-B1H -CP
I.MX-P.W.Board			C6417	08S65676Y08	CAP,CER 106K-X7R1ACP
I.MX-P.W.Board			C6418	08S45231Y31	CAP,CER 331J-CH1H-CP
I.MX-P.W.Board			C6419	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C6420	08S65676Y08	CAP,CER 106K-X7R1ACP
I.MX-P.W.Board			C6421	08S65676Y08	CAP,CER 106K-X7R1ACP
I.MX-P.W.Board			C6422	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C6423	08-26091Z01	CAP,CER 102KX7R2J-CP
I.MX-P.W.Board			C6424	08S65669Y05	CAP,CER 106KX7R0J-CP
I.MX-P.W.Board			C6425	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6426	08S65668Y05	CAP,CER 224KX5R1A-CP
I.MX-P.W.Board			C6427	08S45231Y17	CAP,CER 22RJ-CH1H-CP
I.MX-P.W.Board			C6428	08S35350Y03	CAP,CER 224K-B1C -CP
I.MX-P.W.Board			C6429	08S45231Y17	CAP,CER 22RJ-CH1H-CP
I.MX-P.W.Board			C6430	08S65669Y05	CAP,CER 106KX7R0J-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			C6431	08S65676Y08	CAP,CER 106K-X7R1ACP
I.MX-P.W.Board			C6432	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			C6433	08S45231Y25	CAP,CER 101J-CH1H-CP
I.MX-P.W.Board			CB4001	09-14451Z06	FFC,502790-3091 -ED
I.MX-P.W.Board			CB5100	09-25213Z01	WTB,TCX3400-011187-T
I.MX-P.W.Board			CB5200	09-25213Z01	WTB,TCX3400-011187-T
I.MX-P.W.Board			CB6100	09-19907Z03	BTB,IMSA9984B-100YEZ
I.MX-P.W.Board			CB6300	09-29652Z01	BTB,FX23-100P-0.5S-T
I.MX-P.W.Board			CB6400	09-25106Z05	WTB,S18B-PUDSS-1 -DB
I.MX-P.W.Board			D5101	48-08988Z01	VST,EZIZ0V800AA -CP
I.MX-P.W.Board			D5102	48-08988Z01	VST,EZIZ0V800AA -CP
I.MX-P.W.Board			D5104	48-08988Z01	VST,EZIZ0V800AA -CP
I.MX-P.W.Board			D5204	48-05164Z01	DIO,1SS352-TPH3 -CP
I.MX-P.W.Board			D5701	48-08988Z01	VST,EZIZ0V800AA -CP
I.MX-P.W.Board			D5702	48-08988Z01	VST,EZIZ0V800AA -CP
I.MX-P.W.Board			D6400	48-19711Z01	DIO,BAV99W -CP
I.MX-P.W.Board			D6401	48T75527Y01	DIO,1SR154-400 -E1
I.MX-P.W.Board			E4000	23-22657Z06	CAP,CX 221-0G -E2
I.MX-P.W.Board			E4001	23-22657Z06	CAP,CX 221-0G -E2
I.MX-P.W.Board			E5700	23S75244Y19	CAP,ELY 101-1C -E6

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			E5701	23-31100Z19	CAP,MAK 33R-1E -E6
I.MX-P.W.Board			E6310	23-31100Z19	CAP,MAK 33R-1E -E6
I.MX-P.W.Board			F6200	65-10745Z09	FUSE,TF16AT 2.00A-CP
I.MX-P.W.Board			IC4000	51-29541Z01	MCIMX6D6AVT08AD -BT
I.MX-P.W.Board			IC4200	51-27163Z02	H5TQ4G63CFR-RDC -BT
I.MX-P.W.Board			IC4201	51-27163Z02	H5TQ4G63CFR-RDC -BT
I.MX-P.W.Board			IC4202	51-27163Z02	H5TQ4G63CFR-RDC -BT
I.MX-P.W.Board			IC4203	51-27163Z02	H5TQ4G63CFR-RDC -BT
I.MX-P.W.Board			IC4300	83-31628Z12	V0.960_LIMOGM_nor
I.MX-P.W.Board			IC4300	51-27465Z01	S29GL256S90TFI010-ST
I.MX-P.W.Board			IC4400	83-31628Z21	V0.960_LIMOGM_eMMC
I.MX-P.W.Board			IC4400	51-29432Z01	H26M41103HPR -BT
I.MX-P.W.Board			IC4500	51-26850Z01	MFI337S3959 -CP
I.MX-P.W.Board			IC4600	51T15185Y03	TC7SH08FU,LJ -CP
I.MX-P.W.Board			IC4601	51T65003Y03	TC7SZ05FU,LJ -CP
I.MX-P.W.Board			IC4602	51T65003Y03	TC7SZ05FU,LJ -CP
I.MX-P.W.Board			IC4700	51T35220Y01	TC7WH126FU-TE12L-SE1
I.MX-P.W.Board			IC5000	51-19098Z01	BU16002KVT-E2 -QEA
I.MX-P.W.Board			IC5100	51-27798Z01	ADV7511WBSWZ-RL -QEA
I.MX-P.W.Board			IC5200	51-29819Z01	ADV7480WBBCZ -BT

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			IC5300	51-29818Z01	ML86V8201 -QT
I.MX-P.W.Board			IC5400	51-29313Z01	DS90UH927QSQ -LE6
I.MX-P.W.Board			IC5500	51-29718Z01	UGKZ4D6009A -NE9
I.MX-P.W.Board			IC5501	51-13971Z01	TC74VCX08FT-EL -SE5
I.MX-P.W.Board			IC5502	51-15608Z01	TC7WPN3125FK-TE85LCP
I.MX-P.W.Board			IC5503	51-15608Z01	TC7WPN3125FK-TE85LCP
I.MX-P.W.Board			IC5504	51-15608Z01	TC7WPN3125FK-TE85LCP
I.MX-P.W.Board			IC5600	51-29896Z01	LTC3676HUI#TRA1 -LE6
I.MX-P.W.Board			IC5650	51-28779Z02	BD90640EFJ-CE2 -SE2
I.MX-P.W.Board			IC5700	51-28538Z02	MAX16984RATI/V+ -LE2
I.MX-P.W.Board			IC5701	51-21632Z01	BD11600NUX-E2 -CE1
I.MX-P.W.Board			IC5800	51-28614Z01	BD00FC0EEFJ-ME2 -SE2
I.MX-P.W.Board			IC5801	51-28341Z01	S-1323B52-N4BB30 -CP
I.MX-P.W.Board			IC6000	51-28779Z01	BD90620EFJ-CE2 -SE2
I.MX-P.W.Board			IC6001	51-23593Z02	BD00IC0WEFJ-ME2 -SE2
I.MX-P.W.Board			IC6002	51-23593Z05	BD00IA5EEFJ-ME2 -SE2
I.MX-P.W.Board			IC6400	51-12745Z01	BH7073G-TR -CP
I.MX-P.W.Board			IC6401	51-12745Z01	BH7073G-TR -CP
I.MX-P.W.Board			IC6402	51T15192Y02	TC74VHC14FT,K-EL-SE5
I.MX-P.W.Board			IC6403	51T25183Y04	TC7SET08FU,LJ -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			IC6404	51T15185Y03	TC7SH08FU,LJ -CP
I.MX-P.W.Board			IC6405	51-31236Z01	ML22331 -ST
I.MX-P.W.Board			L5100	24-22766Z02	IND,LBC3225 10RM -CP
I.MX-P.W.Board			L5101	24-22766Z02	IND,LBC3225 10RM -CP
I.MX-P.W.Board			L5102	24-22766Z02	IND,LBC3225 10RM -CP
I.MX-P.W.Board			L5103	24-22766Z02	IND,LBC3225 10RM -CP
I.MX-P.W.Board			L5400	24T95456W27	FBI,BLM18PG181SH1-CP
I.MX-P.W.Board			L5502	24-22766Z01	IND,LBC3225 2R2M -CP
I.MX-P.W.Board			L5503	24-22766Z03	IND,LBC3225 1R0M -CP
I.MX-P.W.Board			L5504	24T25164Y09	IND,FSLM2520 R47J-CP
I.MX-P.W.Board			L5600	24-22372Z05	IND,NRS6045T 2R3N-E2
I.MX-P.W.Board			L5601	24-22372Z05	IND,NRS6045T 2R3N-E2
I.MX-P.W.Board			L5602	24-22372Z05	IND,NRS6045T 2R3N-E2
I.MX-P.W.Board			L5603	24-22372Z05	IND,NRS6045T 2R3N-E2
I.MX-P.W.Board			L5650	24-22372Z05	IND,NRS6045T 2R3N-E2
I.MX-P.W.Board			L5651	24-08610Z03	IND,DS106C2 10RM -EA
I.MX-P.W.Board			L5700	24-23871Z01	IND,NRS8040T 10RM-E6
I.MX-P.W.Board			L5701	24T95458W06	FBI,BLM31PG121SH1-CP
I.MX-P.W.Board			L5704	24T75143Y17	IND,HK1005 R022J -CP
I.MX-P.W.Board			L5705	24T75143Y17	IND,HK1005 R022J -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			L6000	24-13301Z07	IND,DS75LC 10RM -E6
I.MX-P.W.Board			L6030	24-22766Z03	IND,LBC3225 1R0M -CP
I.MX-P.W.Board			L6400	24T65067Y02	FBI,MMZ1005S601AT-CP
I.MX-P.W.Board			L6401	24T65067Y02	FBI,MMZ1005S601AT-CP
I.MX-P.W.Board			PS6400	48-27319Z01	POLY,SW1812L150/24E2
I.MX-P.W.Board			Q4000	48-17548Z01	TR,DSA500100L -CP
I.MX-P.W.Board			Q4001	48-13000Z05	TR,LTC124EUBFS8-TLCP
I.MX-P.W.Board			Q5200	48T25737Y02	TR,UMD3N-TR -CP
I.MX-P.W.Board			Q5800	48T25737Y02	TR,UMD3N-TR -CP
I.MX-P.W.Board			Q6400	48T63417F03	TR,C2412K-BR-96 -CP
I.MX-P.W.Board			R4000	06S15616Y36	RES,RK 225J 1/16 -CP
I.MX-P.W.Board			R4001	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4003	06S15616Y22	RES,RK 105J 1/16 -CP
I.MX-P.W.Board			R4005	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R4006	06S15615Y49	RES,RK 102J 1/16 -CP
I.MX-P.W.Board			R4007	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R4008	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R4009	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R4010	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R4011	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			R4012	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4013	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4014	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4015	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4016	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4017	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R4018	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R4020	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4021	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4022	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4023	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4024	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4025	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4026	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4027	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4028	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4029	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4030	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4031	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4033	06S15615Y09	RES,RK 22RJ 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R4034	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4035	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4036	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4037	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4038	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4044	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4045	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4046	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4047	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4048	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4049	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4050	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R4051	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R4052	06S15615Y21	RES,RK 68RJ 1/16 -CP
I.MX-P.W.Board			R4053	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4054	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4055	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4056	06S65415Y85	RES,RK 241F 1/16 -CP
I.MX-P.W.Board			R4058	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4059	06-02713Z04	RES,RK 102D 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R4060	06-02713Z04	RES,RK 102D 1/16 -CP
I.MX-P.W.Board			R4061	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4062	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4064	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R4068	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4069	06-25919Z07	RES,RK 243F 1/16 -CP
I.MX-P.W.Board			R4070	06S65415Y55	RES,RK 334F 1/16 -CP
I.MX-P.W.Board			R4071	06S65415Y34	RES,RK 562F 1/16 -CP
I.MX-P.W.Board			R4073	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R4074	06S65415Y63	RES,RK 6041F 1/16-CP
I.MX-P.W.Board			R4076	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4077	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4079	06S65415Y48	RES,RK 823F 1/16 -CP
I.MX-P.W.Board			R4080	06S65415Y99	RES,RK 512F 1/16 -CP
I.MX-P.W.Board			R4200	06S65415Y84	RES,RK 201F 1/16 -CP
I.MX-P.W.Board			R4201	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4202	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4203	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4204	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4205	06S65415Y85	RES,RK 241F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R4206	06S65415Y84	RES,RK 201F 1/16 -CP
I.MX-P.W.Board			R4207	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4208	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4209	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4210	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4211	06S65415Y85	RES,RK 241F 1/16 -CP
I.MX-P.W.Board			R4212	06S65415Y84	RES,RK 201F 1/16 -CP
I.MX-P.W.Board			R4213	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4214	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4215	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4216	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4217	06S65415Y85	RES,RK 241F 1/16 -CP
I.MX-P.W.Board			R4218	06S65415Y84	RES,RK 201F 1/16 -CP
I.MX-P.W.Board			R4219	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4220	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4221	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4222	06S65415Y25	RES,RK 102F 1/16 -CP
I.MX-P.W.Board			R4223	06S65415Y85	RES,RK 241F 1/16 -CP
I.MX-P.W.Board			R4300	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4303	06S15615Y73	RES,RK 103J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R4304	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4305	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4306	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4307	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4308	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4309	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4310	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4311	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4312	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4314	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4315	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4316	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4317	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4318	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4319	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4320	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4321	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4322	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4323	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4324	06S15615Y73	RES,RK 103J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			R4325	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4326	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4327	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4328	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4332	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4333	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4334	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4336	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4337	06S45674W81	RES,RK 103J 1/10 -CP
I.MX-P.W.Board			R4338	06S45674W81	RES,RK 103J 1/10 -CP
I.MX-P.W.Board			R4339	06S45674W81	RES,RK 103J 1/10 -CP
I.MX-P.W.Board			R4400	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4401	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4402	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4403	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4404	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4405	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4406	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4407	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4408	06S15615Y25	RES,RK 101J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R4409	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4410	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4411	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R4500	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R4501	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4601	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R4602	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4603	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4604	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R4700	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R4701	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5000	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5001	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5002	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5003	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5004	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5005	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5006	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5007	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5008	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5009	06S15615Y21	RES,RK 68RJ 1/16 -CP
I.MX-P.W.Board			R5100	06S15615Y81	RES,RK 223J 1/16 -CP
I.MX-P.W.Board			R5101	06S15615Y81	RES,RK 223J 1/16 -CP
I.MX-P.W.Board			R5102	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5103	06S15615Y81	RES,RK 223J 1/16 -CP
I.MX-P.W.Board			R5104	06S65415Y87	RES,RK 431F 1/16 -CP
I.MX-P.W.Board			R5105	06S65415Y87	RES,RK 431F 1/16 -CP
I.MX-P.W.Board			R5106	06S65415Y06	RES,RK 27RF 1/16 -CP
I.MX-P.W.Board			R5107	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5108	06S70072F59	RES,CP .182-J-1/4-CP
I.MX-P.W.Board			R5109	06S70072F59	RES,CP .182-J-1/4-CP
I.MX-P.W.Board			R5110	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5111	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5112	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R5115	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5116	06S70072F29	RES,CP .101-J-1/4-CP
I.MX-P.W.Board			R5117	06S70072F29	RES,CP .101-J-1/4-CP
I.MX-P.W.Board			R5119	06S70072F77	RES,CP .103-J-1/4-CP
I.MX-P.W.Board			R5120	06S70072F29	RES,CP .101-J-1/4-CP
I.MX-P.W.Board			R5122	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5200	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5201	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5202	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5203	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5204	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5205	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5206	06S70072F53	RES,CP .102-J-1/4-CP
I.MX-P.W.Board			R5207	06S70072F29	RES,CP .101-J-1/4-CP
I.MX-P.W.Board			R5208	06S70072F29	RES,CP .101-J-1/4-CP
I.MX-P.W.Board			R5209	06S70072F29	RES,CP .101-J-1/4-CP
I.MX-P.W.Board			R5210	06S15615Y89	RES,RK 473J 1/16 -CP
I.MX-P.W.Board			R5212	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5213	06S65415Y41	RES,RK 223F 1/16 -CP
I.MX-P.W.Board			R5214	06S15615Y83	RES,RK 273J 1/16 -CP
I.MX-P.W.Board			R5216	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5217	06S15615Y97	RES,RK 104J 1/16 -CP
I.MX-P.W.Board			R5218	06S15615Y89	RES,RK 473J 1/16 -CP
I.MX-P.W.Board			R5219	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5220	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5221	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5222	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5223	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5224	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5225	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5226	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5227	06S65415Y33	RES,RK 472F 1/16 -CP
I.MX-P.W.Board			R5228	06S65415Y33	RES,RK 472F 1/16 -CP
I.MX-P.W.Board			R5230	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5232	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5233	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5234	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5235	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5236	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5300	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5301	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5302	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5303	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5304	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5305	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5306	06S15615Y25	RES,RK 101J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5308	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5309	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5312	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5313	06S15616Y22	RES,RK 105J 1/16 -CP
I.MX-P.W.Board			R5314	06S15615Y53	RES,RK 152J 1/16 -CP
I.MX-P.W.Board			R5315	06S15615Y13	RES,RK 33RJ 1/16 -CP
I.MX-P.W.Board			R5401	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5402	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5403	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5404	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5405	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5406	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5407	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5408	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5411	06S15615Y65	RES,RK 472J 1/16 -CP
I.MX-P.W.Board			R5413	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5416	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5418	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5500	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5501	06S15615Y09	RES,RK 22RJ 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			R5502	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5503	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5504	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5505	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5506	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5507	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5508	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5509	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5510	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5511	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5512	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5513	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5514	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5520	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5521	06S45675W43	RES,RK JUMPER1/10-CP
I.MX-P.W.Board			R5522	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5523	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5524	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5525	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R5526	06S15615Y09	RES,RK 22RJ 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			R5527	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5528	06S15615Y65	RES,RK 472J 1/16 -CP
I.MX-P.W.Board			R5600	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5601	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5602	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5603	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5604	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5605	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5606	06S65415Y29	RES,RK 222F 1/16 -CP
I.MX-P.W.Board			R5607	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5608	06S65415Y33	RES,RK 472F 1/16 -CP
I.MX-P.W.Board			R5609	06S65415Y99	RES,RK 512F 1/16 -CP
I.MX-P.W.Board			R5610	06-25919Z17	RES,RK 164F 1/16 -CP
I.MX-P.W.Board			R5611	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5612	06S65415Y37	RES,RK 103F 1/16 -CP
I.MX-P.W.Board			R5613	06S65415Y41	RES,RK 223F 1/16 -CP
I.MX-P.W.Board			R5614	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5615	06S65415Y52	RES,RK 184F 1/16 -CP
I.MX-P.W.Board			R5616	06S65415Y34	RES,RK 562F 1/16 -CP
I.MX-P.W.Board			R5617	06S65415Y47	RES,RK 683F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5618	06S65415Y29	RES,RK 222F 1/16 -CP
I.MX-P.W.Board			R5619	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5620	06S65415Y33	RES,RK 472F 1/16 -CP
I.MX-P.W.Board			R5621	06-25919Z22	RES,RK 434F 1/16 -CP
I.MX-P.W.Board			R5622	06-25919Z13	RES,RK 753F 1/16 -CP
I.MX-P.W.Board			R5623	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5624	06S65415Y33	RES,RK 472F 1/16 -CP
I.MX-P.W.Board			R5625	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5627	06-25919Z17	RES,RK 164F 1/16 -CP
I.MX-P.W.Board			R5628	06S65415Y99	RES,RK 512F 1/16 -CP
I.MX-P.W.Board			R5629	06S65415Y41	RES,RK 223F 1/16 -CP
I.MX-P.W.Board			R5630	06S65415Y37	RES,RK 103F 1/16 -CP
I.MX-P.W.Board			R5631	06S65415Y37	RES,RK 103F 1/16 -CP
I.MX-P.W.Board			R5632	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5633	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5634	06S65415Y30	RES,RK 272F 1/16 -CP
I.MX-P.W.Board			R5635	06S65415Y41	RES,RK 223F 1/16 -CP
I.MX-P.W.Board			R5636	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5637	06-25919Z12	RES,RK 623F 1/16 -CP
I.MX-P.W.Board			R5638	06S65415Y66	RES,RK 622F 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5639	06S65415Y47	RES,RK 683F 1/16 -CP
I.MX-P.W.Board			R5640	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5641	06S65415Y35	RES,RK 682F 1/16 -CP
I.MX-P.W.Board			R5642	06S65415Y44	RES,RK 393F 1/16 -CP
I.MX-P.W.Board			R5643	06-25919Z18	RES,RK 204F 1/16 -CP
I.MX-P.W.Board			R5644	06-25919Z13	RES,RK 753F 1/16 -CP
I.MX-P.W.Board			R5645	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5646	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5647	06S15615Y41	RES,RK 471J 1/16 -CP
I.MX-P.W.Board			R5648	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5650	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R5651	06S15615Y67	RES,RK 562J 1/16 -CP
I.MX-P.W.Board			R5652	06S65415Y31	RES,RK 332F 1/16 -CP
I.MX-P.W.Board			R5653	06S65415Y26	RES,RK 122F 1/16 -CP
I.MX-P.W.Board			R5654	06S65415Y38	RES,RK 123F 1/16 -CP
I.MX-P.W.Board			R5655	06S65415Y42	RES,RK 273F 1/16 -CP
I.MX-P.W.Board			R5657	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5658	06S65415Y59	RES,RK 684F 1/16 -CP
I.MX-P.W.Board			R5659	06S65415Y34	RES,RK 562F 1/16 -CP
I.MX-P.W.Board			R5700	06S15615Y73	RES,RK 103J 1/16 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5704	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5706	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5707	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5708	06S65415Y46	RES,RK 563F 1/16 -CP
I.MX-P.W.Board			R5710	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R5713	06-12176Z01	RES,RK R10F 1/5 -CP
I.MX-P.W.Board			R5714	06-12176Z01	RES,RK R10F 1/5 -CP
I.MX-P.W.Board			R5715	06S65415Y30	RES,RK 272F 1/16 -CP
I.MX-P.W.Board			R5716	06S65415Y17	RES,RK 221F 1/16 -CP
I.MX-P.W.Board			R5717	06S65415Y32	RES,RK 392F 1/16 -CP
I.MX-P.W.Board			R5718	06S65415Y17	RES,RK 221F 1/16 -CP
I.MX-P.W.Board			R5724	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5800	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R5801	06S65415Y43	RES,RK 333F 1/16 -CP
I.MX-P.W.Board			R5802	06S65415Y39	RES,RK 153F 1/16 -CP
I.MX-P.W.Board			R5803	06S65415Y35	RES,RK 682F 1/16 -CP
I.MX-P.W.Board			R5804	06S15594Y12	RES,RK 394F 1/10 -CP
I.MX-P.W.Board			R5805	06S15593Y92	RES,RK 623F 1/10 -CP
I.MX-P.W.Board			R5807	06S45674W81	RES,RK 103J 1/10 -CP
I.MX-P.W.Board			R5808	06S70072F77	RES,CP .103-J-1/4-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R5810	06S15593Y67	RES,RK 562F 1/10 -CP
I.MX-P.W.Board			R5811	06S15593Y94	RES,RK 753F 1/10 -CP
I.MX-P.W.Board			R6001	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R6002	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R6003	06S65415Y32	RES,RK 392F 1/16 -CP
I.MX-P.W.Board			R6004	06S65415Y20	RES,RK 391F 1/16 -CP
I.MX-P.W.Board			R6005	06S65415Y29	RES,RK 222F 1/16 -CP
I.MX-P.W.Board			R6006	06S65415Y42	RES,RK 273F 1/16 -CP
I.MX-P.W.Board			R6009	06-25919Z13	RES,RK 753F 1/16 -CP
I.MX-P.W.Board			R6010	06S65415Y58	RES,RK 564F 1/16 -CP
I.MX-P.W.Board			R6012	06S65415Y38	RES,RK 123F 1/16 -CP
I.MX-P.W.Board			R6013	06S65415Y30	RES,RK 272F 1/16 -CP
I.MX-P.W.Board			R6014	06S65415Y33	RES,RK 472F 1/16 -CP
I.MX-P.W.Board			R6015	06S15593Y93	RES,RK 683F 1/10 -CP
I.MX-P.W.Board			R6016	06S15594Y07	RES,RK 244F 1/10 -CP
I.MX-P.W.Board			R6019	06S65415Y30	RES,RK 272F 1/16 -CP
I.MX-P.W.Board			R6020	06S65415Y29	RES,RK 222F 1/16 -CP
I.MX-P.W.Board			R6021	06S65415Y32	RES,RK 392F 1/16 -CP
I.MX-P.W.Board			R6022	06S15593Y92	RES,RK 623F 1/10 -CP
I.MX-P.W.Board			R6023	06S15593Y67	RES,RK 562F 1/10 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R6030	06S45674W45	RES,RK 331J 1/10 -CP
I.MX-P.W.Board			R6102	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R6103	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R6104	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R6106	06S15615Y13	RES,RK 33RJ 1/16 -CP
I.MX-P.W.Board			R6107	06S15615Y13	RES,RK 33RJ 1/16 -CP
I.MX-P.W.Board			R6108	06S15615Y13	RES,RK 33RJ 1/16 -CP
I.MX-P.W.Board			R6109	06S15615Y13	RES,RK 33RJ 1/16 -CP
I.MX-P.W.Board			R6110	06S15615Y13	RES,RK 33RJ 1/16 -CP
I.MX-P.W.Board			R6113	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6114	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6115	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R6119	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6120	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6121	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6122	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6123	06S15615Y57	RES,RK 222J 1/16 -CP
I.MX-P.W.Board			R6210	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6211	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6212	06S15616Y23	RES,RK JUMPER1/16-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			R6213	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6214	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6215	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6216	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6217	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6218	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6219	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6220	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6221	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6222	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R6303	06S15615Y65	RES,RK 472J 1/16 -CP
I.MX-P.W.Board			R6304	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R6305	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R6307	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6309	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R6401	06S70072F41	RES,CP .331-J-1/4-CP
I.MX-P.W.Board			R6402	06S35083Y86	RES,RK 75RF 1/4 -CP
I.MX-P.W.Board			R6403	06S45674W57	RES,RK 102J 1/10 -CP
I.MX-P.W.Board			R6404	06S45674W57	RES,RK 102J 1/10 -CP
I.MX-P.W.Board			R6406	06S70072F41	RES,CP .331-J-1/4-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

I.MX-P.W.Board			R6407	06S35083Y86	RES,RK 75RF 1/4 -CP
I.MX-P.W.Board			R6408	06S45674W57	RES,RK 102J 1/10 -CP
I.MX-P.W.Board			R6409	06S45674W57	RES,RK 102J 1/10 -CP
I.MX-P.W.Board			R6410	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R6411	06S45674W81	RES,RK 103J 1/10 -CP
I.MX-P.W.Board			R6412	06S45674W73	RES,RK 472J 1/10 -CP
I.MX-P.W.Board			R6413	06S45674W93	RES,RK 333J 1/10 -CP
I.MX-P.W.Board			R6414	06S15615Y09	RES,RK 22RJ 1/16 -CP
I.MX-P.W.Board			R6415	06S15615Y81	RES,RK 223J 1/16 -CP
I.MX-P.W.Board			R6416	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R6418	06S45674W33	RES,RK 101J 1/10 -CP
I.MX-P.W.Board			R6419	06S70072F69	RES,CP .472-J-1/4-CP
I.MX-P.W.Board			R6420	06S45674W57	RES,RK 102J 1/10 -CP
I.MX-P.W.Board			R6421	06S70072F53	RES,CP .102-J-1/4-CP
I.MX-P.W.Board			R6422	06S70072F53	RES,CP .102-J-1/4-CP
I.MX-P.W.Board			R6423	06S70072F29	RES,CP .101-J-1/4-CP
I.MX-P.W.Board			R6424	06S70072F53	RES,CP .102-J-1/4-CP
I.MX-P.W.Board			R6425	06S70072F53	RES,CP .102-J-1/4-CP
I.MX-P.W.Board			R6426	06S70072F53	RES,CP .102-J-1/4-CP
I.MX-P.W.Board			R6427	06S70072F53	RES,CP .102-J-1/4-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			R6428	06S15615Y73	RES,RK 103J 1/16 -CP
I.MX-P.W.Board			R6431	06S15616Y23	RES,RK JUMPER1/16-CP
I.MX-P.W.Board			R6432	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R6433	06S15615Y25	RES,RK 101J 1/16 -CP
I.MX-P.W.Board			R6434	06S15615Y77	RES,RK 153J 1/16 -CP
I.MX-P.W.Board			R6439	06S15615Y61	RES,RK 332J 1/16 -CP
I.MX-P.W.Board			RA4000	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4001	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4002	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4003	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4004	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4005	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4006	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4007	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4008	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA4009	06S15771Y13	RES,ARYEXB28V101J-CP
I.MX-P.W.Board			RA5300	06S15771Y07	RES,ARYEXB28V33RJ-CP
I.MX-P.W.Board			RA5301	06S15771Y07	RES,ARYEXB28V33RJ-CP
I.MX-P.W.Board			RA6100	06S15771Y07	RES,ARYEXB28V33RJ-CP
I.MX-P.W.Board			RA6101	06S15771Y07	RES,ARYEXB28V33RJ-CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			RA6102	06S15771Y07	RES,ARYEXB28V33RJ-CP
I.MX-P.W.Board			RA6103	06S15771Y07	RES,ARYEXB28V33RJ-CP
I.MX-P.W.Board			SD5650	48-19296Z01	DIO,SHT RB056L-40-E1
I.MX-P.W.Board			SD5700	48-19296Z01	DIO,SHT RB056L-40-E1
I.MX-P.W.Board			SD5801	48-06526Z01	DIO,SHT RSX051VA30CP
I.MX-P.W.Board			SD6000	48-19296Z01	DIO,SHT RB056L-40-E1
I.MX-P.W.Board			SK5400	09-30387Z01	SKT,GT17HNF-4DP-2-DB
I.MX-P.W.Board			SK5700	09-31283Z01	SKT,UBAL-4R-D14-4SDB
I.MX-P.W.Board			TML5400	29-22483Z02	OG-453065 -E5
I.MX-P.W.Board			TML6300	29-22483Z02	OG-453065 -E5
I.MX-P.W.Board			XL4000	91-26661Z36	XTL,NX3225SAAG24.0CP
I.MX-P.W.Board			XL4001	91-26198Z03	XTL,NX3215 32.7NS-E1
I.MX-P.W.Board			XL5200	91-26661Z32	XTL,NX3225SAAG28.6CP
I.MX-P.W.Board			XL5300	91-26661Z24	XTL,NX3225SAAG25.0CP
I.MX-P.W.Board			XL6401	91-16024Z01	XTL,AT-41CD2 3.98-E9
I.MX-P.W.Board			ZD5100	48-28494Z01	DIO,ZEN ECMF04-4H-CP
I.MX-P.W.Board			ZD5101	48-28494Z01	DIO,ZEN ECMF04-4H-CP
I.MX-P.W.Board			ZD5200	48-28494Z01	DIO,ZEN ECMF04-4H-CP
I.MX-P.W.Board			ZD5201	48-28494Z01	DIO,ZEN ECMF04-4H-CP
I.MX-P.W.Board			ZD5202	48-16145Z20	DIO,ZEN PZU5.1B3 -CP

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
I.MX-P.W.Board			ZD5203	48-25907Z01	DIO,ZEN PESD5V0F1-CP
I.MX-P.W.Board			ZD5204	48-25907Z01	DIO,ZEN PESD5V0F1-CP
I.MX-P.W.Board			ZD5205	48-25907Z01	DIO,ZEN PESD5V0F1-CP
I.MX-P.W.Board			ZD5206	48-25907Z01	DIO,ZEN PESD5V0F1-CP
I.MX-P.W.Board			ZD6402	48-16145Z22	DIO,ZEN PZU5.6B2 -CP
I.MX-P.W.Board			ZD6403	48-16145Z22	DIO,ZEN PZU5.6B2 -CP
WIFI.ANT-P.W.Board			ANT9001	09-07494Z01	U.FL-R-SMT-1(80)-E2
WIFI.ANT-P.W.Board			C9003	08S45231Y40	CAP,CER 3R9C-CH1H-CP
Miscellaneous			ANT5502	09-24492Z04	ASSY,U.FL-2LP-066N1
Miscellaneous			ET3150	09-19615Z02	ASSY,ANID-0139-02A
Miscellaneous			M3490	59-14185Z03	MOTOR,ASB0412MA-9D11

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).

P.W.Board	MIS	MODEL	Ref.	Parts No.	Parts Name
-----------	-----	-------	------	-----------	------------

Model Code
X110-G

NOTE:The part that has not PART NUMBER will not be supplied.

#####

IC2000(*) :51-23912Z01(MTP,D70F3479AGJAQ-QT)

IC2202(*) :51-18520Z01(MX25L8035EM21-10G-ST)

IC3001(*) :51-30259Z02(S25FL116K0XMFA040-ST)

IC4300(*) :51-27465Z01(S29GL256S90TFI010-ST)

IC4400(*) :51-29432Z01(H26M41103HPR -BT)

Software is not written in to the part indicated with (*).